August 2015

SANTA MONICA BAY JURISDICTIONAL GROUP 2 AND 3 ENHANCED WATERSHED MANAGEMENT PLAN GROUP

### Revised Coordinated Integrated Monitoring Program (CIMP)

Submittal Date: June 27, 2014 Revision Submittal Date: June 15, 2015 Second Revision Submittal Date: August 10, 2015

Prepared by

City of Los Angeles, Los Angeles County Flood Control District, City of Santa Monica and City of El Segundo



The MWH Team







# **Table of Contents**

SECTIO	ON 1 INTRODUCTION	1
1.1	LACFCD BACKGROUND INFORMATION	1
1.2	SANTA MONICA BAY JURISDICTIONAL GROUP 2 AND 3 WATERSHED	
	MANAGEMENT PLAN AREA	
1.3	WATER QUALITY PRIORITIES	
1.4	CIMP OVERVIEW	
1.4	.1 Receiving Water Monitoring	12
1.4	.2 Stormwater Outfall Monitoring	12
1.4	.3 Non-Stormwater Outfall Program	12
1.4	.4 New Development and Redevelopment Effectiveness Tracking	13
1.4	.5 Regional Studies	13
1.4	.6 Special Studies	13
SECTIO	ON 2 RECEIVING WATER MONITORING PROGRAM	14
2.1	RECEIVING WATER MONITORING OBJECTIVES	14
2.2	RECEIVING WATER MONITORING SITES	14
2.2	.1 Santa Monica Bay (RW-SMB-1)	16
2.2	.2 Santa Monica Canyon Channel (RW-SMB-2)	18
2.2	.3 Santa Monica Bay (RW-SMB-3)	19
2.2	.4 TMDL Monitoring Site	21
2.3	MONITORED FREQUENCY, PARAMETERS, AND DURATION OF MONITORING	26
2.3	.1 Wet-Weather	26
2.3	.2 Dry-Weather	27
2.3	.3 SMB TMDLs	29
2.4	RECEIVING WATER MONITORING SUMMARY	30
SECTIO	ON 3 MS4 INFRASTRUCTURE DATABASE	32
3.1	PROGRAM OBJECTIVES	32
3.2	AVAILABLE INFORMATION	33
3.3	PENDING INFORMATION AND SCHEDULE FOR COMPLETION	36
SECTIO	ON 4 STORMWATER OUTFALL MONITORING	37
4.1	STORMWATER OUTFALL MONITORING OBJECTIVES	37

4.2	2	STORM	MWATER OUTFALL MONITORING SITES	37
	4.2.1	OF-S	SMB-1	39
	4.2.2	OF-S	SMB-2	41
	4.2.3	OF-S	SMB-3	43
	4.2.4	OF-S	SMB-4	45
4.3	3 ]	MONI	TORED FREQUENCY, PARAMETERS, AND DURATION	47
4.4	1 :	SUMM	ARY OF STORMWATER OUTFALL MONITORING	48
SEC	TION	N 5	NON-STORMWATER OUTFALL MONITORING PROGRAM	<b>19</b>
5.1	1 ]	NON-S	STORMWATER OUTFALL MONITORING OBJECTIVES	49
5.2	2 ]		STORMWATER OUTFALL SCREENING AND MONITORING PROGRAM	
5.3		IDENT	TIFICATION OF OUTFALLS WITH SIGNIFICANT NON-STORMWATER	
5.4	1 ]		NTORY OF MS4 OUTFALLS WITH NON-STORMWATER DISCHARGES	
5.5	5 ]	PRIOR	RITIZED SOURCE IDENTIFICATION	54
5.6	5		FICANT NON-STORMWATER DISCHARGE SOURCE IDENTIFICATION	
5.7	7 ]	NON-S	STORMWATER DISCHARGE MONITORING	56
	5.7.1	Non	-Stormwater Outfall-Based Monitoring Sites	56
	5.7.2	Mon	nitored Frequency, Parameters, and Duration of Monitoring	56
5.8	3 ]	NON-S	STORMWATER OUTFALL PROGRAM SUMMARY	57
~	TION		NEW DEVELOPMENT/RE-DEVELOPMENT EFFECTIVENESS	
			ROGRAM	
6.1			RAM OBJECTIVES	59
6.2			ING NEW DEVELOPMENT/RE-DEVELOPMENT TRACKING EDURES	59
6.3	3	SPECL	AL CONSIDERATIONS FOR DATA MANAGEMENT AND REPORTING	59
	6.3.1	Data	a Management	50
	6.3.2	Addi	itional Data	51
	6.3.3	Repo	orting	51
6.4			ARY OF NEW DEVELOPMENT/RE-DEVELOPMENT EFFECTIVENESS	
SEC	TION	N 7	REGIONAL STUDIES	55
7.1	1 ]	PROG	RAM OBJECTIVES	55

7.2	REGIO	ONAL STUDY PARTICIPATION	65
SECTI	ON 8	SPECIAL STUDIES	67
SECTI	ON 9	NON-DIRECT MEASUREMENTS	68
SECTI	ON 10	ADAPTIVE MANAGEMENT	69
10.1	INTEC	GRATED MONITORING AND ASSESSMENT PROGRAM	69
10.2	CIMP	REVISION PROCESS	69
SECTI	ON 11	REPORTING	71
11.1	DOCL	JMENTS AND RECORDS	71
11.	1.1 S	emi-Annual Analytical Data Submittal	71
11.	2 MO	NITORING REPORTS	72
11.	3 SIG	NATORY AND CERTIFICATION REQUIREMENTS	72
SECTI	ON 12	SCHEDULE FOR CIMP IMPLEMENTATION	74
SECTI	ON 13	REFERENCES	75

### List of Figures

Figure 1 Area within Santa Monica Bay Watershed and the Los Angeles Basin	3
Figure 2 Santa Monica Bay Participating Permittees*	4
Figure 3 Land Use	5
Figure 4 Santa Monica Bay JG 2/3 HUC-12 Subwatersheds	8
Figure 5 Participating Permitees with HUC-12, MS4 Drainage System and Outfalls	9
Figure 6 Receiving Water Monitoring Sites	15
Figure 7 Receiving Water Monitoring Site RW-SMB-1 and RW-SMB-2	17
Figure 8 Receiving Water Monitoring Site RW-SMB-3	20
Figure 9 TMDL Receiving Water Monitoring Sites	25
Figure 10 Effective Impervious Areas	35
Figure 11 Stormwater Outfall Monitoring Sites	38
Figure 12 Stormwater Outfall Monitoring Site OF-SMB-1	40
Figure 13 Stormwater Outfall Monitoring Site OF-SMB-2	42
Figure 14 Stormwater Outfall Monitoring Site OF-SMB-3	44
Figure 15 Stormwater Outfall Monitoring Site OF-SMB-4	46
Figure 16 Major Outfalls	52

### List of Tables

Table 1 Land Use Summaries	6
Table 2 Water Body Pollutant Prioritization	11
Table 3 RW-SMB-1 Receiving Water Monitoring Site Overview	18
Table 4 RW-SMB-2 Receiving Water Monitoring Site Overview	19
Table 5 RW-SMB-3 Receiving Water Monitoring Site Overview	21
Table 6 Receiving Water Monitoring Summary of Constituents to be Monitored and Annual         Frequency (wet/dry) <sup>(1)</sup>	27
Table 7 Santa Monica Bay Enhanced Watershed Management Program Group Low Flow         Diversions	28
Table 8 Santa Monica Bay Beaches Bacterial TMDL Sampling Frequency	29
Table 9 Summary of Receiving Water Monitoring Sites	31
Table 10 Information to be Collected for MS4 Database	36
Table 11 Stormwater Outfall Monitoring Site OF-SMB-1 Tributary Area (Castlerock – Parker Mesa Storm Drain)	

Table 12 Stormwater Outfall Monitoring Site OF-SMB-2 Tributary Area (Sullivan Canyon and Mandeville Canyon Storm Drains)	
Table 13 Stormwater Outfall Monitoring Site OF-SMB-3 Tributary Area (Pico-Kenter Storm Drain)	. 45
Table 14 Stormwater Outfall Monitoring Site OF-SMB-4 Tributary Area (Grand Avenue Storn Drain) <sup>1</sup>	
Table 15 List of Constituents for Stormwater Outfall Monitoring <sup>(1)</sup>	. 48
Table 16 Summary of Stormwater Outfall Monitoring Sites	. 48
Table 17 Known Major Outfalls in Santa Monica Channel and Rustic Canyon Creek	. 51
Table 18 Approach for Establishing Non-Stormwater Outfall Screening Process <sup>1</sup>	. 53
Table 19 Source Identification Types	. 55
Table 20 List of Constituents for Non-Stormwater Monitoring	. 57
Table 21 Development Review Process and Data Collection	. 61
Table 22 Example Data Collection Template	. 62

### List of Attachments

Attachment A:	Watershed Management Plan Area Background
Attachment B:	Monitoring Location Fact Sheets
Attachment C:	Analytical and Monitoring Procedures
Attachment D:	Photographic Log
Attachment E	Section 13 of Caltrans document No. CTSW-RT-03-105, Guidance Manual:
	Stormwater Monitoring Protocols
Attachment F	Background Information for Santa Monica Bay Debris TMDL TMRP and PMRP
	Justification
Appendix A:	Additional Watershed Information
Appendix B:	Example Field and Chain-of-Custody Forms

# LIST OF ACRONYMS

Acronym	Definition
40 CFR	Code of Federal Regulations
Basin Plan	Basin Plan for the Coastal Watersheds of Los Angeles and Ventura Counties
BMPs	Best Management Practices
Caltrans	California Department of Transportation
CERCLA	Comprehensive Environmental Response, Compensation, and Liability Act
CIMP	Coordinated Integrated Monitoring Program
County	Los Angeles County
CSMP	Coordinated Shoreline Monitoring Plan
CWA	Clean Water Act
CWC	California Water Code
DDT	Dichlorodiphenyltrichloroethane
EIA	Effective Impervious Area
EWMP	Enhanced Watershed Management Program
GIS	Geographic Information System
HUC-12	Hydrologic Unit Codes
IC/ID	Illicit Connection/Illicit Discharge
IMCR	Integrated Monitoring Compliance Report
IMP	Integrated Monitoring Program
JG2/3	Jurisdictional Group 2 and 3
LACDPW	County of Los Angeles Department of Public Works
LACFCD	Los Angeles County Flood Control District
LFD	Low Flow Diversion
LID	Low Impact Development
MAL	Municipal Action Limts
MCM	Minimum Control Measure
MES	Mass Emission Stations
MRP	Monitoring and Report Program
MS4	Municipal Separate Storm Sewer System
NPDES	National Pollutant Discharge Elimination System
PCB	Polychlorinated biphenyl
PCIS	Plan Check and Inspection System
Permit	Permit No. R4-2012-0175
PMRP	Pellets Monitoring and Reporting Plan
RAA	Reasonable Assurance Analysis
Regional Board	Los Angeles Regional Water Quality Control Board
RWL	Receiving Water Limitations
SCCWRP	Southern California Coastal Water Research Project

Acronym	Definition
SDTF	Standardized Data Transfer Format
SIC	Standard Industrial Classification System
SMB	Santa Monica Bay
SMB EWMP Group	Santa Monica Bay Enhanced Watershed Management Program Group
SMBBB	Santa Monica Bay Beaches Bacteria
SMC	Southern California Stormwater Monitoring Coalition
SMURRF	Santa Monica Urban Runoff Recycling Facility
SOP	Standard Operating Procedure
SWAMP	Surface Water Ambient Monitoring Program
TIE	Toxicity Identification Evaluation
TMDL	Total Maximum Daily Load
TMRP	Trash Monitoring and Reporting Plan
USEPA	U.S. Environmental Protection Agency
WBPCs	Water Body-Pollutant Combinations
WDID	State Waste Discharge Identification
WLA	Waste Load Allocations
WMA	Watershed Management Area
WQBEL	Water Quality-Based Effluent Limits

# Section 1 Introduction

In June 2013, the Cities of El Segundo, Los Angeles, and Santa Monica, together with the County of Los Angeles (County) and the Los Angeles County Flood Control District (LACFCD), collectively referred to as the Santa Monica Bay EWMP Group (SMB EWMP Group), submitted a notice of intent to develop an Enhanced Watershed Management Program (EWMP) and Coordinated Integrated Monitoring Program (CIMP) to fulfill the requirements of the National Pollutant Discharge Elimination System (NPDES) Municipal Separate Storm Sewer System (MS4) Permit No. R4-2012-0175 (Permit) for Los Angeles County issued by the Los Angeles Regional Water Quality Control Board (Regional Board). The Permit was adopted on November 8, 2012, by the Regional Board and became effective December 28, 2012. This Permit replaced the previous MS4 permit (Order No. 01-182). The purpose of the Permit is to ensure the MS4s in Los Angeles County are not causing or contributing to exceedances of water quality objectives set to protect the beneficial uses in the receiving waters in the Los Angeles region. The Permit allows the Permittees to customize their stormwater programs to achieve compliance with certain Receiving Water Limitations (RWL) and Water Quality-Based Effluent Limits (WQBELs).

The SMB EWMP Group's CIMP establishes the requirements presented in the Monitoring and Reporting Program (MRP) portion of the Permit, which are specified in Attachment E of the Permit. The primary objectives for the MRP are listed in Part II.A of the MRP, as follows:

- Assess the chemical, physical, and biological impacts of discharges from the MS4 on receiving waters;
- Assess compliance with RWLs and WQBELs established to implement Total Maximum Daily Load (TMDL) wet-weather and dry-weather waste load allocations (WLAs);
- Characterize pollutant loads in MS4 discharges;
- Identify sources of pollutants in MS4 discharges; and
- Measure and improve the effectiveness of pollutant controls implemented under the Permit.

As an option in the MRP, the SMB EWMP Group's CIMP proposes alternative approaches, with sufficient justification, to meet the primary objectives. Additionally, the CIMP includes TMDL monitoring requirements to unify monitoring efforts and to provide consistent observations of watershed conditions.

### 1.1 LACFCD BACKGROUND INFORMATION

In 1915, the Los Angeles County Flood Control Act was adopted by the California State Legislature after a disastrous regional flood took a heavy toll on lives and property. The act established the LACFCD and empowered it to manage flood risk and conserve stormwater for groundwater recharge. In coordination with the United States Army Corps of Engineers the LACFCD developed and constructed a comprehensive system that provides for the regulation and control of flood waters through the use of reservoirs and flood channels. The system also controls debris, protects existing vegetal covers, collects surface storm water from streets, and replenishes groundwater with storm water and imported and recycled waters. The LACFCD covers the 2,753 square-mile portion of Los Angeles County south of the east-west projection of Avenue S, excluding Catalina Island. It is a special district governed by the County of Los Angeles Board of Supervisors, and its functions are carried out by the Los Angeles County Department of Public Works. The LACFCD service area is shown in **Figure 1**. By statute, the LACFCD has limited powers and purposes, which places constraints on the types of projects and activities which the LACFCD may fund. Unlike cities and counties, the LACFCD does not own or operate any municipal sanitary sewer systems, public streets, roads, or highways. The LACFCD operates and maintains storm drains and other appurtenant drainage infrastructure within its service area. The LACFCD has no planning, zoning, development permitting, or other land use authority within its service area. The permittees that have such land use authority are responsible under the Permit for inspecting and controlling pollutants from industrial and commercial facilities, development projects, and development construction sites. (Permit, Part II.E, p. 17.)

The MS4 Permit language clarifies the unique role of the LACFCD in storm water management programs: "[g]iven the LACFCD's limited land use authority, it is appropriate for the LACFCD to have a separate and uniquely-tailored storm water management program. Accordingly, the storm water management program minimum control measures imposed on the LACFCD in Part VI.D of this Order differ in some ways from the minimum control measures imposed on other Permittees. Namely, aside from its own properties and facilities, the LACFCD is not subject to the Industrial/Commercial Facilities Program, the Planning and Land Development Program, and the Development Construction Program. However, as a discharger of storm and non-storm water, the LACFCD remains subject to the Public Information and Participation Program and the Illicit Connections and Illicit Discharges Elimination Program. Further, as the owner and operator of certain properties, facilities and infrastructure, the LACFCD remains subject to requirements of a Public Agency Activities Program." (Permit, Part II.F, p. 18.)

Consistent with the role and responsibilities of the LACFCD under the Permit, the [E]WMPs and CIMPs reflect the opportunities that are available for the LACFCD to collaborate with permittees having land use authority over the subject watershed area. In some instances, the opportunities are minimal, however the LACFCD remains responsible for compliance with certain aspects of the MS4 permit as discussed above.

#### 1.2 SANTA MONICA BAY JURISDICTIONAL GROUP 2 AND 3 WATERSHED MANAGEMENT PLAN AREA

Located in the South Santa Monica Bay Watershed, **Figure 1**, SMB EWMP Group is comprised of the five participating agencies: the Cities of El Segundo, Los Angeles, and Santa Monica, the County, and LACFCD, as shown in **Figure 2**. The total area of Jurisdictional Group 2 and 3 (JG2/3) is approximately 33,967 acres. The SMB EWMP Group area encompasses approximately 25,238 acres within JG2/3. The remaining JG2/3 area encompasses approximately 8,729 acres and includes land owned by U.S. Government, State of California, California Department of Transportation (Caltrans), Chevron, and El Segundo Generation Station. Also excluded from the geographical scope are the beaches. These agencies/organizations are not participants of the SMB EWMP Group. Approximate land area and land use summaries for the JG2/3 area are presented in **Figure 3** and listed in **Table 1**. The most prevalent land uses are open space and residential. Commercial, industrial, educational facilities, and transportation land uses constitute minor portions of the jurisdictions within SMB EWMP Group area.



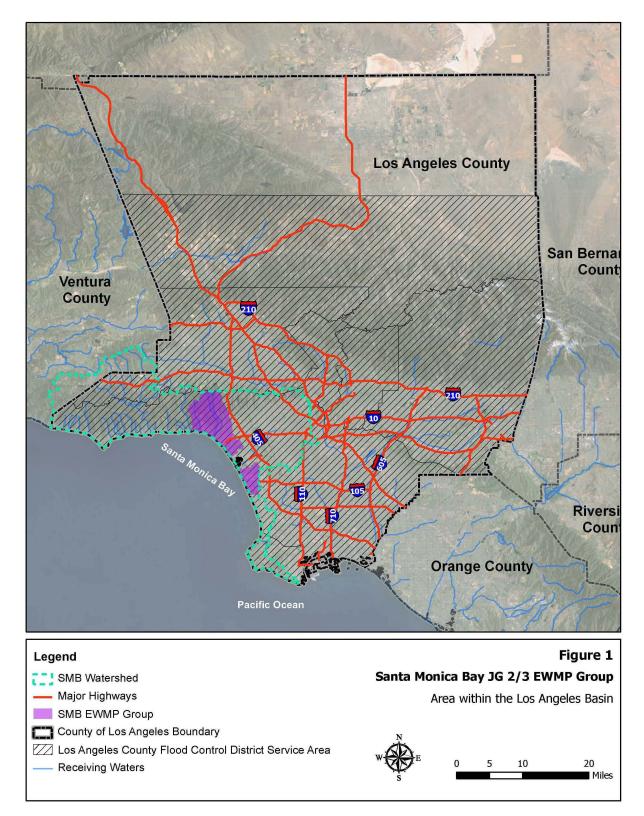


Figure 1 Area within Santa Monica Bay Watershed and the Los Angeles Basin



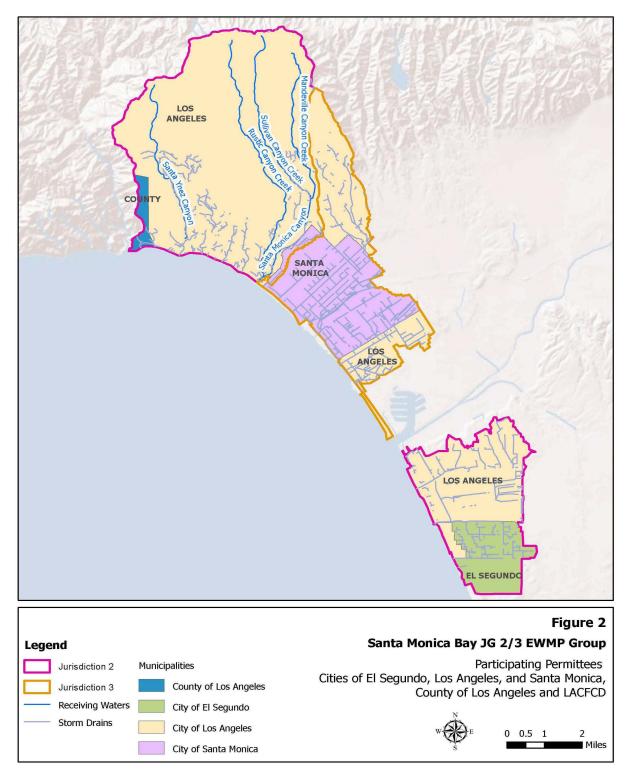

Lands owned by U.S. Government, State of California, California Department of Transportation (Caltrans), Chevron, beaches and El Segundo Generation Station are excluded from the geographical scope.

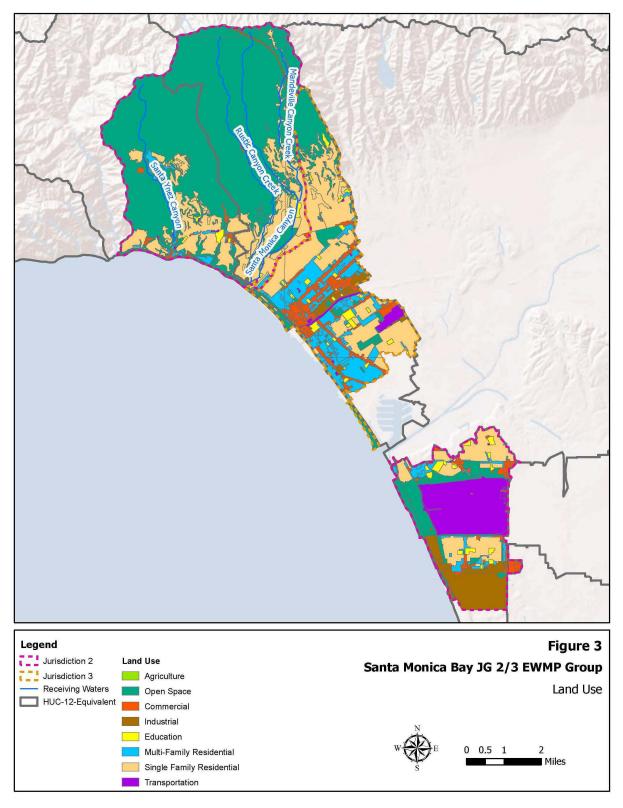



				Land Use St	immaries					
	Los Angeles County				El Segundo		Total*			
Land Use	Acres	% of Total	Acres	% of Total	Acres	% of Total	Acres	% of Total	Acres	% of Total
Agriculture	0	0%	16.37	0.06%	0%	0%	0%	0%	16.37	0.05%
Commercial	1.7	0.44%	537.83	2.04%	929.33	18.64%	183.65	8.42%	1,652.51	4.87%
Industrial	0	0%	270.88	1.03%	230.74	4.63%	1,065.28	48.87%	1566.9	4.61%
Education	0	0%	323.56	1.23%	185.77	3.73%	58.97	2.71%	568.3	1.67%
Multi-Family Residential	7.19	1.85%	1,062.18	4.02%	1,536.01	30.80%	164.33	7.54%	2,769.71	8.15%
Single Family Residential	108.36	27.87%	6,387.27	24.18%	1,595.21	31.99%	556.86	25.54%	8647.7	25.46%
Open Space	271.6	69.85%	15,741.17	59.60%	271.75	5.45%	138.88	6.37%	1,6423.4	48.35%
Transportation	0	0%	2,072.33	7.85%	237.92	4.77%	12.04	0.55%	2,322.29	6.84%
Total	388.85	100%	26,411.59	100%	4,986.73	100%	2,180.01	100%	33,967.18	100%

Table 1 Land Use Summaries

\*Total area for J2/3 – the area for the EWMP group is 25,238 acres

JG2 encompasses Castle Rock, Dockweiler, Pulga Canyon, Santa Monica Canyon, Santa Ynez, and Venice Beach watersheds as defined by the Regional Board. JG3 covers a small section from Santa Monica Canyon and north of the Santa Monica Freeway at the ocean to north of Marina del Rey/Venice area. The receiving waters defined by the Water Quality Control Plan, Los Angeles Region (Basin Plan) (Regional Board, 1995, Updated 2011) within the SMB EWMP Group area include:

- Santa Monica Bay
- Santa Monica Canyon Channel
  - o Rustic Canyon Creek
  - Mandeville Canyon Creek
  - Sullivan Canyon Creek
- Santa Ynez Canyon

Attachment B of the MS4 Permit, mapped United States Geological Survey Hydrologic Units, and other features, based on Hydrologic Unit Codes (HUC-12) watershed boundaries. In-lieu of these specified boundaries, the March 26, 2014 Regional Board Reasonable Assurance Analysis (RAA) Guidelines allows the EWMP group to use HUC-12 equivalent watersheds, prepared by the LACFCD. Using the LACFCD HUC-12 layer and numbering conventions, the LACFCD HUC-12 boundaries, relevant to the SMB EWMP Group, are shown in **Figure 4** and identified as follows:

- Santa Monica Beach Frontal Santa Monica Bay (180701040403)
- Santa Monica Canyon (180701040402)
- Manhattan Beach Frontal Santa Monica Bay (180701040500)

The five-agency jurisdictional boundaries, HUC-12, MS4 drainage system, and outfall locations within JG2/3 are shown in **Figure 5**. Attachment A provides additional watershed background, including TMDL monitoring requirements and existing monitoring programs.

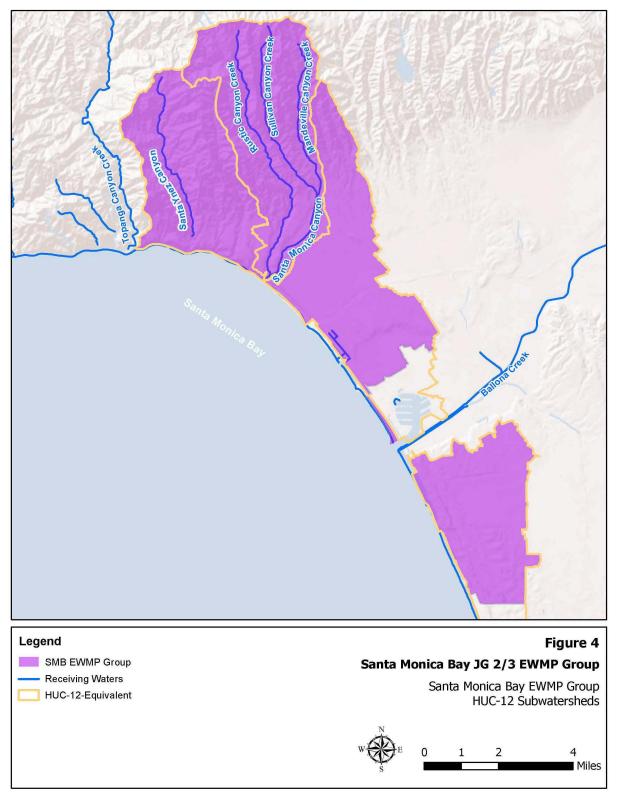


Figure 4 Santa Monica Bay JG 2/3 HUC-12 Subwatersheds

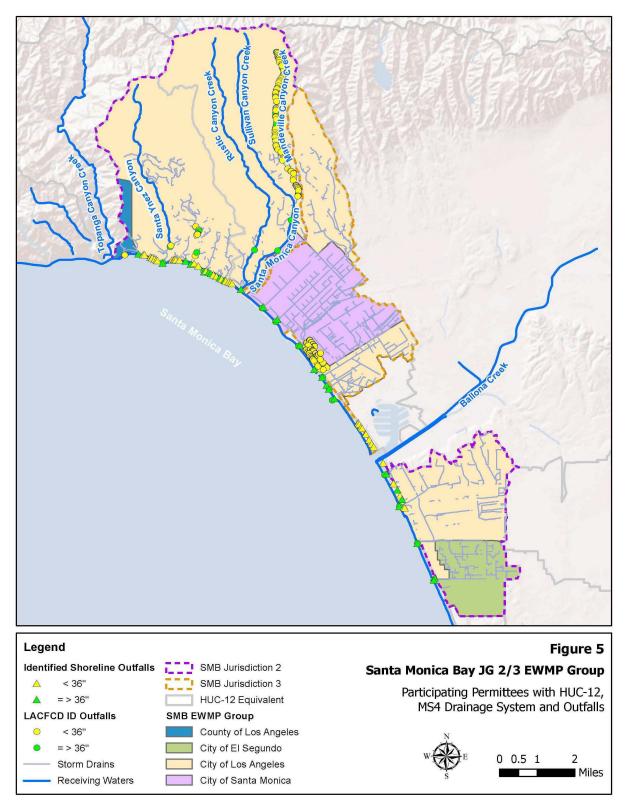


Figure 5 Participating Permitees with HUC-12, MS4 Drainage System and Outfalls

#### 1.3 WATER QUALITY PRIORITIES

Based on the water quality characterization, the water body–pollutant combinations (WBPCs) have been classified into one of three categories, in accordance with Section IV.C.5(a)ii of the Permit. The three categories, as defined by the Permit, are as follows:

- **Category 1**: Water body-pollutant combinations under Category 1 (highest priority) are defined in the Permit as "water body-pollutant combinations for which water quality-based effluent limitations and/or receiving water limitations are established in Part VI.E and Attachments L through R [of *the Permit*]."
- Category 2: (high priority) water body-pollutant combinations are defined as "pollutants for which data indicate water quality impairment in the receiving water according to the State's Water Quality Control Policy for Developing California's Clean Water Act Section 303(d) List (State Listing Policy) and for which MS4 discharges may be causing or contributing to the impairment."
- **Category 3**: (Medium Priority) designations are to be applied to water body-pollutant combinations that are not 303(d)-listed, but which exceed applicable receiving water limitations contained in the Permit and for which MS4 discharges may be causing or contributing to the exceedance.

Water quality priorities are then identified based on the WBPC categories compliance deadlines for the SMB EWMP. This categorization is intended to prioritize WBPCs in order to guide the implementation of structural and institutional best management practices (BMPs) and monitoring activities in the CIMP. Through this process, the Priority 1 WBPC has been identified as summer and winter dry-weather bacteria and wet-weather bacteria. **Table 2** presents the identified water quality priorities and the WBPC categories.

As part of the adaptive management process, categorization of WBPCs may be adjusted based on data obtained from monitoring, source evaluations, and BMP implementation. Data collected as part of the approved CIMP may result in future Category 3 designations in instances when receiving water limits are exceeded and MS4 discharges are identified as contributing to such exceedances. Under these conditions, the appropriate agencies will adhere to Section VI.C.2.a.iii of the Permit.

Additional details and supporting information for monitoring to address priorities can be found in **Attachment A**.

Category	Water Body	Pollutant	Compliance Deadline		
	SMB Beaches	Summer dry weather bacteria	7/15/2006 (Final: Single sample summer AEDs met)		
			7/15/2009 (Interim: 10% single sample ED reduction)		
			7/15/2013 (interim: 25% single sample ED reduction)		
	SMB Beaches	Wet weather bacteria	7/15/2018 (Interim: 50% single sample ED reduction)		
			7/15/2021 (Final: Single sample AED)		
			7/15/2021 (Final: Geometric Mean [GM])		
	SMB Beaches	Winter dry weather bacteria	7/15/2009 (Final: Single sample winter AEDs) <sup>1</sup>		
1	SMB Offshore/ Nearshore		3/20/2016 (20% load reduction)		
1			3/20/2017 (40% load reduction)		
		Debris	3/20/2018 (60% load reduction)		
			3/20/2019 (80% load reduction)		
			3/20/2020 (100% load reduction)		
	SMB	DDTs	[Compliance schedule to be developed through the $EWMP$ ] <sup>2</sup>		
	SMB	PCBs	[Compliance schedule to be developed through the EWMP] <sup>2</sup>		
2	Santa Monica Canyon Channel	Lead	NA		
2	Santa Monica Canyon Channel	Indicator bacteria	NA		
3	None	None	None		

Table 2Water Body Pollutant Prioritization

<sup>1</sup> The compliance date of 7/15/2009 will be used instead of 11/1/2009 to coordinate with the summer dry weather and wet weather 7/15 compliance dates. In addition, the 2013 reopener TMDL compliance date became effective on July 2, 2014.

 $^{2}$  Although the TMDL lacks a formal compliance schedule for the WQBEL, the TMDL Executive Summary does state, "The time frame for attainment of the TMDL targets for the rest of Santa Monica Bay (other than the Palos Verdes shelf) is 11 years for DDT and 22 years for PCBs."

#### 1.4 CIMP OVERVIEW

The CIMP is designed to provide the information necessary to guide management decisions in addition to providing a means to measure compliance with the Permit. The SMB EWMP Group's CIMP is composed of six elements:

- 1. Receiving Water Monitoring
- 2. Stormwater Outfall Monitoring
- 3. Non-Stormwater Outfall Monitoring
- 4. New Development and Redevelopment Effectiveness Tracking
- 5. Regional Studies
- 6. Special Studies

Each of the six CIMP elements is discussed below.

#### 1.4.1 Receiving Water Monitoring

Receiving water monitoring is intended to assess whether water quality objectives are being achieved, to determine if beneficial uses are being supported, and to track trends in constituent concentrations over time. Three receiving water monitoring sites were selected. **Section 2** discusses SMB EWMP Group's receiving water monitoring program.

#### 1.4.2 Stormwater Outfall Monitoring

Stormwater outfall monitoring assesses compliance with municipal action limits (MALs), WQBELs derived from TMDL WLAs, as well as the potential to have caused or contributed exceedances of RWLs derived from TMDL WLAs or receiving water quality objectives.

The majority of storm drains within the SMB EWMP Group generally drain towards Santa Monica Bay. Four stormwater outfall monitoring sites were selected. The four monitoring sites comprise about 45.7% of the drainages area of the SMB EWMP Group. The selected sites are representative of a combination of the HUC-12s, jurisdictions, and/or land uses within each drainage area that they have been chosen to represent. A synopsis of each potential outfall drainage area, along with an analysis of its land use/zoning characteristics is summarized in **Section 4**.

#### 1.4.3 Non-Stormwater Outfall Program

The SMB EWMP Group has been addressing non-stormwater flow to Santa Monica Bay since the late 1990s and has installed 23 low flow diversions (LFDs) along the Santa Monica Bay shoreline within the J2/J3 EWMP geographical scope. To further fulfill the Permit requirements, the MRP requires Permittees to implement a non-stormwater outfall based screening and monitoring program. The Non-Stormwater Outfall Screening and Monitoring Program (Non-Stormwater Program) is focused on Non-Stormwater discharges to receiving waters from MS4 outfalls.

The Non-Stormwater Program will collect information necessary to identify significant Non-Stormwater discharges and conduct the screening process and prioritization prior to Non-Stormwater outfall monitoring. Additional details of the Non-Stormwater Program are presented in **Section 5**.

#### 1.4.4 New Development and Redevelopment Effectiveness Tracking

The New Development/Re-Development Effectiveness Tracking is required to identify the information necessary for data management and annual compliance reporting. Each jurisdiction will be individually responsible for tracking Permit requirements, based on their specific operational procedures and internal processes. The SMB EWMP Group will maintain an informational database record for each new development/re-development project subject to the minimum control measure (MCM) and their adopted Low Impact Development (LID) Ordinance. In addition, to the SMB EWMP Group will implement a tracking system for new development/re-development projects that have been conditioned for post-construction BMPs. Section 6 presents the new development and redevelopment effectiveness tracking system for the SMB EWMP Group.

#### 1.4.5 Regional Studies

Only one regional study is identified in the MRP: Southern California Stormwater Monitoring Coalition (SMC), which is overseen by the Southern California Coastal Water Research Project (SCCWRP). The SMB EWMP Group is continuing to participate and support several SMC research studies, including the most recent SMC study, Bioassessment Monitoring Program. The SMB EWMP will continue to coordinate with SCCWRP and participate in regional studies. **Section 7** presents the regional studies approach for the SMB EWMP Group.

#### 1.4.6 Special Studies

The MRP requires each Permittee to be responsible for conducting special studies required in an effective TMDL or an approved TMDL Monitoring Plan. Special studies options are further discussed in **Section 8**.

# Section 2 Receiving Water Monitoring Program

Receiving water monitoring will be conducted in Santa Monica Bay and Santa Monica Canyon Channel.

As outlined in the MRP, receiving water monitoring is intended to assess whether water quality objectives are being achieved and beneficial uses are being supported, as well as to track trends in constituent concentrations over time. The requirements in the MRP for selecting receiving water monitoring sites include utilizing receiving water monitoring sites at previously designated Los Angeles County Department of Public Works (LACDPW) mass emission stations (MES), TMDL receiving water compliance points, and additional receiving water locations representative of the impacts from MS4 discharges. Through the evaluation of previously-utilized and existing receiving water monitoring sites, as summarized in Attachment A, no existing MES were located. Additionally, other existing receiving water monitoring sites located in relation to the SMB EWMP Group's jurisdictional area were not considered. These existing receiving water monitoring sites located in an area that will achieve monitoring objectives for the represented existing monitoring programs. However, these monitoring sites may not accurately assess the overall impact of the MS4 outfalls. For other listed receiving water bodies within the SMB EWMP Group, there are no existing monitoring locations. New receiving water monitoring locations were selected and are summarized in the following sections.

#### 2.1 RECEIVING WATER MONITORING OBJECTIVES

The objectives of the receiving water monitoring include the following (Part II.E.1 of the MRP):

- Determine whether the receiving water limitations are being achieved;
- Assess trends in pollutant concentrations over time, or during specified conditions; and
- Determine whether the designated beneficial uses are fully supported as determined by water chemistry, as well as aquatic toxicity and bioassessment monitoring.

#### 2.2 RECEIVING WATER MONITORING SITES

The primary objective of receiving water monitoring is to assess trends in pollutant concentrations over time, or during specified conditions. For that reason, the primary characteristics of an ideal receiving water monitoring site is that it has a large dataset from previously-collected monitoring events so that trends in pollutant concentration over time, or during specified conditions, can be assessed.

As previously indicated, existing receiving water monitoring sites within the SMB EWMP Group were not considered. For other listed receiving water bodies within the SMB EWMP Group, there are no existing monitoring locations. Through these findings, new receiving water monitoring sites were chosen to assess whether water quality objectives are being achieved and beneficial uses are being supported, as well as to track trends in constituent concentrations over time.

Three receiving water monitoring sites were chosen, two within Santa Monica Bay (RW-SMB-1 and RW-SMB-3) and one within Santa Monica Canyon Channel (RW-SMB-2). **Figure 6** presents the approximate locations of the receiving water monitoring sites for SMB EWMP Group including TMDL monitoring sites. Fact sheet summary for each receiving water monitoring site is presented in **Attachment B**.

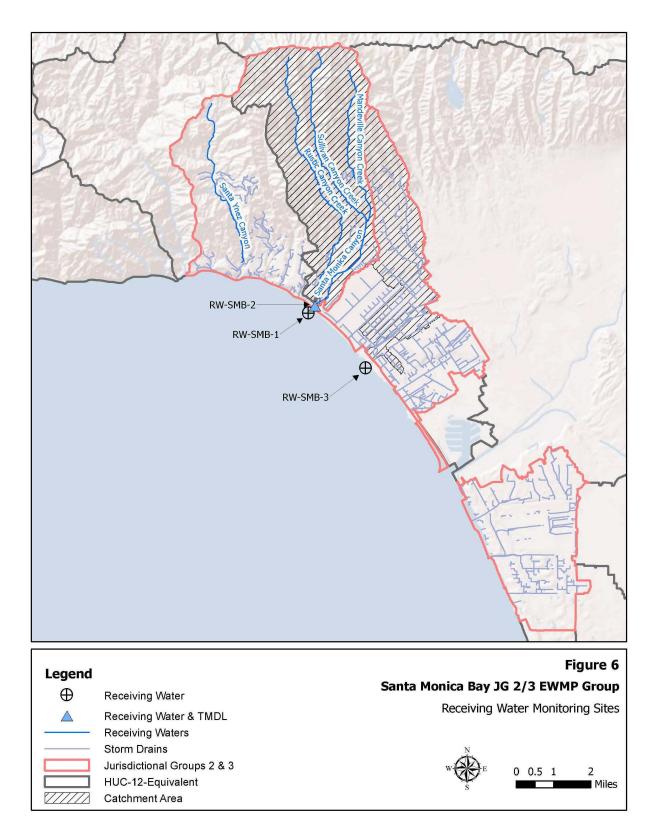


Figure 6 Receiving Water Monitoring Sites

#### 2.2.1 Santa Monica Bay (RW-SMB-1)

Located within Santa Monica Bay, RW-SMB-1 will be monitored at the point of initial mixing and will be dependent on the intensity of a qualifying storm event. Samples will be collected within plumes, in the ocean, generated during a qualifying storm event, in the vicinity and across from Santa Monica Canyon Channel (SMBBB TMDL monitoring location SMB 2-7). Grab samples will be collected, via boat in accordance with the Los Angeles County ordinance, when it has been deemed safe for collection by the Captain of the boat.

Receiving water monitoring site RW-SMB-1 will represent the drainage characteristics of JG2. As the point of initial mixing will be a mixing of waters from Santa Monica Bay and Santa Monica Canyon Channel, the represented catchment area within SMB EWMP Group and the approximate location of RW-SMB-1 is presented in **Figure 7**. Catchment area from RW-SMB-1 represents approximately 40.36% of the total JG2 area.

The Cities of El Segundo, Los Angeles, and Santa Monica and the County of Los Angeles are all represented in the JG2 area. Drainage from the catchment area is primarily from the City of Los Angeles and a small portion from the City of Santa Monica. Primary land uses in the JG2 area and the catchment area of RW-SMB-1 are open space and single family residential. Given that the land uses of JG2 and the catchment area are comparable, monitoring at RW-SMB-1 will be representative in order assess the impact of JG2 MS4 to Santa Monica Bay. **Table 3** presents the land use composition of JG2 and the catchment area of RW-SMB-1.

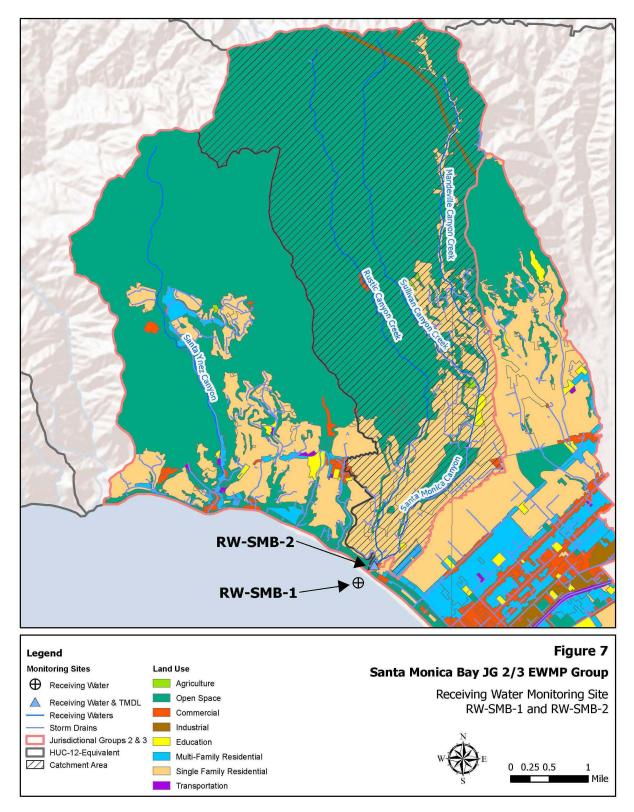


Figure 7 Receiving Water Monitoring Site RW-SMB-1 and RW-SMB-2

RW-SMD-1 Receiving Water Monitoring Site Overview								
	Catchme	ent Area	JG	<b>F</b> 2				
	Acres	% of Total	Acres	% of Total				
Land Use								
Agricultural	12.82	0.13%	16.37	0.07%				
Commercial	35.01	0.35%	529.39	2.12%				
Industrial	60.92	0.61%	1,304.25	5.23%				
Education	35.14	0.35%	294.1	1.18%				
Single Family Residential	2,089.65	20.81%	5,160.31	20.71%				
Multi-Family Residential	46.1	0.46%	597.68	2.40%				
Open Space	7,764.02	77.30%	14,945.23	59.97%				
Transportation	0%	0%	2,074.91	8.33%				
Total	10,043.66	100%	24,922.24	100%				
Jurisdictions								
City of Los Angeles	9,778	97.35%	22,087	88.62%				
City of Santa Monica	266	2.65%	266	1.07%				
City of El Segundo	0%	0%	2,180	8.75%				
County of Los Angeles	0%	0%	389	1.56%				

 Table 3

 RW-SMB-1 Receiving Water Monitoring Site Overview

#### 2.2.2 Santa Monica Canyon Channel (RW-SMB-2)

Monitoring site RW-SMB-2 will be used for receiving water monitoring in Santa Monica Canyon Channel. Santa Monica Canyon Channel is a receiving water body that flows into Santa Monica Bay. The outlet structure is a 40-feet by 12-feet channel. Monitoring site RW-SMB-2 will be located upstream of the LFD weir in Santa Monica Canyon Channel. RW-SMB-2 will be used to represent monitoring of runoff from Santa Monica Canyon Channel, Rustic Canyon, Mandeville Canyon, and Sullivan Canyon Creeks. Collection of samples will be done utilizing a fixed continuous autosampler. The catchment area of RW-SMB-2 will encompass 100% of the Santa Monica Canyon (180701040402) HUC-12 jurisdictional area of SMB EWMP Group.

Catchment areas for RW-SMB-1 and RW-SMB-2 are identical, but the representative samples will differ as RW-SMB-1 will characterize the mixing of Santa Monica Canyon Channel with Santa Monica Bay, and RW-SMB-2 will characterize the runoff from Santa Monica Canyon Channel and all upstream creeks.

As summarized in **Section 2.2.1**, the drainage from the catchment area is primarily from the City of Los Angeles and a small portion is from the City of Santa Monica. Primary land uses from the catchment area of RW-SMB-2, shown in **Figure 7**, are open space and single family residential. **Table 4** shows the land use composition within the RW-SMB-2 catchment area, HUC-12, and SMB EWMP Group area.

RW-SMD-2 Receiving Water Monitoring Site Overview						
	Catchment Area		HUC			
	Acres	% of Total	Acres	% of Total		
Land Use						
Agriculture	12.82	0.13%	12.82	0.13%		
Commercial	35.01	0.35%	35.01	0.35%		
Industrial	60.92	0.61%	60.92	0.61%		
Education	35.14	0.35%	35.14	0.35%		
Single Family Residential	2,089.65	20.81%	2,089.65	20.81%		
Multi-Family Residential	46.1	0.46%	46.1	0.46%		
Open Space	7,764.02	77.30%	7,764.02	77.30%		
Transportation	0	0%	0	0%		
Total	10,043.66	100%	10,043.66	100%		
Jurisdictions						
City of Los Angeles	9,778	97.35%	9,778	97.35%		
City of Santa Monica	266	2.65%	266	2.65%		
City of El Segundo	0	0%	0	0%		
County of Los Angeles	0	0%	0	0%		

 Table 4

 RW-SMB-2 Receiving Water Monitoring Site Overview

#### 2.2.3 Santa Monica Bay (RW-SMB-3)

Similar to RW-SMB-1, RW-SMB-3 will be located at the point of initial mixing and will be dependent on the intensity of a qualifying storm event. Samples will be collected within plumes generated during a qualifying storm event, in the vicinity and across from Pico Kenter storm drain (SMBBB TMDL monitoring location SMB 3-4). The samples will be collected via a boat and grab samples will be collected, when it has been deemed safe for collection by the Captain of the boat.

RW-SMB-3 will be monitored to represent the characteristic of the drainage from the JG3 area. The catchment area within SMB EWMP Group area and approximate location for receiving water monitoring site RW-SMB-3 are shown in **Figure 8**. RW-SMB-3 catchment area captures approximately 51.63% of JG3 and drains into Santa Monica Bay.

The represented agencies and discharge from the catchment area within the JG3 area are the Cities of Los Angeles and Santa Monica. Each of the eight land use categories, as shown on **Table 5**, is represented in the catchment area within SMB EWMP Group area and JG3. For both the catchment area and JG3, the primary land uses are single- and multi-family residential, open space, and commercial. Based on these similarities, RW-SMB-3 is an ideal receiving water monitoring site and is critical to the SMB EWMP Group will be valuable for assessing the impact of JG3's discharges on the receiving water.

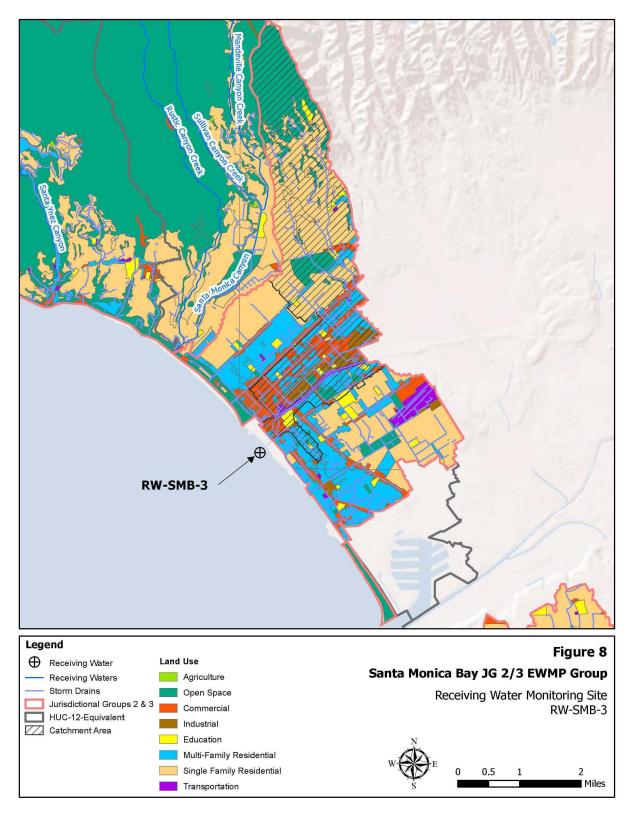


Figure 8 Receiving Water Monitoring Site RW-SMB-3

RW-SWD-S Receiving Water Monitoring Site Overview					
	Catchn	Catchment Area		G3	
	Acres	% of Total	Acres	% of Total	
Land Use					
Agricultural	0	0%	0	0%	
Commercial	602.74	13.02%	1123.12	12.40%	
Industrial	219.94	4.75%	262.64	2.90%	
Education	137.38	2.97%	274.21	3.03%	
Single Family Residential	1,786.79	38.60%	3,487.38	38.50%	
Multi-Family Residential	696.42	15.04%	2,172.03	23.98%	
Open Space	1,106.71	23.91%	1,490.23	16.45%	
Transportation	79.02	1.71%	247.38	2.73%	
Total	4,629	100%	9,056.99	100%	
Jurisdictions					
City of Los Angeles	2,760	59.62%	4,242	47.33%	
City of Santa Monica	1,869	40.38%	4,721	52.67%	
City of El Segundo	0	0%	0	0%	
County of Los Angeles	0	0%	0	0%	

 Table 5

 RW-SMB-3 Receiving Water Monitoring Site Overview

#### 2.2.4 TMDL Monitoring Site

Receiving water TMDL monitoring sites within the SMB EWMP Group area are required for Santa Monica Bay. Attachment A presents the TMDL monitoring requirements for the SMB EWMP Group, and the TMDLs are as follows:

- Santa Monica Bay Beaches Bacteria TMDL (Wet and Dry), July 15, 2003 (SMBBB TMDL);
- Santa Monica Bay TMDL for Total Dichlorodiphenyltrichloroethane (DDTs) and Polychlorinated biphenyls (PCBs), March 26, 2012 (SMB DDT and PCB TMDL); and
- Santa Monica Bay Nearshore and Offshore Debris TMDL, March 20, 2012 (SMB Debris TMDL).

To satisfy the receiving water monitoring requirements for the SMBBB TMDL, 24 existing monitoring sites, presented in **Figure 9**, will continue to be monitored in accordance to the coordinated shoreline monitoring plan (CSMP).

The SMB DDT and PCB TMDL monitoring will be conducted to provide credible estimates of the total mass loading, as each Permittee is required to show compliance. Given that Santa Monica Canyon (180701040402) HUC-12 was identified as one of the highest loading watersheds<sup>1</sup> to Santa Monica Bay, RW-SMB-2 monitoring site will be used to provide relevant data and to fulfil the SMB DDT and PCB TMDL receiving water monitoring requirements. As stated in **Section 2.2.2** above, the catchment area of RW-SMB-2 encompasses 100% of the Santa Monica Canyon (180701040402) HUC-12 jurisdictional area of the SMB EWMP Group. Santa Monica Canyon is approximately 77% open space which is a

<sup>&</sup>lt;sup>1</sup> United States Environmental Protection Agency, Region IX, 2013, Santa Monica Bay Total Maximum Daily Loads for DDTs and PCBs. March 2013

close representation of J2/J3 EWMP area as a whole which contains approximately 49% open space. As a result, monitoring for SMB DDT and PCB TMDL at RW-SMB-2 is appropriate to determine the total waste load allocation of the SMB EWMP Group. Additionally, the DDT/PCB data from Ballona Creek with 83% urbanized area will be used (by way of extrapolation) to ensure the compliance with the waste load allocation for DDT/PCB storm born sediment is accurately determined and reported. All data will be shared with the permittees of the J2/J3 EWMP group for reporting purposes.

Samples will be collected using autosamplers and sufficient volume of stormwater will be collected to allow for an accurate measurement of TSS. Additional sample collection procedures and analysis discussion can be found in **Attachment C Section 2.4.7**.

SMB Debris TMDL does not require receiving water monitoring, and the SMB EWMP Group is not required to conduct any type of monitoring if it is complying with the WLAs through the implementation of BMPs, such as full capture systems.

Permittees are to report compliance strategy through the development of a Trash Monitoring and Reporting Plan (TMRP) and Plastic Pellets Monitoring and Reporting Plan (PMRP), or demonstrate that a PMRP is not required, to be approved by the Regional Board. Once the TMRP and PMRP are approved and adopted, a progress report based on installation of structural BMPs, such as full capture or partial capture systems, institutional controls, or any BMPs, is to be reported in order to calculate the reduction in the amount of trash and plastic pellets, if applicable, being discharged into Santa Monica Bay.

Each of the jurisdictions within SMB EWMP Group have submitted a TMRP and PMRP. Each jurisdiction has conducted the following:

- City of El Segundo: A TMRP was submitted in 2014 for review and approval. The City of El Segundo conducted a search, within the City's boundaries, of standard industrial classification system (SIC) codes for manufactures using plastic pellets. From the search, two facilities with SIC codes for manufactures using plastic pellets were found within the City of El Segundo portion of the SMB EWMP Group area. One of the facilities, Henry Company located at 999 N. Sepulveda Boulevard, Suite 800 was discovered to be an administrative corporate office. Manufacturing, storing, handling, and/or transportation are not conducted at this location. A facility inspection was conducted at the second facility, International Plastic Cards (IPC), Inc located at 1475 E. El Segundo Boulevard. During the inspection, City of El Segundo staff confirmed that the manufacturing of the plastic cards were not conducted at this location. The plastic cards are pre-manufactured and pre-packaged at an off-site facility and IPC is only involved in the personalization of the cards, such as printing name and number on the cards. A copy of the letter from the City of El Segundo incorporating further details of the SIC code search and rational for exemption from PMRP monitoring is included in **Attachment F**. **Attachment F** also includes the City of El Segundo's Emergency Spill and Response Plan.
- City of Los Angeles: The *Trash TMDL Compliance Method: Structural Measures* was submitted in September 2011 and was adopted as the TMRP for the City of Los Angeles. The City of Los Angeles current MFAC Program in the 2012 TMRP for Santa Monica Bay Nearshore and Offshore Debris TMDL only covers Ocean Front Walk and associated recreational facilities. This area is one of the most popular beach attraction areas of Santa Monica Bay that lie within the City of Los Angeles, with an estimated 16 million visitors per year. The current MFAC already requires trash collection/disposal 7 days of week, by the City's Recreation and Parks staff, to ensure an aesthetic pleasing environment for all visitors. Due to the large number of visitors as well as City staff present on a daily basis, any unsightly accumulation of trash would be immediately reported and immediately addressed to prevent any disbursement into the receiving water. Therefore, in the City's opinion no further actions are necessary since maintaining a trash free area is in the best interest of the City. Though, the City as part of its Santa Monica Bay Nearshore and Offshore Debris TMDL Trash Annual Report, the first to be

submitted in December 2016 (20% compliance milestone in March 2016), will include documentation that the City is fulfilling its obligations under the MFAC to the Regional Board.

An investigation of industries with SIC codes associated with manufacturing or use of plastic pellets within the City of Los Angeles was conducted. The investigation was conducted using the following procedure:

- 1. A list of all facilities within the City of LA that have SIC codes identified by the Nearshore/Off shore TMDL associated with their permit was obtained. Over a thousand facilities were identified and included in the list.
- 2. By a process of elimination and random calling survey, the list was narrowed down to a list of 171. The list has been included in **Attachment F**.
- 3. This list of 171 was geocoded to identify and extract a list of facilities within Santa Monica Bay watershed (including Ballona Creek and Marina Del Rey). This further narrowed down the candidates to a list of 23 facilities that could potentially be involved in an operation with plastic pellets. The list is also included in **Attachment F**.
- 4. The geocoded map showed none of the facilities were located within the J2/J3 of the Santa Monica Bay watershed.

Through this investigation, it was found that no facilities were located within the City of Los Angeles for the SMB EWMP Group area. Furthermore, with the exception of Ballona Creek, the land uses of all other City of Los Angeles sub-watersheds draining into the Santa Monica Bay from Castle Rock to Dockweiler are residential with limited commercial facilities. Additionally, there are no railways within these sub-watersheds, and the only roadway for transportation is Pacific Coast Highway (PCH), which falls under the Caltrans jurisdiction. As a result, Santa Monica Bay watershed management area for the City of Los Angeles is exempt from monitoring. A copy of the SIC code investigation report is included in **Attachment F**.

The Illicit Connection Illicit Discharge Elimination Program Manual, developed by the City of Los Angeles Department of Public Works in 1999, contains the operational protocols and policies for City staff to address illicit discharges into the storm drain system, which has been included in **Attachment F**. The following spill and response plan is in place in general as well as in the case of a plastic pellets spill:

- 1. The City of Los Angeles has established a hotline (800-974-9794) where spills can be reported. This hotline can be contacted 24/7, and is managed by LASAN's Watershed Protection Division. Any spills reported to the City's 311 number or to LASAN's call center are immediately forwarded to this hotline.
- 2. An environmental compliance inspector of LASAN's Watershed Protection Division (a total of about 15-20 inspectors) will inspect the location of the spill and evaluate the necessary next steps (determination of responsible party, clean-up, reporting/coordination with Department of Fish and Wildlife).
- 3. LASAN's Watershed Protection Division will coordinate the containment and clean-up of a plastic pellet spill. Containment may include the use of sand bags and/or mesh screens to prevent plastic pellets from entering catch basins, or the use of trash booms if the pellets have reached the receiving water. LASAN's Watershed Protection Division has an emergency contract in place with a contractor to assist with immediate containment and clean-up needs.

- **City of Santa Monica**: Both TMRP and PMRP were submitted on June 15, 2013 for review and approval. The City of Santa Monica has adopted the requisite bans on plastic bags, public smoking, and food container materials. The final compliance has been extended by three years.
- **County of Los Angeles**: A TMRP was submitted in September 2012. The PMRP was submitted on September 19, 2013 for all County of Los Angeles jurisdictions within Santa Monica Bay watershed management area (WMA). As stated in the PMRP, there is no plastic pellet usage by any County facility.
- **LACFCD**: A PMRP was submitted on September 19, 2013 for all LACFCD within the Santa Monica Bay WMA. Likewise, the LACFCD submitted a TMRP on September 20, 2012.

All submitted TMRP and PMRP for each jurisdiction will be implemented by the corresponding jurisdiction, once approved by the Regional Board. TMDL monitoring sites are presented in **Figure 9**. Additional TMDL requirements and existing TMDL monitoring programs are further detailed in **Attachment A**.

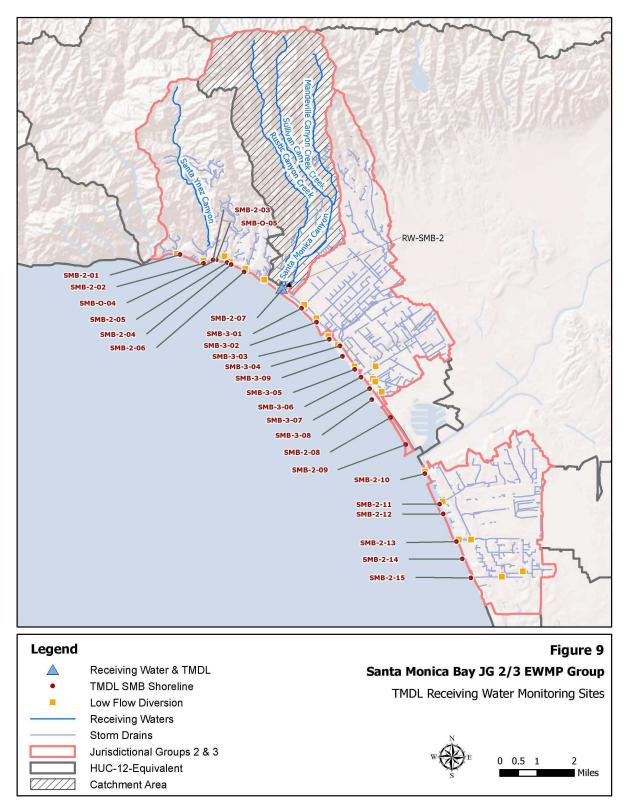


Figure 9 TMDL Receiving Water Monitoring Sites

## 2.3 MONITORED FREQUENCY, PARAMETERS, AND DURATION OF MONITORING

The MRP section of the MS4 Permit identifies specific requirements for fresh (Santa Monica Canyon Channel) and salt water (Santa Monica Bay). However, the CIMP will use consistent requirements for the fresh and salt water receiving sites. Wet- and dry-weather monitoring frequency, parameters, and duration will be addressed in the following sections. Parameters for monitoring were based on the water quality priorities, as discussed in **Section 1.2** and **Attachment A**. Additional analytical and monitoring procedures are discussed in **Attachment C**.

#### 2.3.1 Wet-Weather

For all receiving water monitoring sites within SMB EWMP Group, wet-weather conditions will be defined as a storm event of greater than or equal to 0.1 inch of precipitation, as measured from at least 50 percent of the Los Angeles County controlled rain gauges within the watershed. Receiving water monitoring sites will be monitored for all required constituents listed in **Table 6** during three wet-weather events per year, including the first significant rain event of the storm year, except for aquatic toxicity, which will be performed twice a year. Wet-weather receiving water monitoring will be performed in close coordination with stormwater outfall monitoring to be reflective of potential impacts from MS4 discharges. Parameters to be collected and sampling frequency to meet to the receiving water monitoring will be conducted for the MRP are summarized in **Table 6**. Wet-weather receiving water monitoring will be conducted for the MS4 permit.

Table 6
Receiving Water Monitoring Summary of Constituents to be Monitored and Annual Frequency
(wet/dry) <sup>(1)</sup>

	Site ID		
Constituents	RW-SMB-1	RW-SMB-2	RW-SMB-3
Flow and field parameters <sup>(2)</sup>	3/0	3/2	3/0
Pollutants identified in Table E-2 of the MRP <sup>(3)</sup>	1 <sup>(4)</sup> /0	$1^{(4)}/1^{(4)}$	1 <sup>(4)</sup> /0
Aquatic Toxicity and Toxicity Identification Evaluation (TIE)	2/0	2/1	2/0
TSS and Hardness		3/2	
Total Coliform <sup>(5)</sup>			
Fecal Coliform/(E. coli) <sup>(5)</sup>			
Enterococcus <sup>(4)</sup>			
Suspended Sediment: DDT <sup>(6)</sup> , PCBs <sup>(7)</sup>		3/0	
Lead		3/2	
E. coli (Indicator Bacteria)		3/2	

1. Annual frequency listed as number of wet-weather/dry-weather events per year, respectively (e.g., 3/2 signifies three wet weather and two dry weather events per year).

2. Field parameters are defined as DO, hardness, pH, temperature, and specific conductivity; ocean parameters will be DO, pH, temperature, and salinity

3. All pollutants identified in Table E-2 of the MRP that are not already addressed by TMDL monitoring at this site, will be monitored during the first significant rain event of the storm year and critical dry event for the year. After the first year of monitoring where the Table E-2 constituents are monitored, an analysis will be conducted to determine which MS4 Permit required pollutants exceeded a water quality objective. Those exceeding the respective water quality objectives will be added to the monitoring list.

4. After the first year of monitoring, pollutants identified in Table E-2 of the MRP that were not detected at the Method Detection Limit (MDL) for its respective test method or the result is below the lowest applicable water quality objective, additional monitoring will not be conducted (i.e., the monitoring frequency will become 0/0). For pollutants identified in Table E-2 of the MRP that are detected above the lowest applicable water quality objective, additional monitoring will be conducted in the MRP (i.e., the monitoring frequency will become 3/0 or 3/2) beginning the season following the Table E-2 sampling.

5. Will be monitored at the existing CSMP monitoring locations and CSMP sampling schedule.

6. DDT is defined as the sum of 2,4'-DDD, 2,4'-DDE, 2,4'-DDT, 4,4'-DDD, 4,4'-DDE, and 4,4'-DDT.

7. To allow appropriate comparisons between potential sources and effects, the 54 PCB congeners are to be analyzed for each matrix. PCBs are defined as the sum of 54 PCB congeners when analyzed in the water column, sediment or suspended solids, including: 8, 18, 28, 31, 33, 37, 44, 49, 52, 56, 60, 66, 70, 74, 77, 81, 87, 95, 97, 99, 101, 105, 110, 114, 118, 119, 123, 126, 128, 132, 138, 141, 149, 151, 153, 156, 157, 158, 167, 168, 169, 170, 174, 177, 180, 183, 187, 189, 194, 195, 201, 203, 206, and 209.

#### 2.3.2 Dry-Weather

Dry-weather receiving water monitoring will be conducted two times per year, except aquatic toxicity, which will be conducted once per year during the historically driest month. As detailed in **Attachment A**, **Section 2.1.1** and presented in **Table 7**, the SMB EWMP Group has installed 23 LFDs at all outfalls along the Santa Monica shoreline within the JG2 and 3 to address dry-weather flows. The LFDs are operational year round and divert dry-weather flows from the storm drains to the sanitary sewer system, keeping dry-weather flows from reaching Santa Monica Bay. Given that the LFDs divert all dry-weather flow from reaching Santa Monica Bay. All LFDs are closely monitored and maintained to ensure that no dry-weather flow will reach Santa Monica Bay shoreline.

In Santa Monica Canyon Channel, receiving water monitoring site RW-SMB-2 is located upstream of the LFD, which diverts dry-weather flow, within Santa Monica Canyon Channel, from reaching Santa Monica Bay. Although dry-weather flow from Santa Monica Canyon Channel is captured by the LFD and diverted from entering Santa Monica Bay, dry-weather flow into Santa Monica Canyon Channel is not captured by any LFD, MCMs, or BMPs. Dry-weather monitoring for RW-SMB-2 will be conducted twice per year, including August which is the historically driest month. However, aquatic toxicity will only be monitored once per year, during August for the critical dry weather event, as outlined in Part VI.D.1a of the MRP. Parameters and sampling frequency are further detailed in **Table 6**. After the first year of monitoring, if results are found to be insignificant, a request for reduction in dry weather monitoring frequency will be submitted to the Regional Board for consideration.

Name	Owner	Latitude	Longitude	Project Title
Bay Club Drive	City of Los Angeles	34.040784	-118.545169	Bay Club Drive Low Flow Diversion Project
Thronton Avenue	City of Los Angeles	33.993324	-118.475411	Thornton Avenue Low Flow Diversion Project
Palisades Park	City of Los Angeles	34.031694	-118.526400	Palisades Park Low Flow Diversion Project
Santa Monica Canyon	City of Los Angeles	34.027704	-118.518952	Santa Monica Low Flow Diversion Project
Venice Pavilion	City of Los Angeles	33.988239	-118.471236	Venice Pavilion Low Flow Diversion Project
Imperial Highways	City of Los Angeles	33.930915	-118.429173	Imperial Highway Low Flow Diversion Project
Temescal Canyon	City of Los Angeles	34.035875	-118.535386	Temescal Canyon Low Flow Diversion
Pulga Canyon	LACFCD	34.038724	-118.542464	Pulga Canyon Low Flow Diversion Project
Marques Avenue	City of Los Angeles	34.039604	-118.549626	Marquez Avenue Low Flow Diversion
Santa Ynez	LACFCD	34.039079	-118.555013	Santa Ynez Low Flow Diversion
Castlerock/Parker Canyon	LACFCD	34.041694	-118.567516	Castlerock/Parker Canyon Low Flow Diversion
Rose Avenue	LACFCD	33.998155	-118.474197	Rose Ave. Low Flow Diversion
Ashland Avenue	LACFCD	33.998087	-118.484046	Ashland Ave. Low Flow Diversion
Brooks Avenue	LACFCD	33.992216	-118.474245	Brooks Ave. Low Flow Diversion
Playa del Rey	LACFCD	33.957210	-118.450879	Playa del Rey Low Flow Diversion
North Westchester	LACFCD	33.945531	-118.442492	North Westchester Low Flow Diversion
Santa Monica Pier	City of Santa Monica	34.009925	-118.496375	Santa Monica Pier (SMURRF) Low Flow Diversion
Wilshire Boulevard	City of Santa Monica	34.016712	-118.502077	Wilshire Blvd Low Flow Diversion
Montana Avenue	City of Santa Monica	34.021984	-118.507841	Montana Ave. Low Flow Diversion
Pico-Kenter (SMURFF)	City of Santa Monica	34.006439	-118.491889	Pico-Kenter (SMURRF)
Imperial Highway	LACFCD	33.930892	-118.434895	Imperial Highway Low Flow Diversion Project
Arena Pump Plant	LACFCD	33.916390	-118.414636	Arena Pump Plant
El Segundo Pump	LACFCD	33.918549	-118.404877	El Segundo Pump Plant

 Table 7

 Santa Monica Bay Enhanced Watershed Management Program Group Low Flow Diversions

Name	Owner	Latitude	Longitude	Project Title
Plant				

#### 2.3.3 SMB TMDLs

#### Bacteria TMDL – Shoreline Monitoring

The SMB EWMP Group's shoreline monitoring schedule currently has twenty (20) monitoring sites sampled on a weekly basis and four (4) sampled five (5) times per week in accordance with the bacteria TMDL CSMP which was approved by the Los Angeles Regional Board in April 2004 and implemented since November 2004. MRP section VI.B.2.c of the MS4 Permit requires all SMBBB TMDL shoreline monitoring sites to be monitored on a five (5) times per week schedule in place of the current SMBBB TMDL sampling schedule. The SMB EWMP Group is proposing to keep the current sampling schedule. To justify keeping the current sampling schedule, an evaluation for each shoreline monitoring site within the SMB EWMP Group was conducted. Each shoreline monitoring site has one or more of the following characteristics:

- The site is subject to the anti-degradation criterion;
- The site is located at an open beach with no MS4 discharge; and/or
- An LFD, which diverts all dry-weather flow, is located upstream of the site.

**Table 8**Error! Reference source not found. indicated which of the three characteristics listed above apply to each shoreline monitoring site, and includes additional location information for each site.

Site ID	JG	Туре	LFD	Description	Sampling Frequency in Accordance with the 2004 CSMP
SMB-2-1	2	Point Zero	Yes	Castlerock (Parker Mesa)storm drain	Weekly
SMB-2-2	2	Point Zero	Yes	Santa Ynez storm drain	Weekly
SMB-2-3	2	Open Beach	No	Will Rogers State Beach, ¼ mile east of Gladstone's restaurant (DHS101)	Weekly
SMB-2-4	2	Point Zero	Yes	Pulga storm drain (S3)	Weekly
SMB-2-5	2	Point Zero	Yes	Bay Club Storm drain in front of the Bel Air Bay Club (DHS102)	Weekly
SMB-2-6	2	Point Zero	Yes	Temescal Canyon storm drain(DHS103)	Weekly
SMB-2-7	2	Point Zero	Yes	Santa Monica Canyon	Daily
SMB-2-8	2	Open Beach	No	Venice Beach, 50 yards south of the pier (DHS108)	Weekly
SMB-2-9	2	Open Beach	No	Venice Beach at Topsail Street(DHS109)	Weekly
SMB-2-10	2	Point Zero	Yes	Culver storm drain (S11)	Weekly
SMB-2-11	2	Point Zero	Yes	North Westchester storm drain	Weekly
SMB-2-12	2	Open Beach	No	Dockweiler Beach at WorldWay (DHS110)	Weekly
SMB-2-13	2	Point Zero	Yes	Imperial storm drain (S12)	Weekly
SMB-2-14	2	Open Beach	No	Dockweiler Beach opposite the Hyperion Treatment Plant (DHS111)	Weekly
SMB-2-15	2	Point Zero	Yes	Dockweiler Beach, at the wavewash of Grand Avenue stormdrain outlet (DHS112)	Weekly

 Table 8

 Santa Monica Bay Beaches Bacterial TMDL Sampling Frequency

SMB-3-1	3	Point Zero	Yes	Montana storm drain (DHS104)	Weekly
SMB-3-2	3	Point Zero	Yes	Wilshire storm drain (DHS105)	Weekly
SMB-3-3	3	Point Zero	Yes	Santa Monica Pier storm drain(S5)	Daily
SMB-3-4	3	Point Zero	Yes	Pico-Kenter storm drain (S6)	Daily
SMB-3-5	3	Point Zero	Yes	Ashland storm drain (S7)	Daily
SMB-3-6	3	Point Zero	Yes	Rose storm drain	Weekly
SMB-3-7	3	Point Zero	Yes	Brooks storm drain (DHS107)	Weekly
SMB-3-8*	3	Point Zero	Yes	Windward storm drain (S8)	Weekly
SMB-3-9	3	Open Beach	No	Santa Monica Beach at Strand Street (DHS106)	Weekly

 Table 8

 Santa Monica Bay Beaches Bacterial TMDL Sampling Frequency

\* Beach monitoring locations subject to the anti-degradation implementation provision in the TMDL.

In the event an exceedance has occurred at a SMBBB TMDL monitoring site, procedures following Elevated Bacteria Levels (Exceedances), per the CSMP, will be executed. SMB EWMP Group will conduct accelerated testing 48 hours after the initial bacteria exceedances, and if necessary, SMB EWMP Group will conduct accelerated testing 96 hours for those sites still exceeding bacterial indicators after 48 hours. The purpose of the increased monitoring is to identify the persistence of an exceedance, especially during dry-weather when source identification will be a priority. This accelerated monitoring may not be as critical during wet-weather at every location when the source of the exceedance is known to be storm water runoff.

#### <u>Toxic TMDL – Storm Sediment Monitoring</u>

Receiving water monitoring site RW-SMB-2 has been selected as the monitoring site for the SMB Toxics TMDL, as mentioned in **Section 2.2.4**. It is proposed that three wet-weather sampling events be conducted to evaluate the annual WLA of DDT and PCB for SMB EWMP Group based on the three (3) year average loading.

A summary of constituents and monitoring frequency for each of the receiving water monitoring sites is presented in **Table 6**.

## 2.4 RECEIVING WATER MONITORING SUMMARY

Three receiving water monitoring sites, which include monitoring for SMB Toxics, and 24 existing SMBBB TMDL sites have been selected to meet the MRP objects for receiving water monitoring. **Table 9** provides a summary of receiving water monitoring sites. Approximate locations of the monitoring sites are presented in **Figure 6** through **Figure 9**. A summary of constituents and monitoring frequency for each of the receiving water monitoring sites is presented in **Table 6**.

Attachment B provides summary sheets for each receiving water monitoring site, which include photos and additional information. Sampling and analytical methods for receiving water monitoring is provided in Attachment C.

				Coor		Monitoring Type	
Site ID	Water Body/Location	JG	LFD	Latitude	Longitude	RW	TMDL
New Monitoring	g Sites						
RW-SMB-1	SMB/ Santa Monica Canyon (SMC) Channel (In Ocean outward transect)	2	Yes	34.02519	-118.52362	х	
RW-SMB-2 Santa Monica Canyon (SMC) Channel/ Upstream of Low Flow Diversion (LFD)		2	Yes	34.02879	-118.51784	X	$\mathbf{X}^{(1)}$
RW-SMB-3	SMB/ Pico-Kenter (In Ocean outward transect)	3	Yes	34.00326	-118.49643	Х	
Existing Monito	oring Sites						
SMB-2-1	Santa Monica Bay/Shoreline	2	Yes	34.04135	-118.56600		X <sup>(2)</sup>
SMB-2-2	Santa Monica Bay/Shoreline	2	Yes	34.03801	-118.55500		X <sup>(2)</sup>
SMB-2-3	Santa Monica Bay/Shoreline	2	No	34.03934	-118.55052		X <sup>(2)</sup>
SMB-2-4	Santa Monica Bay/Shoreline	2	Yes	34.03757	-118.54200		X <sup>(2)</sup>
SMB-2-5	Santa Monica Bay/Shoreline	2	Yes	34.03837	-118.54400		X <sup>(2)</sup>
SMB-2-6	Santa Monica Bay/Shoreline	2	Yes	34.03473	-118.53600		X <sup>(2)</sup>
SMB-2-7	Santa Monica Bay/Shoreline	2	Yes	34.02784	-118.51800		X <sup>(2)</sup>
SMB-2-8	Santa Monica Bay/Shoreline	2	No	33.97826	-118.46714		X <sup>(2)</sup>
SMB-2-9	Santa Monica Bay/Shoreline	2	No	33.96768	-118.45994		X <sup>(2)</sup>
SMB-2-10	Santa Monica Bay/Shoreline	2	Yes	33.95641	-118.45100		X <sup>(2)</sup>
SMB-2-11	Santa Monica Bay/Shoreline	2	Yes	33.94447	-118.44400		X <sup>(2)</sup>
SMB-2-12	Santa Monica Bay/Shoreline	2	No	33.94064	-118.44226		X <sup>(2)</sup>
SMB-2-13	Santa Monica Bay/Shoreline	2	Yes	33.93005	-118.43600		X <sup>(2)</sup>
SMB-2-14	Santa Monica Bay/Shoreline	2	No	33.92331	-118.43326		X <sup>(2)</sup>
SMB-2-15	Santa Monica Bay/Shoreline	2	Yes	33.91592	-118.42926		X <sup>(2)</sup>
SMB-3-1	Santa Monica Bay/Shoreline	3	Yes	34.02061	-118.50900		X <sup>(2)</sup>
SMB-3-2	Santa Monica Bay/Shoreline	3	Yes	34.01535	-118.50200		X <sup>(2)</sup>
SMB-3-3	Santa Monica Bay/Shoreline	3	Yes	34.0087	-118.49600		X <sup>(2)</sup>
SMB-3-4	Santa Monica Bay/Shoreline	3	Yes	34.00615	-118.49100		X <sup>(2)</sup>
SMB-3-5	Santa Monica Bay/Shoreline	3	Yes	33.99702	-118.48400		X <sup>(2)</sup>
SMB-3-6	Santa Monica Bay/Shoreline	3	Yes	33.99398	-118.48100		X <sup>(2)</sup>
SMB-3-7	Santa Monica Bay/Shoreline	3	Yes	33.98946	-118.47700		X <sup>(2)</sup>
SMB-3-8	Santa Monica Bay/Shoreline	3	Yes	33.9852	-118.47600		X <sup>(2)</sup>
SMB-3-9	Santa Monica Bay/Shoreline	3	No	34.00199	-118.48979		X <sup>(2)</sup>

Table 9 Summary of Receiving Water Monitoring Sites

1. SMB Total DDT and PCB TMDL

2. SMBBB TMDL

# Section 3 MS4 Infrastructure Database

To meet the requirements of Part VII of the MRP, a map(s) and/or database of the MS4 storm drains, channels, and outfalls must be submitted with the CIMP and include the following information (Part VII.A of the MRP):

- 1. Surface water bodies within the Permittee(s) jurisdiction
- 2. Sub-watershed (HUC-12) boundaries
- 3. Land use overlay
- 4. Effective Impervious Area (EIA) overlay (if available)
- 5. Jurisdictional boundaries
- 6. The location and length of all open channel and underground pipes 18 inches in diameter or greater (with the exception of catch basin connector pipes)
- 7. The location of all dry-weather diversions
- 8. The location of all major MS4 outfalls within the Permittee's jurisdictional boundary. Each major outfall shall be assigned an alphanumeric identifier, which must be noted on the map
- 9. Notation of outfalls with significant non-stormwater discharges (to be updated annually)
- 10. Storm drain outfall catchment areas for each major outfall within the Permittee(s) jurisdiction
- 11. Each mapped MS4 outfall shall be linked to a database containing descriptive and monitoring data associated with the outfall. The data shall include:
  - a. Ownership
  - b. Coordinates
  - c. Physical description
  - d. Photographs of the outfall, where possible, to provide baseline information to track operation and maintenance needs over time
  - e. Determination of whether the outfall conveys significant non-stormwater discharges
  - f. Stormwater and non-stormwater monitoring data

Attachment A of the MS4 Permit defines a major MS4 outfall (or "major outfall") as a municipal separate storm sewer outfall that discharges from a single pipe with an inside diameter of 36 inches or more or its equivalent (discharge from a single conveyance other than circular pipe which is associated with a drainage area of more than 50 acres); or for municipal separate storm sewers that receive stormwater from lands zoned for industrial activity (based on comprehensive zoning plans or the equivalent), an outfall that discharges from a single pipe with an inside diameter of 12 inches or more or from its equivalent (discharge from other than a circular pipe associated with a drainage area of 2 acres or more) (40 CFR § 122.26(b)(5)).

Available Geographic Information System (GIS) data were reviewed to determine whether components 1 through 11.f from the list specified in the MRP were available for submittal. Based on the review of the GIS data, components 1 through 11.f from the list specified in the MRP were divided into available information or pending information and the associated schedule for completion, **Section 3.2** and **3.3**, respectively.

## 3.1 PROGRAM OBJECTIVES

Each year, a storm drain, channel, outfall map as well as an associated database for the SMB EWMP Group are required to be updated to incorporate the most recent characterization data for outfalls with significant non-stormwater discharge.

### 3.2 AVAILABLE INFORMATION

The SMB EWMP Group reviewed Part VII.A of the MRP and gathered the available information for the group. The following data are readily available for submittal as a map and/or in a database (Note: the numbering below corresponds to the item number in the Permit list):

#### 1. Surface water bodies within the Permittee(s) jurisdiction

Two surface water body layers were obtained from the City of Los Angeles and clipped to the JG2/JG3 boundaries. These layers include a *Streams* layer and an *Impaired Rivers* layer in the geodatabase.

#### 2. Sub-watershed (HUC-12) boundaries

HUC-12 boundaries were obtained from the National Resources Conservation Service and are included as a layer named *HUC12bndys* in the geodatabase.

#### 3. Land use overlay

The Southern California Association of Governments 2008 Existing Land Use Database has been clipped to the JG2/JG3 boundaries to create a layer named *LU\_2008SCAG* in the geodatabase.

#### 4. Effective Impervious Area (EIA) overlay

The Hydrologic Response Unit (HRU) Impervious Area Shapefile was obtained from the LACDPW and has been clipped to the JG2/JG3 boundaries to create a layer named *Effective Impervious Area* in the geodatabase.

#### 5. Jurisdictional boundaries

The *J237Watersheds* layer in the geodatabase identifies the boundaries of Jurisdiction 2 and Jurisdiction 3 of the SMB EWMP Group.

## 6. The location and length of all open channel and underground pipes 18 inches in diameter or greater (with the exception of catch basin connector pipes)

Three layers obtained from the LACFCD identify the locations of all open channel and underground pipes 18 inches in diameter or greater. These layers have been clipped to the JG2/JG3 boundaries and have been named *ForceMainGT18in*, *GravityMainGT18in*, and *OpenChannelGT18in* in the geodatabase.

#### 7. The location of all dry-weather diversions

The location of dry-weather Low Flow Diversions are mapped on the *Low Flow Diversion Points* layer that was obtained from the City of Los Angeles and clipped to the JG2/JG3 boundaries.

**8.** The location of all major MS4 outfalls within the Permittee's jurisdictional boundary MS4 outfalls are inventoried on the *MS4Outfalls* layer that was obtained from LACDPW and clipped to the JG2/JG3 boundaries.

## 10. Storm drain outfall catchment areas for each major outfall within the Permittee(s) jurisdiction

The *Subwatershed* layer of the geodatabase was obtained from the Los Angeles County Hydraulic Water Conservation & Environmental Programs Division and clipped to the JG2/JG3 boundaries. The *MS4 Outfalls* layer contains a column that indicates the subwatershed the outfall is located in. Detailed analyses of storm drain catchment areas will be conducted as needed at outfall monitoring locations, locations that may have significant NSW discharges, and outfalls that will host structural BMPs.

## 11. Each mapped MS4 outfall shall be linked to a database containing descriptive and monitoring data associated with the outfall. The data shall include:

- b. Coordinates
- c. Physical description

The attribute tables for the *MS4Outfalls* layer include the coordinates and a physical description of each major MS4 outfall in the geodatabase.

Figure 2 through 5 and 10 presents the available database information, listed above, for the SMB EWMP Group.

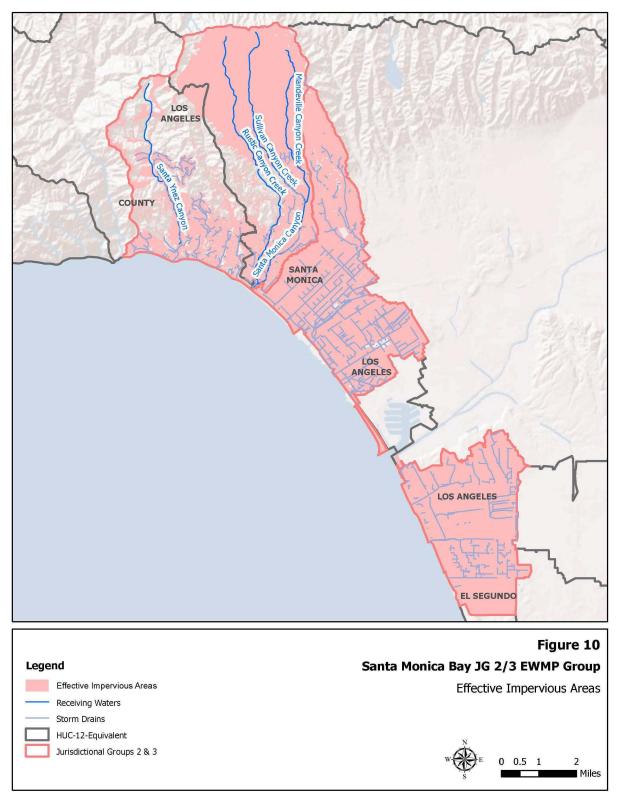


Figure 10 Effective Impervious Areas

## 3.3 PENDING INFORMATION AND SCHEDULE FOR COMPLETION

As the data becomes available, it will be entered into the database. The data summarized in **Table 10** will be populated into a database as the data is collected. The annual reports will include the updated database.

MS4 Permit		To be	Date of		
Requirement	Database Element	Developed	Submission		
VII.A.9	Notation of outfalls with significant NSW discharges (to be updated annually)	$\mathbf{X}^1$	December 2015		
VII.A.11	Each mapped MS4 outfall shall be linked to a database containing descriptive and monitoring data associated with the outfall. The data shall include items below:				
VII.A.11.a	Ownership	X <sup>3</sup>	December 2015		
VII.A.11.d	Photographs of the outfall, where possible, to provide baseline information to track operation and maintenance needs over time	$X^3$	December 2015		
VII.A.11.e	Determination of whether the outfall conveys significant NSW discharges	$\mathbf{X}^1$	December 2015		
VII.A.11.f	Stormwater and non-stormwater monitoring data	$X^4$	Ongoing		

 Table 10

 Information to be Collected for MS4 Database

NSW = Non-stormwater

<sup>1</sup> The determination of significance will be made after the initial screening process outlined in this CIMP.

<sup>2</sup> Storm drain outfalls were linked in the database to the modeling subwatersheds to provide information on contributing areas. Detailed analysis of storm drain outfall catchment areas for the stormwater outfall monitoring sites have been developed and additional detailed analysis for any new outfall monitoring locations, outfalls identified as having significant non-stormwater discharges, and outfalls addressed by structural BMPs will be conducted as needed.

<sup>3</sup> The data will be gathered as part of the screening and monitoring program and will be added to the database as they are gathered.

The Los Angeles County Storm Drain System geometric network model has the goal of integrating countywide drainage infrastructure, regardless of ownership or jurisdiction. Therefore, ownership data has not been indicated in the *MS4Outfalls* layer and will be updated during the MS4 outfall screening process. Photographs, and stormwater and non-stormwater monitoring data information have been collected and will be added as needed during the MS4 outfall screening process. Based on preliminary investigations, outfalls with significant non-stormwater discharges were not found. As further investigations are conducted and additional data is collected, updates to the maps and/or database will be conducted over time. Updates to the maps and/or database will be submitted through the Annual Report. Completion of the pending data will be collected through the implementation of the Non-Stormwater Outfall Screening and Monitoring Program, summarized in **Section 5**.

# Section 4 Stormwater Outfall Monitoring

Stormwater outfall monitoring assesses compliance with municipal action limits (MALs), WQBELs derived from TMDL WLAs, as well as the potential to cause or contribute exceedances of RWLs derived from TMDL WLAs or receiving water quality objectives. The majority of SMB EWMP Group storm drains generally drain towards Santa Monica Bay through multiple jurisdictions. An analysis of land use per HUC-12, drainage area and SMB EWMP Group area was conducted for each monitoring site.

## 4.1 STORMWATER OUTFALL MONITORING OBJECTIVES

As outlined in the Part VIII.A of the MRP, stormwater discharges from the MS4 shall be monitored at outfalls and/or alternative access points such as manholes, or in channels representative of the land uses within the Permittee's jurisdiction to support meeting the three objectives of the stormwater outfall based monitoring program:

- 1. Determine the quality of a Permittee's discharge relative to MALs;
- 2. Determine whether a Permittee's discharge is in compliance with applicable stormwater WQBELs derived from TMDL WLAs; and
- 3. Determine whether a Permittee's discharge causes or contributes to an exceedance of receiving water limitations.

Each stormwater outfall monitoring site was evaluated and assessed on how representative it is of the surrounding land use of the SMB EWMP Group area, jurisdictions, and the HUC-12. Each zoning category provided by the RAA guidance manual was fit into one of the following eight land use categories:

- Agricultural
- Industrial
- Single Family Residential
- Open Space

- Commercial
- Education
- Multi-Family Residential
- Transportation

## 4.2 STORMWATER OUTFALL MONITORING SITES

Four stormwater outfall monitoring sites, as shown in **Figure 11**, were selected (designated as OF-SMB-01 to -04). The selected sites are representative of a combination of the HUC-12s, jurisdictions, and/or land uses within each catchment area, which they have been chosen to represent. A synopsis of each potential outfall catchment area, along with an analysis of its land use/zoning characteristics is summarized in the following sections.

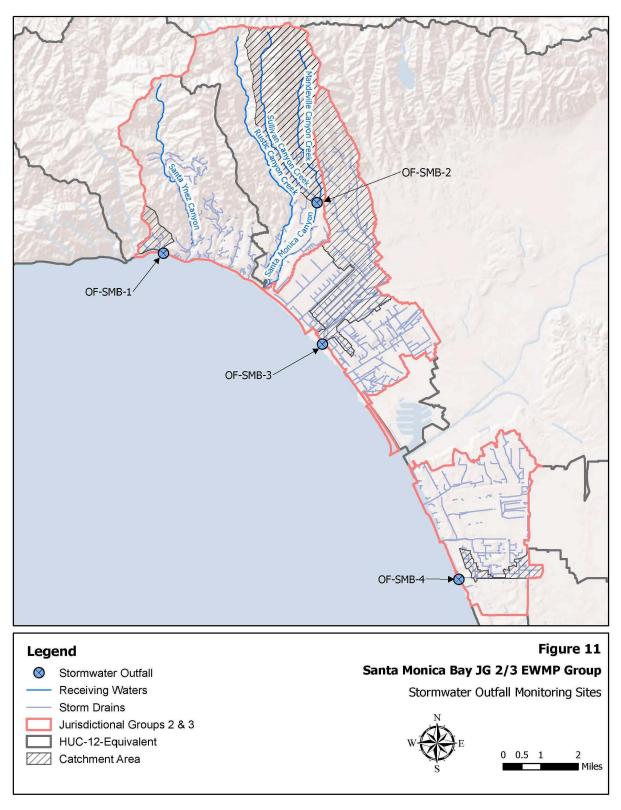


Figure 11 Stormwater Outfall Monitoring Sites

#### 4.2.1 OF-SMB-1

OF-SMB-1 is located upstream of SMBBB TMDL monitoring location SMB 2-1, as shown on **Figure 12**. This stormwater outfall monitoring site is the Castlerock (Parker Mesa) storm drain, which discharges into Santa Monica Bay. The outfall is a 5-feet by 8-feet reinforced concrete box structure. OF-SMB-1 currently has a LFD upgradient of the discharge point, which diverts all dry weather flows. The outfall is located near the intersection of Coastline Drive and PCH. Samples will be collected via a fixed autosampler installed at the outfall location, preferably at the discharge point, where it has been evaluated to be safe.

Stormwater outfall monitoring site OF-SMB-1 was selected to represent the Santa Monica Beach – Frontal Santa Monica Bay (180701040403) HUC-12 JG2 area. The City of Los Angeles and a small portion from the County of Los Angeles are the represented agencies in the Santa Monica Beach – Frontal Santa Monica Bay (180701040403) HUC-12 JG2 area. The catchment area from OF-SMB-1 encompasses approximately 4.55% of the Santa Monica Beach – Frontal Santa Monica Bay (180701040403) HUC-12 JG2 area.

Runoff from OF-SMB-1 is primarily from the County of Los Angeles and the City of Los Angeles, 57.75% and 42.25%, respectively. As shown on **Table 11**, the represented land uses for the OF-SMB-1 catchment area, HUC-12, and the SMB EWMP Group area are open space and single family residential. Accordingly, OF-SMB-1 is an ideal outfall monitoring site to assess MS4 discharge for open space and single family residential land uses, and the County of Los Angeles.

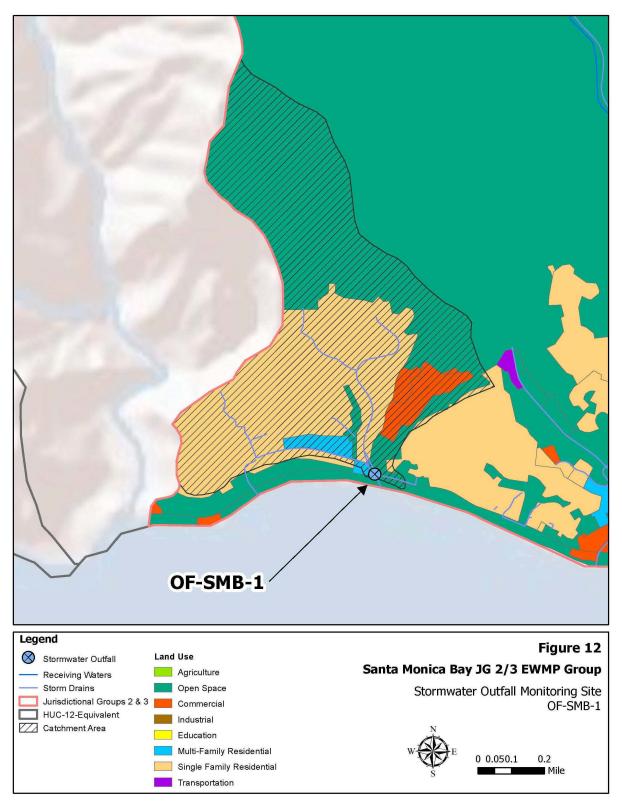


Figure 12 Stormwater Outfall Monitoring Site OF-SMB-1

	Catchment Area	HUC	SWB EWMP Area
	% of Total	% of Total	% of Total
Land Use			
Agricultural	0%	0.04%	0.05%
Commercial	4.67%	1.49%	4.86%
Industrial	0%	0%	4.61%
Education	0%	0.82%	1.67%
Single Family Residential	42.63%	20.36%	25.45%
Multi-Family Residential	1.82%	2.37%	8.15%
Open Space	50.88%	74.67%	48.37%
Transportation	0%	0.25%	6.83%
Total	100%	100%	100%
Jurisdictions			
City of Los Angeles	42.25%	95.26%	77.70%
City of Santa Monica	0%	0%	14.72%
City of El Segundo	0%	0%	6.43%
County of Los Angeles	57.75%	4.74%	1.15%

Table 11 Stormwater Outfall Monitoring Site OF-SMB-1 Tributary Area (Castlerock – Parker Mesa Storm Drain)

#### 4.2.2 OF-SMB-2

Stormwater outfall monitoring site OF-SMB-2 receives runoff from the Sullivan Canyon storm drain and Mandeville Canyon storm drain, as shown in **Figure 13**, which discharges into Santa Monica Canyon Channel. Sullivan Canyon storm drain is a 108 inch by 192 inch reinforced concrete box located near the North Old Ranch Road, and Mandeville Canyon storm drain is a 144 inch by 192 inch reinforced concrete box located near Mandeville Canyon Road. Samples will be collected via a fixed autosampler installed at the confluence point, preferably where the discharge points meet and where it has been evaluated to be safe.

OF-SMB-2 was selected to represent the Santa Monica Canyon (180701040402) HUC-12 area. The City of Los Angeles and a small portion of the City of Santa Monica are the represented agencies within the Santa Monica Canyon (180701040402) HUC-12 area. The catchment area from OF-SMB-2 encompasses approximately 41.42% of the Santa Monica Canyon (180701040402) HUC-12 area.

Runoff from OF-SMB-2 is entirely from the City of Los Angeles. **Table 12** compares the land use composition within the OF-SMB-2 catchment area, HUC-12, and SMB EWMP Group area. As shown on **Table 12**, the represented land uses of the OF-SMB-2 catchment area are open space and single family residential land use, and will characterize the upstream portion of Santa Monica Canyon Channel. Based on this comparison, OF-SMB-2 would be an ideal outfall monitoring site to represent the water quality assessment for open space and single family residential land uses, and the City of Los Angeles.

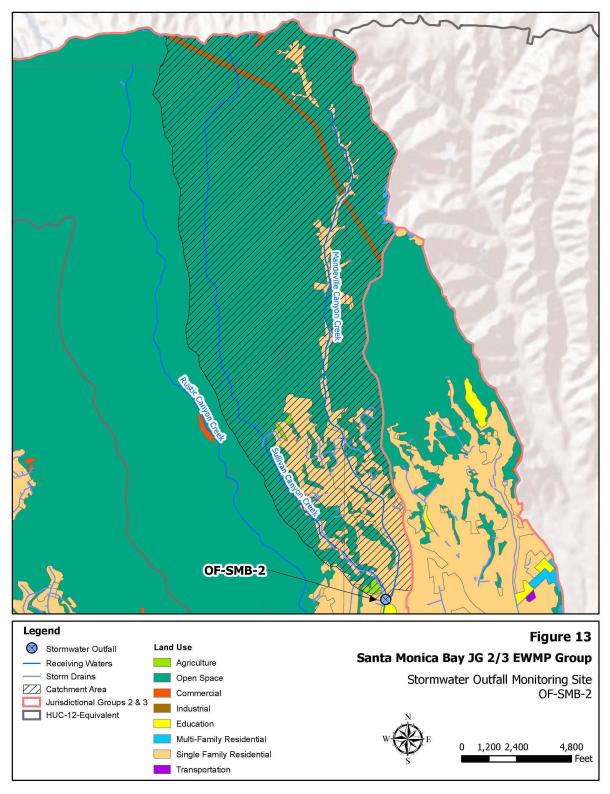


Figure 13 Stormwater Outfall Monitoring Site OF-SMB-2

	Catchment Area	HUC	SMB EWMP Area
	% of Total	% of Total	% of Total
Land Use			
Agricultural	0.31%	0.13%	0.05%
Commercial	0.07%	0.35%	4.86%
Industrial	1.46%	0.61%	4.61%
Education	0%	0.35%	1.67%
Single Family Residential	15.40%	20.81%	25.45%
Multi-Family Residential	0.21%	0.46%	8.15%
Open Space	82.55%	77.30%	48.37%
Transportation	0%	0%	6.83%
Total	100%	100%	100%
Jurisdictions			
City of Los Angeles	100%	97.35%	77.70%
City of Santa Monica	0%	2.65%	14.72%
City of El Segundo	0%	0%	6.43%
County of Los Angeles	0%	0%	1.15%

Table 12 Stormwater Outfall Monitoring Site OF-SMB-2 Tributary Area (Sullivan Canyon and Mandeville Canyon Storm Drains)

### 4.2.3 OF-SMB-3

Stormwater outfall monitoring site OF-SMB-3 is the Pico-Kenter storm drain located upstream of SMBBB TMDL monitoring location SMB3-4, as shown in **Figure 14**. The Pico-Kenter storm drain is generally blocked by sand from June to the first large storm event in winter. All flow during dry-weather is diverted to the Santa Monica Urban Runoff Recycling Facility (SMURRF). The outfall is located south of the Santa Monica Pier and can be found right at the end of Pico Boulevard. Samples will be collected via a fixed autosampler installed at the outfall location, preferably at the discharge point, where it has been evaluated to be safe.

OF-SMB-3 was selected to represent the Santa Monica Beach – Frontal Santa Monica Bay (180701040403) HUC-12 JG3 area. The Cities of Los Angeles and Santa Monica are the represented agencies in the Santa Monica Beach – Frontal Santa Monica Bay (180701040403) HUC-12 JG3 area. The catchment area of OF-SMB-3 will encompass approximately 51.11% of the Santa Monica Beach – Frontal Santa Monica Bay (180701040403) HUC-12 JG3 area.

Runoff from OF-SMB-3 is primarily from the City of Santa Monica and the City of Los Angeles, 40.38% and 59.62% respectively. As shown on **Table 13**, the represented land uses of OF-SMB-3 are commercial, mixed residential, and open space. Stormwater outfall monitoring site OF-SMB-3 was selected to represent the MS4 discharge characteristics of the City of Santa Monica and commercial, mixed residential and open space land uses.

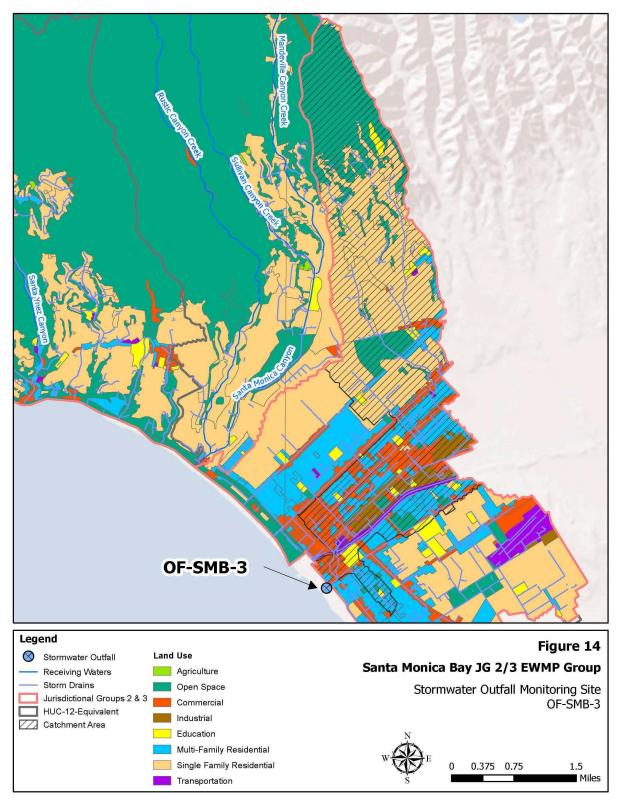


Figure 14 Stormwater Outfall Monitoring Site OF-SMB-3

	Catchment Area	HUC	SWB EWMP Area
	% of Total	% of Total	% of Total
Land Use			
Agricultural	0%	0%	0.05%
Commercial	13.02%	12.40%	4.86%
Industrial	4.75%	2.90%	4.61%
Education	2.97%	3.03%	1.67%
Single Family Residential	38.60%	38.50%	25.45%
Multi-Family Residential	15.04%	23.98%	8.15%
Open Space	23.91%	16.45%	48.37%
Transportation	1.71%	2.73%	6.83%
Total	100%	100%	100%
Jurisdictions			
City of Los Angeles	59.62%	47.33%	77.70%
City of Santa Monica	40.38%	52.67%	14.72%
City of El Segundo	0%	0%	6.43%
County of Los Angeles	0%	0%	1.15%

Table 13 Stormwater Outfall Monitoring Site OF-SMB-3 Tributary Area (Pico-Kenter Storm Drain)

#### 4.2.4 OF-SMB-4

Stormwater outfall monitoring site OF-SMB-4 is the Grand Avenue storm drain, as shown in **Figure 15**, located upstream of SMBBB TMDL monitoring location SMB 2-15. The Grand Avenue storm drain is a 34-inch diameter reinforced concrete pipe located in the parking lot of Dockweiler State Beach near the intersection of W Grand Avenue and Vista Del Mar Boulevard. Grand Avenue storm drain has a LFD up gradient, which diverts all dry-weather flow. The LFD is approximately 0.75 mile up gradient of stormwater outfall monitoring site OF-SMB-4. Samples will be collected via a fixed autosampler installed at the outfall location, preferably at the discharge point, where it has been evaluated to be safe.

OF-SMB-4 was selected to represent the Manhattan Beach – Frontal Santa Monica Bay (180701040500) HUC-12 area. The Cities of Los Angeles and El Segundo are the represented agencies within the Manhattan Beach – Frontal Santa Monica Bay (180701040500) HUC-12 area. The catchment area from OF-SMB-4 will encompass approximately 6.58% of the Manhattan Beach – Frontal Santa Monica Bay (180701040500) HUC-12 area.

Runoff from OF-SMB-4 is primarily from the Cities of El Segundo and Los Angeles, 97.49% and 2.51% respectively. **Table 14** compares the land use composition within the OF-SMB-4 catchment area, HUC-12, and SMB EWMP Group area. The represented land uses of the OF-SMB-4 catchment area are commercial, industrial, mixed residential. Accordingly, OF-SMB-4 has been selected to assess the MS4 discharge characteristic for commercial, industrial, and mixed residential land uses and the City of El Segundo.

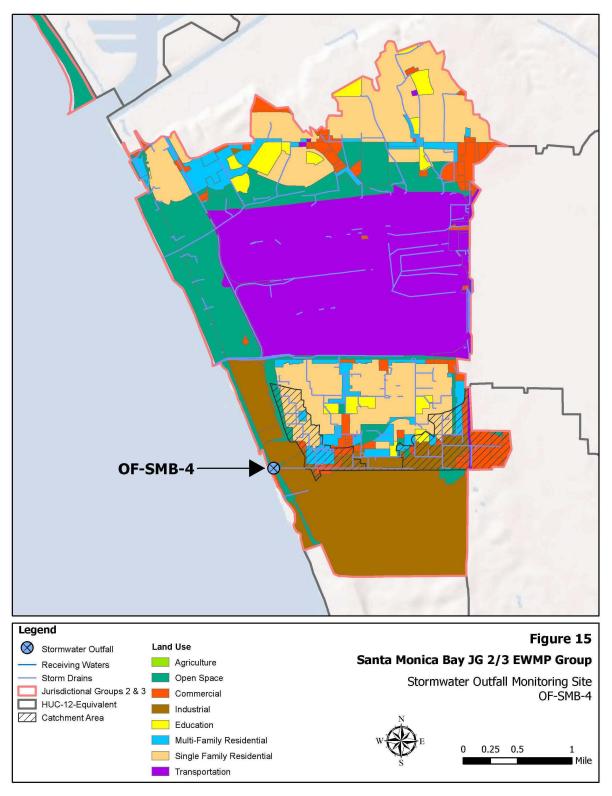


Figure 15 Stormwater Outfall Monitoring Site OF-SMB-4

	Catchment Area	HUC	SWB EWMP Area
	% of Total	% of Total	% of Total
Land Use			
Agricultural	0%	0%	0.05%
Commercial	27.71%	5.58%	4.86%
Industrial	27.57%	18.64%	4.61%
Education	1.50%	2.87%	1.67%
Single Family Residential	21.93%	20.97%	25.45%
Multi-Family Residential	11.77%	5.35%	8.15%
Open Space	6.81%	15.79%	48.37%
Transportation	2.71%	30.80%	6.83%
Total	100%	100%	100%
Jurisdictions			
City of Los Angeles	2.51%	67.36%	77.70%
City of Santa Monica	0%	0%	14.72%
City of El Segundo	97.49%	32.64%	6.43%
County of Los Angeles	0%	0%	1.15%

Table 14 Stormwater Outfall Monitoring Site OF-SMB-4 Tributary Area (Grand Avenue Storm Drain)<sup>1</sup>

<sup>1</sup> The DDT/PCB data from Ballona Creek with 83% urbanized area will be used (by way of extrapolation) to ensure the compliance with the waste load allocation for DDT/PCB storm born sediment is accurately determined and reported.

## 4.3 MONITORED FREQUENCY, PARAMETERS, AND DURATION

Stormwater outfall monitoring sites will be monitored for three (3) storm events per year for all required constituents except aquatic toxicity. Aquatic toxicity will be monitored when triggered by recent receiving water toxicity monitoring, where a toxicity identification evaluation (TIE) on the observed receiving water toxicity test was inconclusive. Sampling will be conducted for the first 24 hours of a storm or, if the storm duration is less than 24 hours, the entire event duration. The requirements for monitored constituents at each outfall are outlined in the MRP Section VIII.B.1.c and presented in **Table 15**. Parameters in Table E-2 of the MRP, as listed in **Attachment C**, will not be identified as exceeding applicable water quality objectives until after the first year of receiving water monitoring. Monitoring for the selected sites would occur for at least the duration of the Permit term, unless an alternative site is warranted, per the adaptive management process, as presented in **Section 10**. Additional analytical and monitoring procedures are discussed in **Attachment C**.

	Site ID			
Constituent	OF-SMB-1	OF-SMB-2	OF-SMB-3	OF-SMB-4
Flow, pH, dissolved oxygen, temperature, and specific conductivity	X	Х	Х	Х
Hardness	X	Х	Х	Х
TSS	X	Х	Х	Х
Table E-2 pollutants detected aboverelevant objectives	X	X	Х	Х
Aquatic Toxicity and Toxicity Identification Evaluation (TIE) <sup>(2)</sup>				
Total Coliform	X		Х	Х
Fecal Coliform/(E. coli)	X		Х	Х
Enterococcus	X		Х	Х
Lead		Х		
E. coli (Indicator Bacteria)		X		

 Table 15

 List of Constituents for Stormwater Outfall Monitoring<sup>(1)</sup>

1. Annual frequency for stormwater outfall monitoring would be 3 times per storm year.

2. Toxicity is only monitored from outfalls when triggered by recent receiving water toxicity monitoring where a TIE on the observed receiving water toxicity test identifies pollutants or where the results were inconclusive. If toxicity is observed at the outfall a TIE must be conducted.

## 4.4 SUMMARY OF STORMWATER OUTFALL MONITORING

Four stormwater outfall monitoring sites, as presented in **Figure 11**, were selected to represent a combination of the HUC-12, jurisdictions, and the land uses within each drainage area of the SMB EWMP Group (OF-SMB-1 through -4). A summary of outfall characteristics are presented in **Table 16** and **Attachment B**.

Outfall ID	Latitude	Longitude	LFD	Tributary HUC-12 Area	Drainage System
OF-SMB-1	34.041362	118.567045	Yes	Santa Monica Beach – Frontal Santa Monica Bay (180701040403) (Upper JG2)	Castle Rock (Parker Mesa)
OF-SMB-2	34.060808	-118.495170	No	Santa Monica Canyon (180701040402)	Sullivan Canyon and Mandeville Canyon
OF-SMB-3	34.006370	118.49184	Yes	Santa Monica Beach – Frontal Santa Monica Bay (180701040403) (JG3)	Pico Kenter
OF-SMB-4	33.917430	118.42858	Yes	Manhattan Beach – Frontal Santa Monica Bay (180701040500) (Lower JG2)	Grand Avenue

 Table 16

 Summary of Stormwater Outfall Monitoring Sites

## Section 5 Non-Stormwater Outfall Monitoring Program

The MRP requires Permittees to implement a non-stormwater outfall based screening and monitoring program. The non-stormwater outfall screening and monitoring program (non-stormwater program) is focused on non-stormwater discharges to receiving waters from major outfalls.

Since the late 1990s, the SMB EWMP Group has been addressing non-stormwater flow to Santa Monica Bay with the installation of LFDs, as summarized in **Attachment A** and in **Section 2**. The SMB EMWP Group has installed 23 LFDs throughout the SMB EWMP shoreline. The LFDs are operational year round and divert non-stormwater flow from the storm drains to the sanitary sewer system, keeping non-stormwater flows from reaching Santa Monica Bay. Non-stormwater flows at beach outfalls within Santa Monica Bay are non-existent due to the installation of the LFD. As non-stormwater flow at beach outfalls are non-existent, and have been reviewed for over 10 years, outfall screening of these outfalls will not be conducted.

Non-stormwater flows at outfalls within Santa Monica Canyon Channel are not diverted and will require an inventory. However, an LFD near the end of Santa Monica Canyon Channel exists and diverts all nonstormwater flow from reaching Santa Monica Bay.

## 5.1 NON-STORMWATER OUTFALL MONITORING OBJECTIVES

The objectives of the non-stormwater outfall program include the following (Part II.E.3 of the MRP):

- a. Determine whether a Permittee's discharge is in compliance with applicable non-stormwater WQBELs derived from TMDL WLAs;
- b. Determine whether a Permittee's discharge exceeds non-stormwater action levels, as described in Attachment G of the MS4 Permit;
- c. Determine whether a Permittee's discharge contributes to or causes an exceedance of receiving water limitations; and
- d. Assist a Permittee in identifying illicit discharges as described in Part VI.D.10 of the MS4 Permit.

Additionally, the outfall screening and monitoring process is intended to meet the following objectives (Part IX.A of the MRP):

- 1. Develop criteria or other means to ensure that all outfalls with significant non-stormwater discharges are identified and assessed during the term of this MS4 Permit.
- 2. For outfalls determined to have significant non-stormwater flow, determine whether flows are the result of illicit connection/illicit discharge (IC/IDs), authorized or conditionally exempt non-stormwater flows, natural flows, or from unknown sources.
- 3. Refer information related to identified IC/IDs to the IC/ID Elimination Program (Part VI.D.10 of the MS4 Permit) for appropriate action.
- 4. Based on existing screening or monitoring data or other institutional knowledge, assess the impact of non-stormwater discharges (other than identified IC/IDs) on the receiving water.
- 5. Prioritize monitoring of outfalls, considering the potential threat to the receiving water and applicable TMDL compliance schedules.

- 6. Conduct monitoring or assess existing monitoring data to determine the impact of non-stormwater discharges on the receiving water.
- 7. Conduct monitoring or other investigations to identify the source of pollutants in non-stormwater discharges.
- 8. Use results of the screening process to evaluate the conditionally exempt non-stormwater discharges identified in Parts III.A.2 and III.A.3 of the MS4 Permit and take appropriate actions pursuant to Part III.A.4.d of the MS4 Permit for those discharges that have been found to be a source of pollutants. Any future reclassification shall occur per the conditions in Parts III.A.2 or III.A.6 of the MS4 Permit.
- 9. Maximize the use of Permittee resources by integrating the screening and monitoring process into existing or planned Integrated Monitoring Program (IMP) and/or CIMP efforts.

The outfall screening and investigations must be completed prior to initiating monitoring at an individual outfall. Detailed discussion of each element is provided in the following subsections.

## 5.2 NON-STORMWATER OUTFALL SCREENING AND MONITORING PROGRAM

The Non-Stormwater Outfall Screening and Monitoring Program are focused on dry-weather discharges to receiving waters from major outfalls that are (1) not served by an LFD, and (2) flows that reach the receiving water. The program fills two roles: (1) to provide assessment of whether the non-stormwater discharges are potentially impacting the receiving water, and (2) to determine whether significant non-stormwater discharges are allowable. The non-stormwater outfall program is complimentary to the IC/ID minimum control measure. Non-stormwater outfall monitoring sites will be determined after the screening events are completed and an inventory of outfalls is created. Parameters monitored at each non-stormwater outfall site will depend upon the receiving water on which it is located.

To determine the number of outfalls that are required to be monitored for the non-stormwater outfall monitoring, SMB EWMP Group has developed an outfall screening and monitoring program. The section starting with **Section 5.3** are part of the monitoring program. Within 90 days of the approval of this CIMP, the SMB EWMP Group will initiate steps to identify, inventory, prioritize, and monitor the non-stormwater discharges. The non-stormwater outfall program will involve following steps:

- 1. **Outfall Screening**: Because data required to implement the non-stormwater program is not available, the SMB EWMP Group will implement a screening process to determine which outfalls exhibit non-stormwater discharges and those that do not require further investigation.
- 2. **Identification of Outfalls with Significant Non-Stormwater Discharge** (Part IX.C of the MRP): Based on data collected during the outfall screening process the SMB EWMP Group will identify MS4 outfalls with significant non-stormwater discharges.
- 3. **Inventory of Outfalls with Non-Stormwater discharges** (Part IX.D of the MRP): Develop an inventory of major MS4 outfalls with known significant non-stormwater discharges and those requiring no further assessment.
- 4. **Prioritized Source Identification** (Part IX.E of the MRP): The data collected during the screening process will be used to prioritize outfalls for source identification investigations.
- 5. **Significant Non-stormwater Discharge Source Identification** (Part IX.F of the MRP): For outfalls exhibiting significant non-stormwater discharges, the SMB EWMP Group will perform source identification per the prioritization completed in the previous element.
- 6. **Monitoring Non-Stormwater Discharges Exceeding Criteria** (Part IX.G of the MRP): Using the information collected during screening and source identification efforts, the SMB EWMP Group will monitor outfalls that have been determined to convey significant non-stormwater discharges comprised of either unknown or non-essential conditionally exempt non-stormwater discharges, or continuing discharges attributed to illicit discharges must be monitored.

## 5.3 IDENTIFICATION OF OUTFALLS WITH SIGNIFICANT NON-STORMWATER DISCHARGES

An initial field survey allowed for the identification of outfalls, the majority of which were observed along the beaches, Santa Monica Canyon Channel, and Rustic Canyon Creek. Santa Ynez Canyon Creek and parts of Sullivan Canvon Creek were found to be natural creeks with no outfalls. Mandeville Canvon Creek was observed to be an underground storm drain. The upstream parts of Mandeville Canyon creek include a natural ditch that runs parallel to the storm drain with a catch basin connection. Natural flows from Sullivan Canyon Creek drain to an underground storm drain that daylights at the confluence of Mandeville Canyon Creek and Sullivan Canyon Creek. Rustic Canyon Creek has a concrete bottom from the confluence of Santa Monica Canyon Channel to the end of W. Rustic Road. After W. Rustic Road, Rustic Canyon Creek is a soft bottom creek. In addition, Temescal Canyon and La Pulga Canyon, similar to Mandeville Canyon Creek, are observed to be underground storm drain with LFD that diverts dryweather flows from Santa Monica Bay. Temescal Canyon was observed to be underground storm drain from Sunset Boulevard down to PCH, where dry-weather flows are diverted through the LFD. The upstream portion of Temescal Canyon was observed to be an open/natural creek that runs through Mountains Recreational Park. At the time of the initial field survey, the natural portion of Temescal Canyon was observed to be dry with patches of stagnant pools along the creek. Access to La Pulga Canyon was limited as the entrance is through private property. Through aerial photos from Google Earth, La Pulga Canyon is observed to be an underground storm drain that daylights before PCH. Attachment D presents the photos from this field survey.

Based on a review of the available information, identification of significant non-stormwater discharges is not available at this time. Under this task, the SMB EWMP Group will undertake a field reconnaissance to evaluate the major outfalls within Santa Monica Canyon Channel and concrete lined portion of Rustic Canyon Creek. The major outfalls for the SMB EWMP Group are defined as follows:

- 36-inch or larger pipes, and
- 12-inch or larger pipes from industrial zoned areas.

**Table 17** and **Figure 16** present a listing of all known outfalls that match the major outfall criteria along Santa Monica Canyon Channel and concrete lined portion of Rustic Canyon Creek. Additional major outfalls identified through the outfall screening process will be incorporated into the inventory and will be submitted in the subsequent annual report.

Station ID	Type of Outlet	<b>Outlet Size</b>	Storm Drain
SULLC-054	Reinforced Concrete Pipe (RCP)	51"	BI 0246 - Georgina Av
SULLC-085	Reinforced Concrete Pipe (RCP)	60"	Carpri Drain - U1

Table 17
Known Major Outfalls in Santa Monica Channel and Rustic Canyon Creek

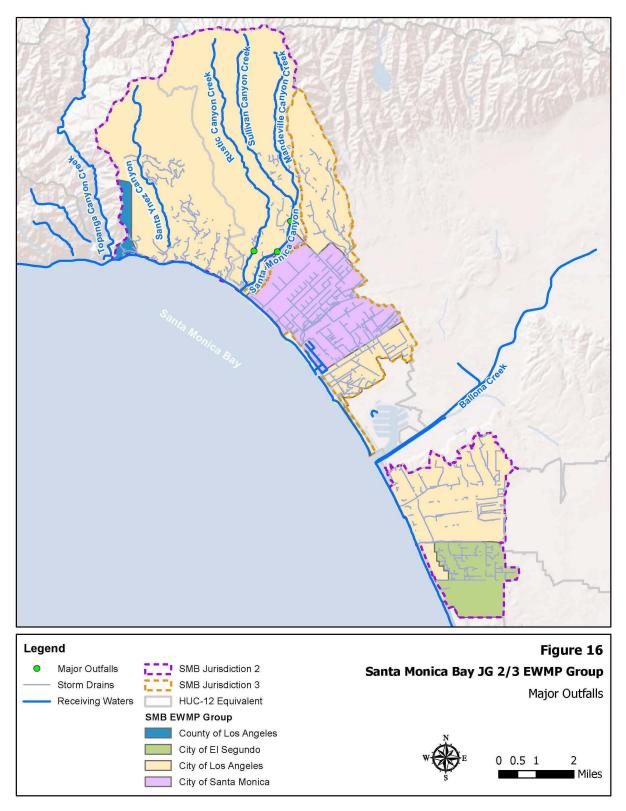


Figure 16 Major Outfalls

To determine whether outfalls contribute significant non-stormwater discharge, the SMB EWMP Group will perform three (3) non-stormwater outfall screenings on major outfalls within Santa Monica Canyon Channel and the concrete lined portion of Rustic Canyon Creek. The SMB EWMP Group has identified *E. coli* and flow as the primary characteristic for determining significant non-stormwater discharges and will monitor for *E. coli* and flow at three outfall screenings for the first year after CIMP approval. The initial screenings will serve the dual purpose of data collection for completing the MS4 infrastructure database, addressed in **Section 3**, and the initial evaluation of outfalls for significant non-stormwater discharge. A standard field data collection form will be used, consisting of:

- Channel bottom, visual estimate of flow rate;
- Whether discharge ponds in the channel or reaches the receiving water;
- Clarity;
- Presence of odors and foam; and
- If flow was observed from the outfall, collect *E. coli* sample.

All *E. coli* and flow data gather during the three initial screenings will be processed and evaluated. As data is gathered and processed, major outfalls with dry-weather flows reaching the receiving water body and with the presence of *E. coli* in more than one screening event will be deemed as exhibiting significant non-stormwater discharge. **Table** 18 outlines the SMB EWMP Group's screening process for determining significant non-stormwater discharge.

Additionally, outstanding information for the MS4 inventory database will be collected, including, at a minimum, geographically referenced photographs. At least one re-assessment of the non-stormwater outfall screening and monitoring program will be conducted during the term of the Permit to determine whether changes or updates are needed. Seasonal variability will be considered in the timing of the re-assessment. If changes are needed, a written request to the Regional Board Executive Officer will be submitted and described in the subsequent annual report.

Component	Description
Data Collection	Data collection includes flow measurements AND <i>E. coli</i> . Additionally, information needed to complete the inventory would be collected.
Frequency	Three times as part of the initial screening process.
	Outfalls will be determined to be significant non-stormwater discharges through the following criteria:
Defining Significant Non- Stormwater Discharges	1. Does the non-stormwater discharge reach the receiving water during dry- weather? If yes, collect <i>E. coli</i> sample.
	2. Was <i>E. coli</i> detected in more than one screening event? If yes, outfall exhibiting significant non-stormwater discharge
Timeline	Initiation of the screening process will occur within 90 day of approval of the CIMP.

Table 18
Approach for Establishing Non-Stormwater Outfall Screening Process <sup>1</sup>

<sup>1</sup> The non-stormwater screening process will be repeated each MS4 Permit cycle (nominally, a five year period), or where requirements are eliminated in a subsequent MS4 Permit.

## 5.4 INVENTORY OF MS4 OUTFALLS WITH NON-STORMWATER DISCHARGES

The inventory of MS4 outfalls identified during outfall screening will be developed and updated by the SMB EWMP Group to classify outfalls with known significant non-stormwater discharges and those requiring no further assessment (Part IX.D of the MRP). If the MS4 outfall requires no further

assessment, then the inventory will include the rationale for the determination of no further action required based on the following:

- The outfall is not within the geographical scope of the EWMP Group;
- The outfall does not have flow;
- The outfall does not have a known significant non-stormwater discharge; or
- Discharges observed were determined to be exempt during the source identification (Section 5.6).

The inventory will be recorded in the database as required in Part VII.A of the MRP. Each year, the inventory will be updated to incorporate the most recent characterization data for outfalls with significant non-stormwater discharges. The following physical attributes of outfalls with significant non-stormwater discharges will be included in the inventory and should be collected as part of the screening process:

- a. Date and time of last visual observation or inspection;
- b. Outfall alpha-numeric identifier;
- c. Description of outfall structure including size (e.g., diameter and shape);
- d. Description of receiving water at the point of discharge (e.g., natural, soft-bottom with armored sides, trapezoidal, concrete channel);
- e. Latitude/longitude coordinates;
- f. Nearest street address;
- g. Parking, access, and safety considerations;
- h. Photographs of outfall condition;
- i. Photographs of significant non-stormwater discharge (or indicators of discharge) unless safety considerations preclude obtaining photographs;
- j. Estimation of discharge rate;
- k. All diversions either upstream or downstream of the outfall; and
- 1. Observations regarding discharge characteristics such as turbidity, odor, color, presence of debris, floatables, or characteristics that could aid in pollutant source identification.

## 5.5 PRIORITIZED SOURCE IDENTIFICATION

Through the outfall screening process the number of major outfalls may increase and may possibly be identified as significant non-stormwater outfalls. Once significant non-stormwater outfalls have been identified through the screening process and incorporated into the inventory, Part IX.E of the MRP requires Permittees to prioritize outfalls for further source investigations. The SMB EWMP Group proposes the following alternative prioritization criteria to be utilized:

- 1. Outfalls with the highest average *E. coli* concentration; and
- 2. Outfalls for which monitoring data exist and indicate recurring exceedances of one or more of the Action Levels identified in Attachment G of the Permit.

Once the prioritization is completed, a source identification of identified significant non-stormwater outfall will be achieved. The SMB EWMP Group proposes the following schedule:

- 25 percent by December 28, 2015
- 100 percent by December 28, 2017

## 5.6 SIGNIFICANT NON-STORMWATER DISCHARGE SOURCE IDENTIFICATION

Based on the prioritized list of major outfalls with significant non-stormwater discharge, source identification will be conducted to identify the source(s) or potential source(s) of non-stormwater discharge.

Part IX.A.2 of the MRP requires Permittees to classify the source identification results into the following types as summarized in **Table 19**:

- A. **IC/ID**: If the source is determined to be an illicit discharge, then the Permittee must implement procedures to eliminate the discharge consistent with IC/ID requirements (Permit Part VI.D.10) and document actions.
- B. Authorized or Conditionally-Exempt Non-Stormwater Discharges: If the source is determined to be an NPDES permitted discharge, a discharge subject to the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA), or a conditionally exempt essential discharge, then the Permittee must document the source. For non-essential conditionally exempt discharges, the Permittee must conduct monitoring consistent with Part IX.G of the MRP for the Regional Board Executive Officer to determine whether the discharge should remain conditionally exempt or be prohibited.
- C. **Natural Flows**: If the source is determined to be natural flows, then the Permittee must document the source.
- D. Unknown Sources: If the source is unknown, then the Permittee must conduct monitoring consistent with Part IX.G of the MRP.
- E. **Originates Upstream of SMB EWMP Group**: If the source is determined to originate from an upstream WMA, then the Permittee must inform the upstream WMA and Regional Board in writing within 30 days of identifying the presence of the discharge, provide all available characterization data and determination efforts, and document actions taken to identify its source.

Туре	Follow-up	Action Required by Permit
A. Illicit Discharge or Connection	Refer to IC/ID program	Implement control measures and report in annual report. Monitor if cannot be eliminated.
B. Authorized or Conditionally Exempt Discharges <sup>1</sup>	Document and identify if essential or non-essential	Monitor non-essential discharges
C. Natural Flows	End investigation	Document and report in annual report
D. Unknown	Refer to IC/ID program	Monitor
E. Upstream of SMB EWMP Group	End investigation	Inform upstream WMA and the Regional Board in writing within 30 days of identifying discharge.

Table 19Source Identification Types

1 Discharges authorized by a separate NPDES permit, a discharge subject to a Record of Decision approved by USEPA pursuant to section 121 of CERCLA, or is a conditionally exempt NSW discharge addressed by other requirements. Conditionally exempt NSW discharge addressed by other requirements are described in detail in Part III.A. Prohibitions – NSW Discharges of the Permit.

Source identification will be conducted using site-specific procedures based on the characteristics of the non-stormwater discharge. Investigations could include:

- Performing field measurements to characterize the discharge;
- Following dry-weather flows from the location where they are first observed in an upstream direction along the conveyance system; and
- Compiling and reviewing available resources, including past monitoring and investigation data, land use/MS4 maps, aerial photography, and property ownership information.

Where the source identification has determined the non-stormwater source to be authorized, natural, or essential conditionally-exempt flows, the outfall will require no further assessment and will move onto the next highest priority outfall. However, if the source identification determines that the source of the discharge is non-essential conditionally exempt, an ID, or is unknown, then further investigation will be conducted to eliminate the discharge or to demonstrate that it is not causing or contributing to receiving water impairments and will be added to the monitoring list until non-stormwater discharge is eliminated.

In some cases, source investigations may ultimately lead to prioritized programmatic or structural BMPs. Where the SMB EWMP Group has determined that they will address the non-stormwater discharge through modifications to programs or by structural BMP implementation, the SMB EWMP Group will incorporate the approach into the implementation schedule developed in the EWMP, and the outfall can be eliminated from the monitoring list.

## 5.7 NON-STORMWATER DISCHARGE MONITORING

As outlined in the MRP (Part II.E.3), outfalls with significant non-stormwater discharges that remain unaddressed after source investigation shall be monitored to meet the following objectives:

- a. Determine whether a Permittee's discharge is in compliance with applicable dry-weather WQBELs derived from TMDL WLAs;
- b. Determine whether the quality of a Permittee's discharge exceeds non-stormwater action levels, as described in Attachment G of the Permit; and
- c. Determine whether a Permittee's discharge causes or contributes to an exceedance of receiving water limitations.

Thus, outfalls that have been determined to convey significant non-stormwater discharges where the source identification concluded that the source is attributable to a continued ID (Type A from **Table 19**, non-essential conditionally exempt (Type B from **Table 19**), or unknown (Type D from **Table 19**) must be monitored. Monitoring will be implemented within 90 days of completing the source identification and will be coordinated with the following receiving water dry-weather monitoring event.

#### 5.7.1 Non-Stormwater Outfall-Based Monitoring Sites

The information to determine the number and location of outfalls requiring monitoring is not available at this time. After the outfall screening, inventory, prioritization, and source identification process, outfalls identified to require monitoring will be monitored per the permit requirements.

#### 5.7.2 Monitored Frequency, Parameters, and Duration of Monitoring

After the outfall screening and determining which outfalls have significant non-stormwater flows, non-stormwater monitoring sites will be monitored for two (2) monitoring events. The monitoring events will be coordinated with receiving water monitoring site RW-SMB-2, which will allow for an evaluation

of whether the non-stormwater discharges are causing or contributing to any observed exceedances of water quality objectives in the receiving water. Significant non-stormwater outfalls will be monitored for all required constituents, per receiving water bodies, as outlined in Part IX.G.1.a-e of the MRP, except toxicity. Toxicity monitoring is only required when triggered by recent receiving water toxicity monitoring where a TIE on the observed receiving water toxicity test was inconclusive. An overview of the constituents to be monitored and the corresponding frequency is listed in **Table 20**. Outfalls on the monitoring list will be monitored for at least the duration of the Permit term, or until the non-stormwater discharge is eliminated. Additional analytical and monitoring procedures are discussed in **Attachment C**.

Constituent	Outfalls on Monitoring List		
Flow, pH, dissolved oxygen, temperature, and specific conductivity	X		
Hardness	X		
TSS	X		
Table E-2 pollutants detected above relevant objectives	Х		
Aquatic Toxicity and			
Toxicity Identification Evaluation (TIE) <sup>(1)</sup>			
Lead	Х		
E. coli (Indicator Bacteria)	Х		

## Table 20 List of Constituents for Non-Stormwater Monitoring

1. Annual frequency for non-stormwater outfall monitoring will be 2 times per storm year.

2. Toxicity is only monitored from outfalls when triggered by recent receiving water toxicity monitoring where a TIE on the observed receiving water toxicity test identifies pollutants or where the results were inconclusive. If toxicity is observed at the outfall a TIE must be conducted.

## 5.8 NON-STORMWATER OUTFALL PROGRAM SUMMARY

At this time, non-stormwater outfall monitoring sites have not been identified. The SMB EWMP Group will conduct the following steps as part of the non-stormwater outfall program to identify non-stormwater outfall monitoring sites:

- 1. Outfall screening;
- 2. Identification of outfalls with significant non-stormwater discharge (Part IX.C of the MRP);
- 3. Inventory of outfalls with non-stormwater discharge (Part IX.D of the MRP);
- 4. Prioritized source investigation (Part IX.E of the MRP); and
- 5. Identify sources of significant non-stormwater discharges (Part IX.F of the MRP).

As non-stormwater discharges are addressed, monitoring at the outfall(s) will cease. Additionally, if monitoring demonstrates that discharges do not exceed any WQBELs, action levels, or water quality standards for pollutants identified in 303(d) listings, then modifications to the monitoring program, specifically the elimination of parameters and or constituents may be proposed and will be subject to approval by the Regional Board Executive Officer.

# Section 6 New Development/Re-Development Effectiveness Tracking Program

The New Development/Re-Development Effectiveness Tracking Program is used for tracking information data in regards to new and re-development activities. To meet the MRP requirements of Permit Attachment E, Part X.A, the SMB EWMP Group will maintain an informational database record for each new development/re-development project subject to the MCM requirements in Part VI.D.7 of the Permit and their adopted LID Ordinance. The database should track the following information:

- 1. Name of the Project and Developer;
- 2. Mapped project location (preferably linked to the Geographic Information System (GIS) storm drain map);
- 3. Issuance date of the project Certificate of Occupancy;
- 4. 85<sup>th</sup> percentile 24-hour storm event for project design (inches);
- 5. 95<sup>th</sup> percentile 24-hour storm event for projects draining to natural water bodies (inches);
- 6. Other design criteria required to meet hydromodification requirements for drainages to natural water bodies;
- 7. Project design storm (inches per 24 hours);
- 8. Project design storm volume (gallons or million gallons);
- 9. Percent of design storm volume to be retained onsite;
- 10. Design volume for water quality mitigation treatment BMPs (if any);
- 11. If flow through, water quality treatment BMPs are approved, provide the one-year, one-hour storm intensity as depicted on the most recently issued isohyetal map published by the Los Angeles County Hydrologist;
- 12. Percent of design storm volume to be infiltrated at an off-site mitigation or groundwater replenishment project site;
- 13. Percent of design storm volume to be retained or treated with biofiltration at an off-site retrofit project;
- 14. Location and maps (preferably linked to the GIS storm drain map) of off-site mitigation, groundwater replenishment, or retrofit sites; and
- 15. Documentation of issuance of requirements to the developer.

Until the EWMP is approved by the Regional Board or the Executive Officer, the SMB EWMP Group is only required to implement and track MCM information in its existing stormwater management program per Part V.C.4.d.i.

In addition to the requirements in Part X.A of the MRP, Part VI.D.7.d.iv of the Permit requires that the SMB EWMP Group implement a tracking system for new development/re-development projects that have been conditioned for post-construction BMPs. The following information is to be tracked using GIS or another electronic system:

- 1. Municipal Project ID
- 2. State Waste Discharge Identification (WDID) Number
- 3. Project Acreage
- 4. BMP Type and Description
- 5. BMP Location (coordinates)
- 6. Date of Acceptance

- 7. Date of Maintenance Agreement
- 8. Maintenance Records
- 9. Inspection Date and Summary
- 10. Corrective Action
- 11. Date Certificate of Occupancy Issued
- 12. Replacement or Repair Date

## 6.1 **PROGRAM OBJECTIVES**

The objective of the New Development/Re-Development Effectiveness Tracking is to assess whether post-construction BMPs, as outlined in permits issued by the Permittees, are implemented, and to ensure the volume of stormwater associated with the design storm is retained onsite, as required by Part VI.D.7.c.i. of the Permit. The New Development/Re-Development Effectiveness Tracking will gather necessary data to assess whether construction MCM, LID ordinances and BMPs are effective and being implemented.

## 6.2 EXISTING NEW DEVELOPMENT/RE-DEVELOPMENT TRACKING PROCEDURES

Within the SMB EWMP Group, each jurisdiction has a unique approach to tracking some or the entire 27 required development program tracking elements (15 elements identified in Attachment E.X.A and 12 elements in Part VI.D.7.d.iv.). For private development projects, a Building Department, or a variation of, is typically the entity responsible for collecting and recording the program tracking elements. In contrast, public improvement projects are normally the responsibility of a Public Works Department.

Based on a review of the existing new development/re-development tracking procedure for the different jurisdictions within the SMB EWMP Group, additional effort will be needed to track the 27 program tracking elements required by the Permit. Information has currently been recorded and stored differently across jurisdictions, with some using commonly-available software packages, such as Microsoft Office products and GIS, and others using proprietary software programs, such as Plan Check and Inspection System (PCIS), or in some instances paper files. SMB EWMP Group members will develop or modify their current tracking systems to set up a centrally-located spreadsheet template that includes the required information fields for each project that can be tracked separately by the individual jurisdiction's proprietary software system if integrated accordingly. Each jurisdiction will dedicate resources to develop a complete tracking system that works for their individual needs and internal processes.

## 6.3 SPECIAL CONSIDERATIONS FOR DATA MANAGEMENT AND REPORTING

A fundamental step in establishing individual data management protocols consists of developing a recommended standard operating procedure (SOP) and determining the responsible person within each jurisdiction for collecting, reviewing, and reporting the data. The SOP developed by each jurisdiction will consist of written instructions regarding documentation of routine activities and delineation of the primary steps in the land development approval process, relevant data generated at each step, and procedures for "handoff" of the project to the next group. Development and use of an SOP is an integral part of successful data management as it provides information to perform a task properly, and facilitates consistency in the quality and integrity of the tracking data.

#### 6.3.1 Data Management

Each jurisdiction will conduct tracking to meet Permit requirements and facilitate reporting. The data management protocols will include:

- Designing and testing data entry sheets for the required information fields identified in **Section 6.1**;
- Describing the procedures and identifying the persons responsible for inputting data, assessing accuracy and consistency, and coordinating follow up actions when questions arise;
- Strategy for checking and validating data entry, including identifying persons responsible for managing and safeguarding data, performing data entry, supervising the data entry, and ensuring quality control of the data; and
- Specifying procedures for routinely and safely archiving data files.

Data collection for development review processes generally consist of the following similar steps:

- **Planning**: Project proponents submit an application to agency planning department to determine whether or not the project meets jurisdictional requirements. When required, the project may require a public hearing for conditions and entitlements. Project conditions may include water quality related requirements.
- **Building**: Projects may be conditioned subject to engineering, community services, or building department review and approval of plans or technical reports. During review, required water quality BMP designs are reviewed and accepted. When a building and/or grading permit is issued, project construction usually proceeds without further discretionary approvals.
- **Construction**: During construction, approved BMPs are implemented and then verified by the jurisdiction's inspector prior to issuance of a Certificate of Occupancy.
- **Post-Construction Inspections**: Once constructed, inspection and verification of maintenance is transferred to the jurisdiction's water quality program manager.

Relevant project data is collected during each phase of the development review process described above. Based on this general process and information gathered through the questionnaire, **Table 21** illustrates data collection opportunities throughout the planning, building, construction, and post-construction inspection processes for requirements in Part VI.D.7 of the Permit.

Stage	Process	Data Collection Opportunity		
		Project name		
Planning	Planning review, conditions, and	Developer name		
Training	entitlements	Location/Map		
		Documentation of issuance of requirements		
		85 <sup>th</sup> and 95 <sup>th</sup> percentile storm event criteria		
		Other hydromodification management requirements		
		Project design storm intensity and volume		
	Engineering review and approval	Percent of design storm volume retained onsite		
Building		Design volume for treatment BMPs		
Dunung	of plans and technical reports	One year/one hour storm intensity		
		Percent of design storm infiltrated offsite		
		Percent of design storm retained/treated with biofiltration offsite		
		Location/Maps of offsite mitigation		
Construction	Approval of BMP construction and issuance of Certificate of Occupancy	Issuance date of Certificate of Occupancy		
Post-Construction Inspections	Inspection and tracking of post- construction BMPs	Inspection and maintenance dates		

 Table 21

 Development Review Process and Data Collection

#### 6.3.2 Additional Data

To facilitate annual assessment and reporting and future Reasonable Assurance Analyses (RAA) input data compilation, the SMB EWMP Group may also track the following questions and/or information:

- Do any modified MCMs apply to this project?
- Assessor's Identification Number (AIN)
- Street address
- Revised land use (based on City/County Land Use Categories)
- BMP maintenance funding source
- Tributary area to each BMP

#### 6.3.3 Reporting

Coordinated effectiveness tracking among the SMB EWMP Group for watershed-scale reporting and compliance assessment will require a common reporting approach that complements individual Planning and Land Development Program MCM implementation. It is assumed that all group members have access to, can export data to, and use Microsoft Office products such as Access, Excel, and Word. Use of this software will facilitate the sharing of data to fulfill the reporting requirements in Part XVIII.A.1 and A.2 of the MRP.

Development of a data collection template and established SOPs for each jurisdiction will aid in future analyses and annual reporting. The example data collection template, presented in **Table 22**, includes the information to be tracked for each project.

PLANNING										
Project Name / Description	New or Re-Development	Planning ID	Name of Developer	Assessor's Identification Number (AIN)	Location (Lat/Long or Cross Streets)	Address	City	Zip	Issuance of Requirements Date	
ABC Development	New Development	PA14-0001	XYZ Development, LLC	4272-029-017	Ocean Park and 31st Street 34.012603, 118.270348	3250 Ocean Park	Santa Monica	90405	3/11/2014	

# Table 22Example Data Collection Template

	BUILDING										
Building ID	Project Acreage (Acres)	Design Storm (in/24 hr)	Design Storm Volume (Gallons or MGD)	Units	Storm Volume Retained On-site (%)	85th % Storm Event (in/24 hr)	95th % Storm Event - Projects Draining to Natural Water Bodies (in/24 hr)	Type of BMP (Please select from list)	BMP Location (Lat/Long or Coordinates)		
B14-0001	18.943	0.920	473,200	Gallons	100%	0.920	None	(Bio)Infiltration Basins Permeable Pavement Water Harvesting Media Filtration Practices Wet Detention	34.012711, 118.271411         34.012311, 118.271411         34.012311, 118.271411         34.012511, 118.271411         34.012511, 118.271411         34.012811, 118.271811		

	BUILDING										
Contributing Area (Acres)	Design Volume for Treatment BMPs	Units	Offsite Run-on / Mitigation	Offsite Run-on Location	Design Storm Volume - Infiltrated at an Off-Site Mitigation Project (%)	Design Storm Volume - Retained or Treated with Biofiltration Off-Site (%)	Date of Maintenance Agreement	State WDID #			
5.540	-				0.00%	0.00%					
3.400	-				0.00%	0.00%					
2.400	-		No	None	0.00%	0.00%	11/15/2014	4 19C123456			
2.103	6722	cf			0.00%	0.00%					
5.500	-				0.00%	0.00%					

CONS	TRUCTION	POST-CONSTRUCTION BMP INSPECTIONS					
Acceptance Date	Certificate of Occupancy Date	Certificate of Occupancy Date Maintenance Records Inspection Date and Summary		Replacement or Repair Date	Corrective Action		
		Yes	11/21/2017	None	No		
11/5/2016		No	11/21/2018 - No Records	Unknown	Yes		
	11/15/2016	Yes	11/21/2019	None	No		
		Yes	11/21/2020	None	No		
		Yes	11/21/2021	None	No		
Required	= Required Field						
Recommended	= Recommended						

Annual Assessment and Reporting requirements to be included in an Annual Report are outlined in Part XVIII.A.1 through A.7 of the MRP. With regard to New Development/Re-Development Effectiveness Tracking, the SMB EWMP Group is required to annually track, analyze, and report on the following stormwater control measures in Part XVIII.A.1:

- Estimate the cumulative change in percent effective impervious area (EIA) since the effective date of the Permit and, if possible, the estimated change in the stormwater runoff volume during the 85<sup>th</sup> percentile storm event.
- Summarize new development/re-development projects constructed within the Permittee's jurisdictional area during the reporting year.
- Summarize retrofit projects that reduced or disconnected impervious area from the MS4 during the reporting year.
- Summarize other projects designed to intercept stormwater runoff prior to discharge to the MS4 during the reporting year.
- For the projects summarized above, estimate the total runoff volume retained onsite by the implemented projects.
- Summarize actions taken in compliance with TMDL implementation plans or approved Watershed Management Programs to implement TMDL provisions in Part VI.E and Attachments L-R of the Permit.
- Summarize riparian buffer/wetland restoration projects completed during the reporting year. For riparian buffers include width, length and vegetation type; for wetland include acres restored, enhanced, or created.
- Summarize other MCMs implemented during the reporting year, as deemed relevant.
- Provide status of all multi-year efforts that were not completed in the current year and will therefore continue into the subsequent year(s). Additionally, if any of the requested information cannot be obtained, then the Permittee shall provide a discussion of the factor(s) limiting its acquisition and steps that will be taken to improve future data collection efforts.

Group members are also required to track, evaluate, and provide an effectiveness assessment of stormwater control measures per Attachment E, Part XVIII.A.2:

- Summarize rainfall for the reporting year. Summarize the number of storm events, highest volume event (inches/24 hours), highest number of consecutive days with measureable rainfall, total rainfall during the reporting year compared to average annual rainfall for the subwatershed. Precipitation data may be obtained from the LACDPW rain gauge stations available at http://www.ladpw.org/wrd/precip/.
- Provide a summary table describing rainfall during stormwater outfall and wet-weather receiving water monitoring events. The summary description shall include the date, time that the storm commenced and the storm duration in hours, the highest 15-minute recorded storm intensity (converted to inches/hour), the total storm volume (inches), and the time between the storm event sampled and the end of the previous storm event.
- Where control measures were designed to reduce impervious cover or stormwater peak flow and flow duration, provide hydrographs or flow data of pre- and post-control activity for the 85<sup>th</sup> percentile, 24-hour rain event, if available.
- For natural drainage systems, develop a reference watershed flow duration curve and compare it to a flow duration curve for the subwatershed under current conditions.
- Provide an assessment as to whether the quality of stormwater discharges as measured at designed outfalls is improving, staying the same, or declining. The Permittee may compare water quality data from the reporting year to previous years with similar rainfall patterns, conduct

trends analysis, or use other means to develop and support its conclusions (e.g., use of nonstormwater action levels or municipal action levels as provided in Attachment G of the Permit).

- Provide an assessment as to whether wet-weather receiving water quality within the jurisdiction of the Permittee is improving, staying the same, or declining when normalized for variations in rainfall patterns. The Permittee may compare water quality data from the reporting year to previous years with similar rainfall patterns, conduct trends analysis, draw from regional bioassessment studies, or use other means to develop and support its conclusions.
- Provide status of all multi-year efforts, including TMDL implementation, that were not completed in the current year and will continue into the subsequent year(s). Additionally, if any of the requested information cannot be obtained, then the Permittee shall provide a discussion of the factor(s) limiting its acquisition and steps that will be taken to improve future data collection efforts.

Additional reporting elements required are identified in Part VI.D.7 of the Permit and include:

- A summary of total offsite project funds raised to date and a description (including location, general design concept, volume of water expected to be retained, and total estimated budget) of all pending public offsite projects.
- A list of mitigation project descriptions and estimated pollutant and flow reduction analyses.
- A comparison of the expected aggregate results of alternative compliance projects to the results that would otherwise have been achieved by retaining onsite the stormwater quality design volume.

Part XV.A of the MRP requires each Permittee or group to submit an Annual Report to the Regional Board by December 15<sup>th</sup> of each year. The annual reporting period is from July 1<sup>st</sup> through June 30<sup>th</sup>, and information reported will cover approved and constructed projects that have been issued occupancy.

### 6.4 SUMMARY OF NEW DEVELOPMENT/RE-DEVELOPMENT EFFECTIVENESS TRACKING

New Development/Re-Development Effectiveness Tracking is used for tracking information data in regards to new and re-development activities and their associated post-construction BMPs. The information is stored and will be submitted in an annual compliance report. Each jurisdiction will be individually responsible for tracking Permit requirements, based on their specific operational procedures and internal processes.

# Section 7 Regional Studies

The MRP identifies one regional study: the SMC Regional Watershed Monitoring Program. The SMC is a collaborative effort between SCCWRP, State Water Board's Surface Water Ambient Monitoring Program (SWAMP), three Southern California Regional Water Quality Control Boards, and several county stormwater agencies. SCCWRP acts as a facilitator to organize the monitoring program, conducts the data analysis, and prepares monitoring results reports. The goal of the SMC is to develop a monitoring program on a regional level for Southern California's coastal streams and rivers.

Prior to the initiation of the SMC Regional Watershed Monitoring Program, in-stream monitoring in southern California was conducted by over a dozen different organizations, each of which had disparate monitoring programs that varied in design, frequency, and the indicators selected for measurement. Even where the monitoring designs were similar, the field techniques, laboratory methods, and quality assurance requirements were often not comparable, making region-wide assessments impossible. In addition, the lack of an integrated information management system precluded data sharing among programs. To address these problems, SCCWRP helped the SMC design and implement a coordinated and regional watershed monitoring program. The SMC works with local programs in the region to facilitate greater data collection and provide a regional context to address site- and watershed-specific questions.

The SMB EWMP Group, through the City of Los Angeles and LACFCD will continue to participate in the Regional Watershed Monitoring Program (Bioassessment Program) being managed by the Southern California Stormwater Monitoring Coalition (SMC). Initiated in 2008, the SMC's Regional Bioassessment Program is designed to run over a five-year cycle. Monitoring under the first cycle concluded in 2013, with reporting of findings and additional special studies planned to occur in 2014. SMC, is currently working on designing the bioassessment monitoring program for the next five-year cycle, which is scheduled to run from 2015 to 2019.

# 7.1 PROGRAM OBJECTIVES

The SMC Regional Watershed Monitoring Program seeks to coordinate and leverage existing monitoring efforts so as to produce regional estimates of condition, improve data comparability and quality assurance, and maximize data availability, but at the same time conserving monitoring expenditures. This program addresses watersheds, though, rather than the marine environment. The primary goal of the SMC Regional Watershed Monitoring Program is to implement an ongoing, large-scale regional monitoring program for southern California's coastal streams and rivers. The monitoring program addresses three main questions:

- 1. What is the condition of streams in our region?
- 2. What are the stressors that affect stream condition?
- 3. Are conditions getting better or worse?

## 7.2 REGIONAL STUDY PARTICIPATION

The MRP states that each Permittee shall be responsible for supporting the monitoring described at the sites within the watershed management area(s) that overlap with the Permittee's jurisdictional area. One program initiated under the SMC is the Regionally Consistent and Integrated Freshwater Stream Bioassessment Monitoring Program (Bioassessment Program), which included six (6) monitoring sites

that were monitored annually within the SMB EWMP Group area. The SMC Bioassessment Program initiated in 2009 and occurs in five years cycles. Sampling under the 2009 cycle concluded in 2013. The next five-year cycle is scheduled to begin in 2015, with additional special study monitoring scheduled to occur in 2014.

The City of Los Angeles and the LACFCD were participants of the 2009 Bioassessment Program, and the SMB EWMP Group will continue to coordinate with SCCWRP to participate in the SMC Regional Monitoring Program. During the next five-year Bioassessment Program cycle (2015 Bioassessment Program), as indicated by SCCWRP, previous types of monitoring resources will be available to Permittees to participate in the Bioassessment Program. The SMB EWMP Group will contact and discuss with the SCCWRP if the previous location will continue to be monitored in the 2015 Bioassessment Program. If so, then the SMB EWMP Group will coordinate with SCCWRP to participate in the 2015 Bioassessment Program.

# Section 8 Special Studies

The MRP requires each Permittee to be responsible for conducting special studies required in an effective TMDL or an approved TMDL Monitoring Plan. The effective TMDLs, revised TMDLs, and approved monitoring plans relevant to the SMB EWMP Group do not require the completion of special studies. However, the SMB DDT and PCB TMDL have identified optional special studies as follows:

- Refine the relationship between sediment and concentrations of pollutants and fish tissue contamination;
- Determine total mass of DDT and PCBs in Santa Monica Bay subsurface sediments through sediment coring profiles;
- Identify flux rate of pollutants from the sediments to the water column; and
- Evaluate sediments embedded in storm drains to better estimate potential loadings of DDT and PCBs to Santa Monica Bay and identify potential sources.

At this time, the SMB EWMP Group will not participate in any special studies. At a future date, if implementation of a special study is desirable, then a separate work plan that coordinates with the CIMP will be developed.

# Section 9 Non-Direct Measurements

Existing monitoring programs that collect water quality data in the watershed, as summarized in **Attachment A**, will be incorporated into the CIMP database to the extent practicable. Gathering and compiling information from outside the CIMP programs will be dictated by the cost. Water quality data reported by these monitoring programs will be evaluated for suitability for inclusion in the CIMP database. If the water quality data is deemed to be suitable, then it will be included in the database.

# Section 10 Adaptive Management

An adaptive management approach provides a structured process that allows for taking action under uncertain conditions based on the best available science, closely monitoring and evaluating outcomes, and re-evaluating and adjusting decisions as more information is obtained.

The EWMP and CIMP are to be implemented using the adaptive process. As new program elements are implemented and data gathered over time, the EWMP and CIMP will undergo revision to reflect the most current understanding of the watershed and present a sound approach to addressing changing conditions. As such, the EWMP and CIMP will employ an adaptive management process that will allow the two programs to evolve over time.

## 10.1 INTEGRATED MONITORING AND ASSESSMENT PROGRAM

Part XVIII.A of the MRP details the annual assessment and reporting that is required as part of the annual report. The annual assessment and reporting is composed of seven parts:

- 1. Stormwater Control Measures
- 2. Effectiveness Assessment of Stormwater Control Measures
- 3. Non-stormwater Control Measures
- 4. Effectiveness Assessment of Non-stormwater Control Measures
- 5. Integrated Monitoring Compliance Report
- 6. Adaptive Management Strategies
- 7. Supporting Data and Information

Based on the findings of the annual assessment, revisions to the CIMP will be included as part of the Integrated Monitoring Compliance Report (IMCR), which is further outlined in Section 11.2, and submitted as part of the annual report.

## **10.2 CIMP REVISION PROCESS**

Implementation of the CIMP will be used to gather data on receiving water conditions and stormwater/non-stormwater quality to assess water quality and the effectiveness of the EWMP. As part of the adaptive management process, re-evaluation of the CIMP will need to be conducted to better inform the SMB EWMP Group of ever-changing conditions of the watershed. Each program of the CIMP will be re-evaluated, with the exception of the non-stormwater outfall screening and monitoring program, every two years to remain in line with the EWMP's adaptive management process, for the following:

- **Monitoring Site Locations**: As water quality priorities change and certain WBPCs are being address or identified, monitoring site locations may either need to be added or changed.
- Monitoring Constituents: Eliminate monitoring of constituents that are not detected.
- **Sampling and Testing Methods**: Modify the sampling and testing methodology as necessary based on lessons learned from previous year(s) and data analysis.
- **Monitoring Frequency**: Increase or decrease monitoring frequency based on the evaluation of RWL, WQBELs, and non-stormwater action levels.

Based on the re-evaluation, CIMP revisions will be made and submitted to the Regional Board Executive Officer for approval. CIMP revisions will be implemented upon approval by the Regional Board or within 60 days of submittal if the Regional Board expresses no objections.

Re-evaluation of the non-stormwater outfall screening and monitoring program will be conducted once during the term of the permit order to determine whether changes or updates are needed, as specified in Attachment E Part XI.B.2.

# Section 11 Reporting

Analysis and reporting of data is an integral part of verifying whether the CIMP is meeting MRP objectives. The MRP, establishes NPDES permit monitoring, reporting, and recordkeeping requirements, including those for large MS4s, based on federal Clean Water Act (CWA) section 308(a) and Code of Federal Regulations (40 CFR) sections 122.26(d)(2)(i)(F), (iii)(D), 122.41(h)-(l), 122.42(c), and 122.48. In addition, California Water Code (CWC) section 13383 authorizes the Regional Board to establish monitoring, inspection, entry, reporting, and recordkeeping requirements. The following sections outline the CIMP reporting process for the SMB EWMP Group.

# 11.1 DOCUMENTS AND RECORDS

Consistent with the Part XIV.A of the MRP requirements, the SMB EWMP Group will retain records of all monitoring information for a period of at least 3 years from the date of the sample, measurement, report, or application, including:

- Calibration data;
- Major maintenance records;
- Original lab and field data sheets;
- Original strip chart recordings for continuous monitoring instrumentations;
- Copies of reports required by the permit; and
- Records of data used to complete the application for the permit.

Records of monitoring will include:

- Date, time of sampling or measurements, exact place, weather conditions, and rainfall amount;
- Individual(s) who performed the sampling or measurements;
- Date(s) analyses were performed;
- Individual(s) who performed the analyses;
- Analytical techniques or methods used;
- Results of such analyses; and
- Data sheets showing toxicity test results.

#### 11.1.1 Semi-Annual Analytical Data Submittal

Monitoring results data will be submitted semi-annually, as stated in Part XIV.L of the MRP. The transmitted data will be in the most recent update of the Southern California Municipal Storm Water Monitoring Coalition's (SMC) Standardized Data Transfer Formats (SDTFs) and sent electronically to the Regional Board Stormwater site to MS4stormwaterRB4@waterboards.ca.gov. The SMC SDTFs can be found at the SCCWRP web page http://www.sccwrp.org/data/DataSubmission.aspx. The submitted monitoring data will highlight the following:

- Exceedances of applicable WQBELs;
- Receiving water limitations;
- Action levels; and/or
- Aquatic toxicity thresholds for all test results, with corresponding sampling dates per receiving water monitoring station.

#### 11.2 MONITORING REPORTS

Part XVIII.A.5, of the MRP presents the requirements of the IMCR that will be included and submitted on an annual basis as part of the Annual Report. As discussed in **Section 10**, the IMCR is one of seven parts of the Annual Assessment and Reporting.

The IMCR will include the following information as required by the MRP:

- Summary of exceedances against all applicable RWL, WQBELs, non-stormwater action levels, and aquatic toxicity thresholds for:
  - Receiving water monitoring Wet- and dry-weather
  - Stormwater outfall monitoring
  - Non-stormwater outfall monitoring
- Summary of actions taken:
  - To address exceedances for WQBELs, non-stormwater action levels, or aquatic toxicity for stormwater and non-stormwater outfall monitoring
  - To determine whether MS4 discharges contributed to RWL exceedances and efforts taken to control the discharge causing the exceedances to the receiving water
- If aquatic toxicity was confirmed and a TIE was conducted, then identify the toxic chemicals determined by the TIE, and include all relevant data to allow the Regional Board to review the adequacy and findings of the TIE.

The IMCR will be submitted, as part of the Annual Assessment Report section of the Annual Report, to the Regional Board by December 15<sup>th</sup> of each year, for at least the duration of the Permit term. As indicated earlier, event summary reports will be attached to the IMCR.

In addition to the IMCR, the SMB EWMP Group will continue to submit the monthly SMBBB TMDL Monitoring Report.

### 11.3 SIGNATORY AND CERTIFICATION REQUIREMENTS

Part V.B of Attachment D of the Permit presents the Signatory and Certification Requirements and states:

- 1. All applications, reports, or information submitted to the Regional Water Board, State Water Board, and/or US Environmental Protection Agency (USEPA) shall be signed and certified in accordance with Standard Provisions Reporting V.B.2, V.B.3, V.B.4, and V.B.5 below [40 CFR section 122.41(k)(1)].
- 2. All applications submitted to the Regional Water Board shall be signed by either a principal executive officer or ranking elected official. For purposes of this section, a principal executive officer includes: (i) the chief executive officer of the agency (e.g., Mayor), or (ii) a senior executive officer having responsibility for the overall operations of a principal geographic unit of the agency (e.g., City Manager, Director of Public Works, City Engineer, etc.).[40 CFR section 122.22(a)(3)].
- 3. All reports required by this Order and other information requested by the Regional Water Board, State Water Board, or USEPA shall be signed by a person described in Standard Provisions – Reporting V.B.2 above, or by a duly authorized representative of that person. A person is a duly authorized representative only if:
  - a. The authorization is made in writing by a person described in Standard Provisions Reporting V.B.2 above [40 CFR section 122.22(b)(1)];
  - b. The authorization specifies either an individual or a position having responsibility for the overall operation of the regulated facility or activity such as the position of plant

manager, operator of a well or a well field, superintendent, position of equivalent responsibility, or an individual or position having overall responsibility for environmental matters for the company. (A duly authorized representative may thus be either a named individual or any individual occupying a named position.) [40 CFR section 122.22(b)(2)]; and

- c. The written authorization is submitted to the Regional Water Board [40 CFR section 122.22(b)(3)].
- 4. If an authorization under Standard Provisions Reporting V.B.3 above is no longer accurate because a different individual or position has responsibility for the overall operation of the facility, a new authorization satisfying the requirements of Standard Provisions Reporting V.B.3 above must be submitted to the Regional Water Board prior to or together with any reports, information, or applications, to be signed by an authorized representative [40 CFR section 122.22(c)].
- 5. Any person signing a document under Standard Provisions Reporting V.B.2 or V.B.3 above shall make the following certification: "I certify under penalty of law that this document and all attachments were prepared under my direction or supervision in accordance with a system designed to assure that qualified personnel properly gather and evaluate the information submitted. Based on my inquiry of the person or persons who manage the system or those persons directly responsible for gathering the information, the information submitted is, to the best of my knowledge and belief, true, accurate, and complete. I am aware that there are significant penalties for submitting false information, including the possibility of fine and imprisonment for knowing violations." [40 CFR section 122.22(d)].

All required signatures and statements will be included as an attachment of the Annual Report, which will be submitted to the Regional Board by December 15<sup>th</sup> of each year, for at least the duration of the Permit term.

# Section 12 Schedule for CIMP Implementation

As stated in Part IV.C.6 of the MRP, the SMB EWMP Group's CIMP implementation will initiate within 90 days after approval by the Executive Officer of the Regional Board. Monitoring of the existing twenty-four (24) SMBBB TMDL monitoring sites will continue per the CSMP schedule. Implementation of the seven CIMP monitoring sites will be initiated upon approval. Monitoring of Table E-2 constituents, toxicity and field parameters at RW-SMB-1 and RW- SMB-3 will commence immediately upon approval of this CIMP according to the schedule in this CIMP. Five of the sites (RW-SMB-2, OF-SMB-1, OF-SMB-2, OF-MB-3, OF-SMB-4) will require installation of fixed autosamplers and appurtenances. Implementation of these autosamplers may be subject to the availability and approval of construction permits from U.S. Army Corps of Engineers (Section 404 Nationwide Permit), Regional Board (Section 401 Water Quality Certification), Department of Fish and Wildlife (1602 Streambed Alteration Agreement), California Coastal Commission, California Department of Transportation, California State Parks, LACFCD, County Department of Beaches and Harbor, and other property owners. It is anticipated that the permitting and installation process of the fixed autosamplers will be completed within 18 months after CIMP approval. Prior to the installation of the autosamplers, the SMB EWMP Group will conduct water quality sampling using time-weighted temporary/portable auto sampling equipment (first option), or collect composite grab samples every 20 minutes for three hours or the duration of the storm (if less than three hours) as a second option (USEPA, 1992a).

# Section 13 References

- California Department of Fish and Wildlife. Ecosystem Restoration Program, Adaptive Management https://www.dfg.ca.gov/erp/adaptive\_management.asp. April 2014.
- California Regional Water Quality Control Board, Los Angeles Region, Order No. R4-2012-0175 NPDES Permit No. CAS004001, Waste Discharge Requirements for Municipal Separate Storm Sewer System (MS4) Discharges within the Coastal Watersheds of Los Angeles County, Except Those Discharges Originating From The City of Long Beach MS4. November 2012.
- California Regional Water Quality Control Board, Los Angeles Region, Santa Monica Bay Nearshore and Offshore Debris TMDL, October 2010.
- CH2M Hill and CDM, Santa Bay Beaches Wet Weather Bacteria TMDL Implementation Plan for JG2 and JG3. June 2005.
- City of Los Angeles, Environmental Monitoring Division, Santa Monica Bay Shoreline Monitoring Municipal Separate Storm Sewer System (MS4) Report (June 1, 2011 – May 30, 2012), 2012.
- City of Los Angeles, Watershed Protection Division, Concept Memo #5 Outfall and Receiving Water Monitoring Approach. December 2013.
- Cowgill, U.M. and D.P. Milazzo. 1990. The sensitivity of two cladocerans to water quality variables, salinity and hardness. Arch. Hydrobiol. 120:185–196.
- Kayhanian, M., C. Stransky, S. Bay, S. Lau, M.K. Stenstrom. 2008. Toxicity of urban highway runoff with respect to sorm duration. Science of the Total Environment 389:109-128
- Lee, G. F. and A. Jones-Lee. "Review of the City of Stockton Urban Stormwater Runoff Aquatic Life Toxicity Studies Conducted by the CVRWQCB, DeltaKeeper and the University of California, Davis, Aquatic Toxicology Laboratory between 1994 and 2000," Report to the Central Valley Regional Water Quality Control Board, G. Fred Lee & Associates, El Macero, CA, October (2001).
- Los Angeles RWQCB, Attachment A to Resolution No. 2002-022 Final 12/12/02 1 Amendment to the Water Quality Control Plan – Los Angeles Region to incorporate Implementation Provisions for the Region's Bacteria Objectives and to incorporate the Santa Monica Bay Beaches Wet-Weather Bacteria TMDL, 2002.
- Los Angeles RWQCB, Water Quality in the Santa Monica Bay Watershed Under the Surface Water Ambient Monitoring Program Fiscal Year 2001-2002, 2005.
- Los Angeles RWQCB, Order No.R4-2010-0200 NPDES No. CA0109991 Waste Discharge Requirements and National Pollutant Discharge Elimination System Permit for the City of Los Angeles, Hyperion Treatment Plant Discharge to the Pacific Ocean, 2010.

- Los Angeles World Airports Environmental Services Division (LAWA ESD), Storm Water Pollution Prevention Plan (SWPPP), Storm Water Monitoring Program Plan (SWMPP) Associated with Industrial Activities 2012 – 2013. September 2013
- MWH Team, Draft Water Quality Priorities Technical Memorandum, December 16, 2013a. (TM 2.1)
- MWH Team, Draft Existing and Potential Control Measures Technical Memorandum, December 16, 2013b. (TM 2.2)
- MWH Team, Draft Reasonable Assurance Analysis Approach Technical Memorandum, December 16, 2013c. (TM 2.3)
- MWH Team, Draft Monitoring Approach Technical Memorandum, December 16, 2013. (TM 3.1)
- MWH Team, *Draft Site Selection Memorandum*, March 14, 2014. (TM 3.2)
- MWH Team, Draft Enhanced Watershed Management Program Work Plan. March 17, 2014a.
- MWH Team, Draft New Development/Re-Development Effectiveness Tracking Memorandum. March 17, 2014b. (TM 2.1)
- Palumbo, A., Fojut, T., TenBrook, P. and Tjerdeema, R. 2010a. Water Quality Criteria Report for Diazinon. Prepared for the Central Valley Regional Water Quality Control Board by the Department of Environmental Toxicology, University of California, Davis. March.
- Palumbo, A., Fojut, T., Brander, S., and Tjerdeema, R. 2010b. Water Quality Criteria Report for Bifenthrin. Prepared for the Central Valley Regional Water Quality Control Board by the Department of Environmental Toxicology, University of California, Davis. March.
- Santa Monica Public Works. SMURRF: Santa Monica Urban Runoff Recycling Facility. http://www.smgov.net/Departments/PublicWorks/ContentCivEng.aspx?id=7796. December 2013
- Santa Monica Public Works. *SMURRF: Santa Monica Urban Runoff Recycling Facility Fact Sheet.* http://www.smgov.net/uploadedFiles/Departments/OSE/Categories/Urban\_Runoff/UR\_SMURR F\_Info\_Sheets.pdf. December 2013
- Schiff, K., Bax, B., Markle, P., Fleming, T. and Newman, J. 2007. Wet and Dry Weather Toxicity in the San Gabriel River. Bulletin of the Southern California Academy of Sciences: Vol. 106: 3.Available at: http://scholar.oxy.edu/scas/vol106/iss3/2
- Southern California Coastal Water Research Project, Bight'13 Contaminant Impact Assessment Field Operations Manual - Appendix A, 2013 http://www.sccwrp.org/Documents/BightDocuments/Bight13Documents/Bight13PlanningDocum ents.aspx.
- Technical Steering Committee City of Los Angeles and County of Los Angeles, Co-Chairs, Santa Monica Bay Beaches Bacterial TMDLs Coordinated Shoreline Monitoring Plan, 2004
- United States Environmental Protection Agency (USEPA). 1991. Methods for Aquatic Toxicity Identification Evaluations: Phase I. Toxicity Characterization Procedures. 2nd Edition. EPA-600-6-91-003. National Effluent Toxicity Assessment Center, Duluth, MN.

- United States Environmental Protection Agency (USEPA), 1992a. NPDES Storm Water Sampling Guidance Document, EPA 833-B-92, 40 CFR 122.21 (g)(7)(ii).
- United States Environmental Protection Agency (USEPA). 1992b. Toxicity Identification Evaluation: Characterization of Chronically Toxic Effluents, Phase I. EPA/600/6-91/005F. May 1992. National Effluent Toxicity Assessment Center, Duluth, MN.
- United States Environmental Protection Agency (USEPA). 1993a. Methods for Aquatic Toxicity Identification Evaluations- Phase II Toxicity Identification Procedures for Samples Exhibiting Acute and Chronic Toxicity. EPA-600-R-92-080. National Effluent Toxicity Assessment Center, Duluth, MN.
- United States Environmental Protection Agency (USEPA). 1993b. Methods for Aquatic Toxicity Identification Evaluations- Phase III Toxicity Confirmation Procedures for Samples Exhibiting Acute and Chronic Toxicity. EPA-600-R-92-081. National Effluent Toxicity Assessment Center, Duluth, MN.
- United States Environmental Protection Agency (USEPA). 1995. Short-term Methods for Estimating the Chronic Toxicity of Effluents and Receiving Waters to West Coast Marine and Estuarine Organisms. EPA-600-R-95-136. August.
- U.S. Environmental Protection Agency (USEPA). 1996. Marine toxicity identification evaluation (TIE): Phase I guidance document. EPA/600/R-96/054. National Health and Environmental Effects Research Laboratory. Narragansett, RI.
- United States Environmental Protection Agency (USEPA). 2002a. Short-term Methods for Estimating the Chronic Toxicity of Effluents and Receiving Waters to Freshwater Organisms. Fourth Edition. October. EPA-821-R-02-013.
- United States Environmental Protection Agency (USEPA). 2002b. Methods for Measuring the Acute Toxicity of Effluent and Receiving Waters to Freshwater and Marine Organisms. Fifth Edition. October. EPA-821-R-02-012.
- United States Environmental Protection Agency (USEPA), Region 2, 2004, Guidance for the Development of Quality Assurance Project Plans for Environmental Monitoring Projects. April 12, 2004
- United States Environmental Protection Agency (USEPA). 2007. Sediment toxicity identification evaluation (TIE) phases I, II, and III guidance document. EPA/600/R-07/080. U.S. Environmental Protection Agency, Office of Research and Development, Atlantic Ecology Division. Narragansett, RI.
- United States Environmental Protection Agency (USEPA) 2009, New England, Quality Assurance Project Plan Guidance for Environmental Projects Using Only Existing (Secondary) Data. October 2009
- United States Environmental Protection Agency (USEPA). 2010. National Pollutant Discharge Elimination System Test of Significant Toxicity Technical Document. EPA/833-R-10-004, U.S. Environmental Protection Agency, Office of Environmental Management, Washington, DC.

- United States Environmental Protection Agency, Region IX, 2013, Santa Monica Bay Total Maximum Daily Loads for DDTs and PCBs. March 2013
- Wheelock, C., Miller, J., Miller, M., Gee, S., Shan, G. and Hammock, B. 2004. Development of Toxicity Identification Evaluation (TIE) procedures for pyrethroid detection using esterase activity. Environmental Toxicology and Chemistry 23:2699-2708

# **Attachment A**

# Watershed Management Plan Area Background

# Section 1 Watershed Background

The Santa Monica Bay Enhanced Watershed Management Program Group (SMB EWMP Group) is located in Los Angeles County within the Santa Monica Bay Watershed Management Area (Santa Monica Bay WMA). This attachment provides background information on the SMB EWMP Group watershed.

## 1.1 Watershed Management Program Area Overview

The Santa Monica Bay WMA encompasses an area of approximately 264,960 acres. The SMB EWMP Group is located within the central region of the Santa Monica Bay Watershed that drains into the Santa Monica Bay.

The total area of JG2/3 is approximately 33,967 acres. The SMB EWMP Group encompasses approximately 25,238 acres within JG2/3 of Santa Monica Bay. The remaining JG2/3 area encompasses approximately 8,729 acres and includes land owned by the California Department of Transportation (Caltrans), Chevron, El Segundo Generation Station, State of California, and the U.S. Government. These agencies/organizations are not participants of the SMB EWMP Group.

The receiving waters defined by the Basin Plan within the SMB EWMP Group include:

- Santa Monica Bay
- Santa Monica Canyon Channel
  - o Rustic Canyon Creek
  - Mandeville Canyon Creek
  - Sullivan Canyon Creek
- Santa Ynez Canyon

Attachment B of the National Pollutant Discharge Elimination System (NPDES) Municipal Separate Storm Sewer System (MS4) Permit No. R4-2012-0175 (Permit) for Los Angeles County (MS4 Permit) mapped United States Geological Survey Hydrologic Units, and other features, based on antiquated Hydrologic Unit Codes (HUC-12) watershed boundaries. In-lieu of these Permit specified boundaries, on March 26, 2014 the Regional Board Reasonable Assurance Analysis (RAA) Guidelines allows EWMP group to use HUC-12 equivalent watersheds, prepared by the Los Angeles County Flood Control District (LACFCD). Using the LACFCD HUC-12 layer and numbering conventions, the LACFCD HUC-12 boundaries, relevant to the SMB EWMP Group, and identified as follows:

- Santa Monica Beach Frontal Santa Monica Bay (180701040403)
- Santa Monica Canyon (180701040402)
- Manhattan Beach Frontal Santa Monica Bay (180701040500)

### **1.2** Participating Permittees

The SMB EWMP Group is comprised of the five participating agencies: the Cities of El Segundo, Los Angeles, and Santa Monica, the County of Los Angeles, and the LACFCD.

## **1.3 Geographic Boundaries**

Santa Monica Bay is an integral part of the larger geographic region commonly known as the Southern California Bight (or bend in the coastline). It is bordered offshore by the Santa Monica Basin, to the north by the rocky headlands of Point Dume, and to the south by the Palos Verdes Peninsula, and onshore by the Los Angeles Coastal Plain and Santa Monica Mountains. The 264,960 acres of land that drains naturally to Santa Monica Bay is bordered on the north by the Santa Monica Mountains from the Ventura-Los Angeles Coastal Plain to include the area east of Ballona Creek and north of Baldwin Hills. South of Ballona Creek, a narrow coastal strip between Playa del Rey and the Palos Verdes Peninsula forms the southern boundary of the watershed. The Santa Monica Bay itself is the submerged portion of the Los Angeles Coastal Plain. The continental shelf extends seaward to the shelf break about 265 feet underwater, then drops steeply to the Santa Monica Basin at about 2,630 feet underwater.

Near shore Santa Monica Bay is defined by the Ocean Plan as a zone bounded by the shoreline and a distance of 1,000 feet from the shoreline or the 30-foot contour, whichever is further from the shoreline. Offshore is defined as the waters between the near shore zone and the limit of State Waters. Lastly, State Waters, according to Section 13200 of the California Water Code (CWC), extends three nautical miles into the Pacific Ocean from the line of mean lower low water marking the seaward limits of inland waters and three nautical miles from the line of mean lower low water on the mainland and each offshore island.

# Section 2 Total Maximum Daily Load Monitoring Requirements

The Total Maximum Daily Loads (TMDLs) addressing water body-pollutant combinations within or downstream of the SMB EWMP Group include:

- Santa Monica Bay Beaches Bacteria TMDL (Wet and Dry), July 15, 2003 (SMBBB TMDL)
- Santa Monica Bay TMDL for Dichlorodiphenyltrichloroethane (DDTs) and Polychlorinated biphenyls (PCBs), March 26, 2012 (SMB DDT and PCB TMDL)
- Santa Monica Bay Nearshore and Offshore Debris TMDL, March 20, 2012 (SMB Debris TMDL)

The only approved coordinated monitoring plan for the TMDLs addressing water body-pollutant combinations within the SMB EWMP Group is the SMBBB TMDL (as will be described in **Section 2.1**). Part XIX of the MRP includes TMDL monitoring requirements, which are summarized in the following subsections below.

### 2.1 Santa Monica Bay Beaches Bacteria Total Maximum Daily Load

SMBBB TMDL was the first bacteria TMDL adopted by the Regional Board in the State of California. The dry-weather criterion was first adopted on January 24, 2002, and the wet-weather criterion was adopted on December 12, 2002. Both came in effect on July 15, 2003.

As this was the first bacteria TMDL, new approaches for regulating bacteria were developed. A 2-year work plan was implemented to support the TMDL, including an intensive wet-weather monitoring effort, watershed modeling, and various special studies. Based on these studies, new implementation provisions for bacteria were incorporated into the Basin Plan. The SMBBB TMDL used these new approaches, including the reference beach/antidegradation approach and the corresponding exceedance day approach to expressing TMDL allocations.

In 2012, the Regional Board put forward the *Reconsideration of Certain Technical Matters for the Santa Monica Bay Beach Bacteria TMDLs; the Marina del Rey Harbor Mothers' Beach and Back Basins Bacteria TMDL; and the Los Angeles Harbor Inner Cabrillo Beach and Main Ship Channel Bacteria TMDL. The reconsideration examined certain elements of the SMBBB TMDL, which is presented in Table A-1. Through the reconsideration process, winter dry-weather single sample allowable exceedance days were increased and modifications were made to the geometric mean calculation.* 

### Table A-1

TMDL	Reconsideration Items <sup>(1)</sup>
Santa Monica Bay Beaches Dry- Weather TMDL 4 years after effective date of July 15, 2003	Re-consider TMDL to re-evaluate allowable winter dry weather exceedance days based on additional data on bacterial indicator densities in the wave wash, a reevaluation of the reference system selected to set allowable exceedance levels, and a re-evaluation of the reference year used in the calculation of allowable exceedance days.
Santa Monica Bay Beaches Wet- Weather TMDL 4 years after effective date of July 15, 2003	Refine allowable wet weather exceedance days based on additional data on bacterial indicator densities in the wave wash and an evaluation of site-specific variability in exceedance levels.
	Re-evaluate the reference system selected to set allowable exceedance levels, including a reconsideration of whether the allowable number of exceedance days should be adjusted annually dependent on the rainfall conditions and an evaluation of natural variability in exceedance levels in the reference system(s).
	Re-evaluate the reference year used in the calculation of allowable exceedance days.
	Re-evaluate whether there is a need for further clarification or revision of the geometric mean implementation provision.

#### Summary of Reconsideration Elements for Santa Monica Bay Beach Bacteria TMDL

1. Elements for this reconsideration are to be re-evaluated in 2018, before the final compliance deadline of 2021.

The SMBBB TMDL establishes multi-part numeric targets for total coliform, fecal coliform, and enterococcus densities, reported as bacteria counts (Most Probable Number, MPN or colony forming unit, cfu) per 100 milliliters of sample. The TMDL waste load allocation (WLA), expressed as water quality-based effluent limitations (WQBELs) for outfall discharges, are based on the Los Angeles Basin Plan objectives for body-contact recreation (REC-1) as summarized in **Table A-2.** Dry-weather WQBELs compliance was anticipated as of December 28, 2012, the effective date of the order, while wet-weather compliance is anticipated by July 15, 2021.

#### Table A-2

#### Santa Monica Bay Bacteria Total Maximum Daily Load Water Quality-Based Effluent Limitations

Constituent	Daily Maximum (MPN or colony forming unit)	Rolling 30-day Geometric Mean (MPN or colony forming unit)
Total coliform <sup>1</sup>	10,000/100 mL <sup>(1)</sup>	1,000/100 mL
Fecal coliform	400/100 mL	200/100 mL
Enterococcus	104/100 mL	35/100 mL

1. Total coliform density shall not exceed a daily maximum of 1,000/100 mL, if the ratio of fecal to total coliform exceeds 0.1.

The TMDL WLA, expressed as receiving water limitations (RWLs), are based on the Los Angeles Basin Plan objectives for body-contact recreation (REC-1) as summarized in **Table A-3**. Dry-weather WQBELs compliance was anticipated as of December 28, 2012, the effective date of the order, while wet-weather compliance is anticipated by July 15, 2021.

### Table A-3

Constituent	Single Sample Limits (MPN or colony forming unit)	Rolling 30-day Geometric Mean (MPN or colony forming unit)
Total coliform	10,000/100 mL <sup>(1)</sup>	1,000/100 mL
Fecal coliform	400/100 mL	200/100 mL
Enterococcus	104/100 mL	35/100 mL

#### Santa Monica Bay Bacteria Total Maximum Daily Load Receiving Water Limitation

1. Total coliform density shall not exceed 1,000/100 ml, if the ratio of fecal-to-total coliform exceeds 0.1.

Recognizing that rainfall and other natural events may cause an exceedance, the TMDL limits the number of allowed annual exceedance days. An exceedance day occurs when the average of samples taken within the preceding 30 days exceeds the geometric mean limit or when any single sample exceeds the RWL.

The interim single sample bacteria RWL schedule for wet-weather exceedance day percent reduction is presented in **Table A-4**.

#### Table A-4

#### Interim Single Sample Receiving Water Limitations Schedule

Deadline	Cumulative Percentage Reduction from the Total Exceedance Day Reductions Required for Each Jurisdictional Group as Identified in Table M-1 of the MS4 Permit
July 15, 2009	10%
July 15, 2013	25%
July 15, 2018	50%

**Table A-5** presents the interim single sample bacteria RWLs for the SMB EWMP Group. Permittees in each jurisdictional group must comply with the interim for all shoreline monitoring stations within their jurisdictional area during wet-weather.

JG	Primary	Additional Responsible Jurisdiction	Monitoring	<b>Reduction Milestone</b>		
JG	Jurisdiction	and Agencies	Sites	10%	25%	50%
2	City of Los Angeles	City of El Segundo (Dockweiler only) City of Santa Monica County of Los Angeles	SMB 2-1 to SMB 2-15	342	324	294
3	City of Santa Monica	City of Los Angeles County of Los Angeles	SMB 3-1 SMB 3-2 SMB 3-3 SMB 3-4 SMB 3-5 SMB 3-6 SMB 3-7 SMB 3-8 <sup>#</sup> SMB 3-8 <sup>#</sup>	257	237	203

# Interim Maximum Allowable Exceedance Days during Wet-Weather

Table A-5

<sup>1</sup> Interim Single Sample Bacteria Receiving Water Limitations.

<sup>#</sup> Monitoring locations subject to the antidegradation implementation provision in the TMDL.

Through the 2012 reconsideration process, the grouped final single sample bacteria RWLs for all monitoring stations along Santa Monica Bay, except for those monitoring stations subject to the antidegradation implementation provisions as summarized in **Table A-6**. Compliance is anticipated by July 15, 2021.

#### Table A-6

Time Period	Daily Sampling	Weekly Sampling	
Summer Dry Weather (April 1 to October 31)	0	0	
Winter Dry Weather (November 1 to March 31)	3	1	
Wet Weather <sup>2</sup> (Year-round)	17	3	

1 The final receiving water limitations are group-based and shared among all MS4 Permittees located within the subdrainage area to each beach monitoring location.

2 Wet-weather is defined as days with 0.1 inch of rain or greater and the three days following the rain event.

In addition, the 2012 reconsideration also modified the grouped final single sample bacteria RWL for beaches identified as anti-degradation beaches as summarized in **Table A-7**. These new calculations were made using monitoring data collected from 2004 to 2010.

#### Table A-7

#### Annual Allowable Exceedance Days of the Single Sample Objective (days)<sup>1</sup>

	Beach	Summer Dry-Weather (April 1 - October 31)		Winter Dry-Weather (November 1 - March 31)		Wet-Weather (Year- round)	
Monitoring Sites	Monitoring Locations	Daily Sampling	Weekly Sampling	Daily Sampling	Weekly Sampling	Daily Sampling	Weekly Sampling
SMB 2-13	Imperial Highway storm drain	0	0	2	1	17	3
SMB 3-8	Windward Ave. storm drain at Venice Pavilion	0	0	2	1	13	2

1 The final receiving water limitations are group-based and shared among all MS4 Permittees located within the sub-drainage area to each beach monitoring location.

# 2.1.1 Low Flow Diversions

To comply with dry-weather flow and SMBBB TMDL dry-weather exceedances, SMB EMWP Group has installed 23 low flow diversions (LFDs), as details are listed in **Table A-8** and shown in **Figure A-1**. The LFDs are operational year round and divert dry-weather flow from the storm drains to the sanitary sewer system, keeping dry-weather flows from reaching Santa Monica Bay. Once in the sanitary sewer system, flows are treated at the Hyperion Treatment Plant (HTP) before being discharged through the 5-mile outfall, which discharges un-chlorinated secondary treated wastewater.

Name	Owner	Latitude	Longitudo	Project Title
Name	Owner	Latitude	Longitude	ů – Elektrik
Bay Club Drive	City of Los Angeles	34.040784	-118.545169	Bay Club Drive Low Flow Diversion Project
Thronton Avenue	City of Los Angeles	33.993324	-118.475411	Thornton Avenue Low Flow Diversion Project
Palisades Park	City of Los Angeles	34.031694	-118.526400	Palisades Park Low Flow Diversion Project
Santa Monica Canyon	City of Los Angeles	34.027704	-118.518952	Santa Monica Low Flow Diversion Project
Venice Pavilion	City of Los Angeles	33.988239	-118.471236	Venice Pavilion Low Flow Diversion Project
Imperial Highways	City of Los Angeles	33.930915	-118.429173	Imperial Highway Low Flow Diversion Project
Temescal Canyon	City of Los Angeles	34.035875	-118.535386	Temescal Canyon Low Flow Diversion
Pulga Canyon	LACFCD	34.038724	-118.542464	Pulga Canyon Low Flow Diversion Project
Marques Avenue	City of Los Angeles	34.039604	-118.549626	Marquez Avenue Low Flow Diversion
Santa Ynez	LACFCD	34.039079	-118.555013	Santa Ynez Low Flow Diversion
Castlerock/Parke r Canyon	LACFCD	34.041694	-118.567516	Castlerock/Parker Canyon Low Flow Diversion
Rose Avenue	LACFCD	33.998155	-118.474197	Rose Ave. Low Flow Diversion
Ashland Avenue	LACFCD	33.998087	-118.484046	Ashland Ave. Low Flow Diversion
Brooks Avenue	LACFCD	33.992216	-118.474245	Brooks Ave. Low Flow Diversion
Playa del Rey	LACFCD	33.957210	-118.450879	Playa del Rey Low Flow Diversion
North Westchester	LACFCD	33.945531	-118.442492	North Westchester Low Flow Diversion
Santa Monica Pier	City of Santa Monica	34.009925	-118.496375	Santa Monica Pier Low Flow Diversion
Wilshire Boulevard	City of Santa Monica	34.016712	-118.502077	Wilshire Blvd Low Flow Diversion
Montana Avenue	City of Santa Monica	34.021984	-118.507841	Montana Ave. Low Flow Diversion
Pico-Kenter (SMURFF)	City of Santa Monica	34.006439	-118.491889	Pico-Kenter (SMURRF)
Imperial Highway	LACFCD	33.930892	-118.434895	Imperial Highway Low Flow Diversion Project
Arena Pump Plant	LACFCD	33.916390	-118.414636	Arena Pump Plant
El Segundo Pump Plant	LACFCD	33.918549	-118.404877	El Segundo Pump Plant

#### Table A-8

#### Santa Monica Bay Enhanced Watershed Management Program Group Low Flow Diversions

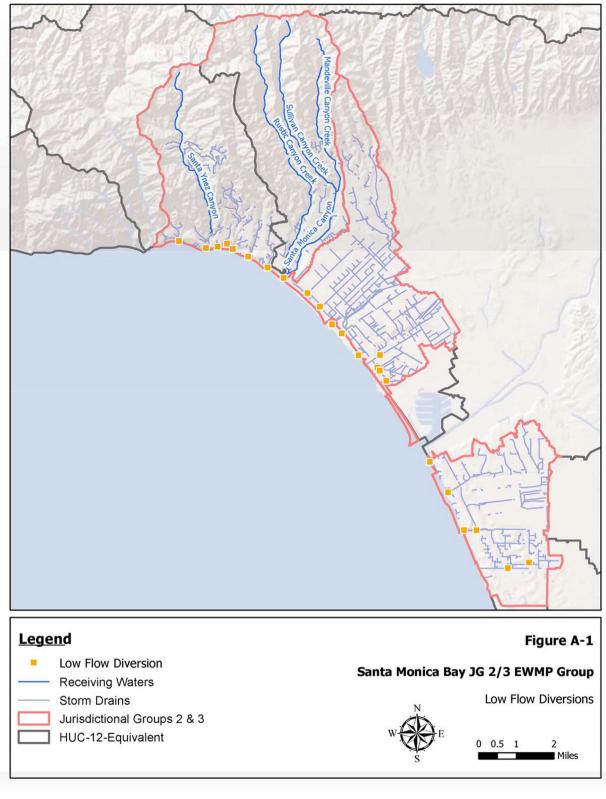


Figure A-1 Low Flow Diversions

Since the installation of the LFDs, data from the tested samples for the Santa Monica Bay Beaches Bacteria Total Maximum Daily Loads (SMBBB TMDL) monitoring sites show a significant improvement in dry weather water quality, due to elimination of MS4 discharge into Santa Monica Bay. This in turn, resulted in a significant decrease in dry weather exceedances and beach closures. One example of this was from the Marquez LFD. The facility started operation on April 1, 2007 and continued to operate until October 31, 2007. During this period the facility was periodically inspected to ensure proper operation. The data from the tested samples at the site show a marked improvement in water quality, due to the fact there was only one exceedance during testing period. Also, the geometric means for the three indicators are at, or near, the lower detection limits for these samples (10 MPN/100 mL). The data for the tests conducted during the dry-weather period indicates that the construction/installation of the Marquez LFD has reduced the exceedance days in Santa Monica Bay.

Heal the Bay has also noted in their Beach Report Card for 2006-2007 that, as a result of the SMB EWMP Groups LFD projects and other initiatives, "Stretches of beach with good water quality included all of Will Rogers State Beach, including Santa Monica Canyon. Clean water for all two miles of Will Rogers State Beach was a first in Beach Report Card history - a testament to Los Angeles City and County runoff diversions and the tougher summer beach water quality regulations." LFDs within SMB EWMP Group area have helped to clean up waterways by treating polluted dry-weather runoff before it reaches beaches and ultimately Santa Monica Bay. Comparison graphs of the Heal the Bay Beach Report Cards for 2008-2013and the current 2013-2014 Beach Report Cards are also included in **Appendix A**.

Currently, pilot testing is being conducted to improve telemetry capabilities, optimize operation and maintenance, and minimize downtime of the LFDs, in addition to enhancing some of the LFDs at existing locations.

No dry-weather receiving water monitoring in the Santa Monica Bay is being proposed as the existing LFDs divert all dry-weather flows from entering the Bay.

# 2.2 Santa Monica Bay Dichlorodiphenyl-trichloro-ethene and Polychlorinated Biphenyls Total Maximum Daily Loads

The SMB DDTs and PCBs TMDLs are regulated for Santa Monica Bay from Point Dume to Point Vicente, and the Palos Verdes shelf from Point Vicente to Point Fermin. As the TMDL originates through the United States Environmental Protection Agency (USEPA). Within the Permit, the WLA targets are stated in **Table A-9**, which is expressed as an annual loading of pollutants to Santa Monica Bay.

#### Table A-9

#### Santa Monica Bay DDTs and PCBs Total Maximum Daily Load Waste Load Allocations Targets

Constituent	Annual Mass-Based WLA (g/yr) <sup>1</sup>
DDT	27.08
PCBs	140.25

Compliance shall be determined based on a three-year averaging period.

SMB DDT and PCB TMDL will be fulfilled at the receiving water monitoring site RW-SMB-2. It is proposed that three wet-weather sampling events be conducted to evaluate the annual WLA of DDT and PCB for SMB EWMP Group based on the three (3) year average loading.

# 2.3 Santa Monica Bay Debris Total Maximum Daily Loads

Compliance with the SMB Debris TMDL is based on the final Numeric Target, WLA, and Load Allocation (LA), which are defined as zero trash in and on the shorelines of Santa Monica Bay, and no plastic pellets discharged from plastic manufacturers and facilities. The compliance deadline is to be achieved no later than March 20, 2020, and every year thereafter. If a Permittee adopts local ordinances to ban plastic bags, smoking in public places, and single-use expanded polystyrene food packaging by November 4, 2013, the final compliance deadline will be extended to March 20, 2023. The SMB Debris TMDL compliance is assessed in accordance with the Permittees' implementation of BMP to address point and non-point source trash and plastic pellet abatement, and attainment of the progressive trash reductions in accordance with the TMDL compliance schedule as shown in **Table A-10**.

#### Table A-10

		March 20, 2016	March 20, 2017	March 20, 2018	March 20, 2019	March 20, 2020 <sup>2</sup>
Permittees	Baseline <sup>1</sup>		Annual T	rash Discharge	(gals/yr)	
County of LA	5,138	4,110	3,083	2,055	1,028	0
El Segundo	2,732	2,186	1,639	1,093	546	0
Los Angeles	25,112	20,090	15,067	10,045	5,022	0
Santa Monica	5,672	4,537	3,403	2,269	1,134	0

#### Santa Monica Bay Debris Total Maximum Daily Load Compliance Schedule

1 If a Permittee elects not to use the default baseline, then the Permittee shall include a plan to establish a site specific trash baseline in their TMRP.

2 Permittees shall achieve their final effluent limitation of zero trash discharge for the 2019-2020 storm year and every year thereafter.

Permittees are to report compliance strategy through the development of a Trash Monitoring and Reporting Plan (TMRP) and Plastic Pellets Monitoring and Reporting Plan (PMRP), or demonstrate that a PMRP is not required, to be approved by the Regional Board. Once the TMRP and PMRP are approved and adopted, a progress report based on installation of structural BMPs, such as full capture or partial capture systems, institutional controls, or any BMPs, is to be reported in order to calculate the reduction in the amount of trash and plastic pellets, if applicable, being discharged into Santa Monica Bay.

To fulfill these requirements each of the jurisdictions within SMB EWMP Group will submit or have already submitted a TMRP and PMRP, as summarized in **Section 2.2.4** All submitted TMRPs and PMRPs for each jurisdiction will be implemented by the corresponding jurisdiction, once approved by the Regional Board. As the SMB Debris TMDL is fulfilled through the implementation of BMPs to achieve compliance of zero trash in and on the shorelines of Santa Monica Bay, monitoring is not required if complying with the WLA. Manufacturers of plastic pellets were not identified within any of the SMB EWMP Group's jurisdictional area, and monitoring for plastic pellets at the MS4 is not required. Appropriate actions for emergency spills and special circumstances for safety considerations are addressed for each jurisdiction.

# Section 3 Existing Watershed Monitoring Programs

Existing watershed monitoring programs provide historical data and identification of constituents for monitoring. The following subsections briefly describe significant existing and historical monitoring programs relevant to the SMB EWMP Group.

### 3.1 MS4 Permit Monitoring

MS4 Permit monitoring within SMB EMWP Group area consist of the following:

- Los Angeles World Airport Storm Water Monitoring Program
- Santa Monica Urban Runoff Recycling Facility Monitoring

## 3.1.1 Los Angeles World Airport Storm Water Monitoring Program

Under the NPDES General Industrial Stormwater Permit, the Los Angeles World Airports (LAWA) implemented an airport-wide Storm Water Pollution Preventon Plan (SWPPP) as mandated by the Federal, State, and local stormwater regulations. The goal of the SWPPP is to identify and eliminate the sources of pollutants associated with industrial and construction activities that may affect the quality of stormwater discharges and authorized NSW discharges from the facility, and to identify and implement site-specific BMPs to reduce or prevent pollutants associated with industrial and construction activities in stormwater discharges and authorized NSW discharges. To maintain compliance with LAWA permitted discharge operations, the following are regularly performed:

- Conduct regular stormwater compliance inspections of all airport tenants' facilities;
- Document airport chemical spills, release responses and notifications, and monitor and document wet and dry season airport industrial discharge activities;
- Prepare and provide annual reports to the Regional Board, and prepare and update SWPPPs; and
- Conduct annual stormwater compliance training on SWPPP requirements and BMPs to LAWA and airport tenant personnel.

Surface water runoff at Los Angeles International Airport (LAX) is collected in catch basins and drainage ditches throughout the airport. The runoff flows through an underground storm sewer system, which is owned and operated by LAWA, and discharges into one of three main stormwater conveyances: Argo Storm Drain, Dominguez Channel, or the Imperial (County) Storm Drain. The Argo and Imperial storm drains discharge directly to Santa Monica Bay.

To monitor the surface water runoff at LAX, a Storm Water Monitoring Program Plan (SWMPP) was developed and implemented prior to January 1, 1993. The objectives of the monitoring program include:

- Monitoring the quality of stormwater discharges;
- Evaluating the effectiveness of on-site conditions and practices that control the discharge of pollutants to stormwater;
- Aiding in the implementation of the SWPPP; and

• Measuring the effectiveness of BMPs implemented to remove or prevent potential pollutants from entering stormwater.

In order to document the elimination or reduction of pollutants as required in the SWPPP, the following elements of a stormwater monitoring program were implemented:

- Document annual comprehensive site compliance evaluation;
- Perform quarterly visual observations for the presence of NSW discharges during dry-weather conditions;
- Conduct visual observations from one storm per month, to be performed during the first hour of discharge at all discharge locations during the wet season (October 1 May 31);
- Collect and analyze stormwater samples during the first hour of discharge from (1) the first storm event of the wet season and (2) at least one other storm event in the wet season. If samples are not collected from the first storm event of the wet season, two other storms are required to be sampled during the remainder of the wet season; and

Submit an annual report by July 1 of each year to the Regional Board Note - annual LAX rainfall data is published by the National Oceanic Atmospheric Agency (NOAA)). **Figure A-2** illustrates the locations of the monitored sampling sites at LAX.

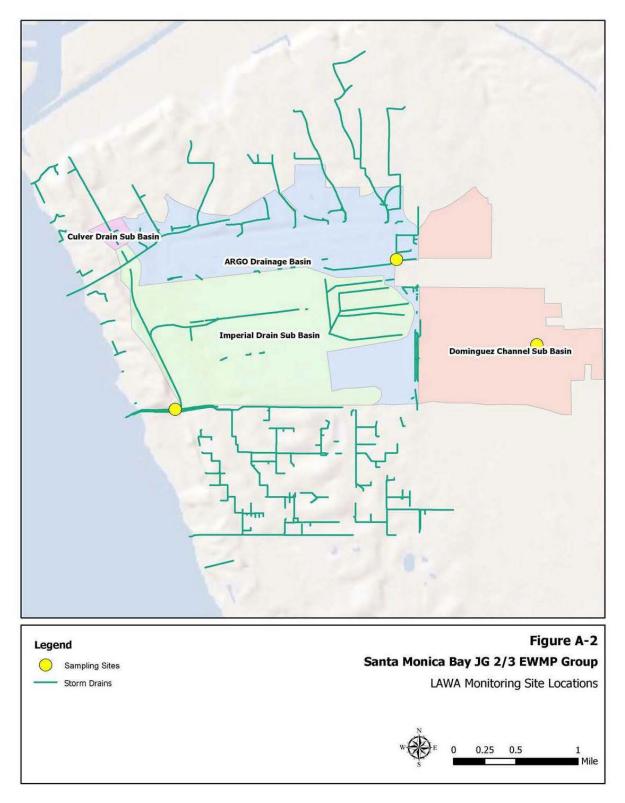


Figure A-2 LAWA Monitoring Site Locations

# 3.1.2 Santa Monica Urban Runoff Recycling Facility Monitoring

The primary objective of the Santa Monica Urban Runoff Recycling Facility (SMURRF) is to capture and eliminate pollution to Santa Monica Bay caused by dry-weather urban runoff and low precipitation storm events. SMURRF is a Best Management Practice (BMP), and not a stormwater management practice. It treats dry weather runoff. SMURFF diverts and treats all dry-weather urban runoff (from excessive irrigation, spills, construction sites, pool draining, car washing, the washing down of paved areas, and some initial wet-weather runoff) and low precipitation storm events, that was previously discharged into Santa Monica Bay through storm drain outlets and releasing pollutants such as litter, oil, and animal waste. The diverted dry weather flows enters the sanitary sewer system, and does not reach the Bay.

The SMURFF project is a joint venture of the City of Los Angeles and the City of Santa Monica. The SMURFF has a treatment design capacity of approximately 500,000 gallons per day (gpd) and currently treats approximately 175,000 to 225,000 gpd of urban runoff generated in parts of the City of Los Angeles and the City of Santa Monica. The urban runoff is diverted from the two cities' two main storm drains (Santa Monica Pier and Pico-Kenter) into the SMURFF, whereby pollutants such as trash, sediment, oil, grease, and pathogens are removed and prevented from entering into Santa Monica Bay. The main treatment processes include:

- Coarse and fine screening to remove trash and debris;
- Dissolved air flotation to remove oil and grease;
- Degritting systems to remove sand and grit;
- Micro-filtration to remove turbidity;
- Ultra-violet (UV) radiation to kill pathogens; and
- Chlorination.

Once treated, the effluent meets the water quality standards for landscaping, irrigation application, and dual-plumbed systems (buildings plumbed to accept recycled water for the flushing of toilets) as prescribed by the California Department of Health (CDPH). The treated water must meet all of California's Title 22 requirements.

Landscape irrigation customers include Caltrans highway landscaping along the Santa Monica Freeway, City of Santa Monica parks, the Woodlawn Cemetery, RAND Corporation, Olympic Boulevard median landscaping, and public school grounds. Dual-plumbed customers include the City of Santa Monica's Public Safety Facility and the Water Garden located at Olympic Boulevard and Cloverfield Boulevard.

SMURRF sampling occurs at the influent, incoming dry-weather urban runoff (prior to water treatment), and the effluent, post-treated water, sampling points. The samples are analyzed for fecal coliform, total coliform, general minerals, metals, nutrients, PCBs, pesticides, semi-volatile organic compounds (SVOCs), turbidity, and volatile organic compounds (VOCs).

The City of Santa Monica submits each year a water quality annual report on SMURRF treatment of dry weather runoff, influent and effluent water. This report is submitted at the time of the NPDES annual report submittal. The City will continue to follow this reporting procedure with the concurrence of the Los Angeles Regional Water Control Board. And changes to this reporting process will be discussed and agreed upon amongst the involved parties.

# 3.2 Regional Monitoring Programs

Regional Monitoring Programs within the SMB EWMP Group area consists of the following programs:

- Hyperion NPDES Permit Monitoring;
- Surface Water Ambient Monitoring Program; and
- Bight Regional Monitoring

Details for each monitoring program are provided in the following sections.

### 3.2.1 Hyperion NPDES Permit Monitoring

The HTP, located in Playa Del Rey, discharges advanced secondary treated wastewater through two outfalls located one (1) mile and five (5) miles from the Santa Monica Bay shoreline. The one-mile outfall discharges intermittent chlorinated secondary wastewater, except during emergencies such as intense storms or power outages. The five-mile discharges un-chlorinated advanced secondary treated wastewater on a daily basis. As part of the waste discharge requirements (WDRs) of Order No. R4-2010-0200, the City of Los Angeles must monitor influent and effluent concentrations, as well as 11 inshore stations and 21 offshore stations, each with four depths. Monitoring of inshore stations consists of annual (summer) sampling at a distance of 1,000 feet from the shoreline (or at the 30-foot depth contour, whichever is further from shore) of total coliform, fecal coliform, and enterococcus. The location of inshore monitoring sites within SMB EWMP Group Area is shown in **Figure A-3**.

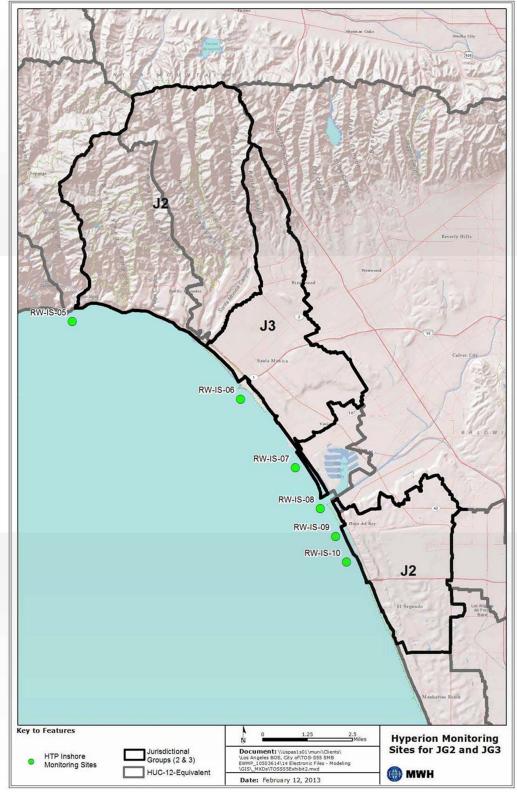


Figure A-3 Hyperion Monitoring Sites for JG2 and JG3

### 3.2.2 Surface Water Ambient Monitoring Program

The Surface Water Ambient Monitoring Program (SWAMP) is a statewide monitoring program, conducted by the State Water Resources Control Board (SWRCB) and Regional Boards in order to evaluate the quality of California's water resources. SWAMP monitoring was conducted by the Los Angeles Regional Board in 2003-2004 for the Santa Monica Bay WMA. Fifty-nine (59) sites within the Santa Monica Bay WMA and nine (9) within the SMB EWMP Group area were each sampled twice for a suite of parameters (one in March of 2003 and one in February of 2004). The weather conditions (wet or dry) at the time of sampling were not available from the data source. The samples were analyzed for the following constituents:

- Conductivity
- Dissolved Oxygen (DO)
- pH
- Salinity
- Temperature
- Turbidity
- Velocity
- Alkalinity

- Ammonia-N
- Boron
- Chloride
- Chlorophyll a
- Fluoride
- Hardness
- Nitrate-N
- Nitrite-N

- Orthophosphate
- Sulfate
- Total Dissolved Solids (TDS)
- Total Kjeldahl Nitrogen(TKN)
- Total Phosphorous (P)
- Bacteriology
- Orthophosphate
- Sulfate

SWAMP monitoring locations for 2003-2004 within the SMB EWMP Group area are shown on **Figure A-4**. Results from the data analysis show that constituents within the SMB EWMP Group area were below applicable WQOs, with the exception of one exceedance of RWL for pH.

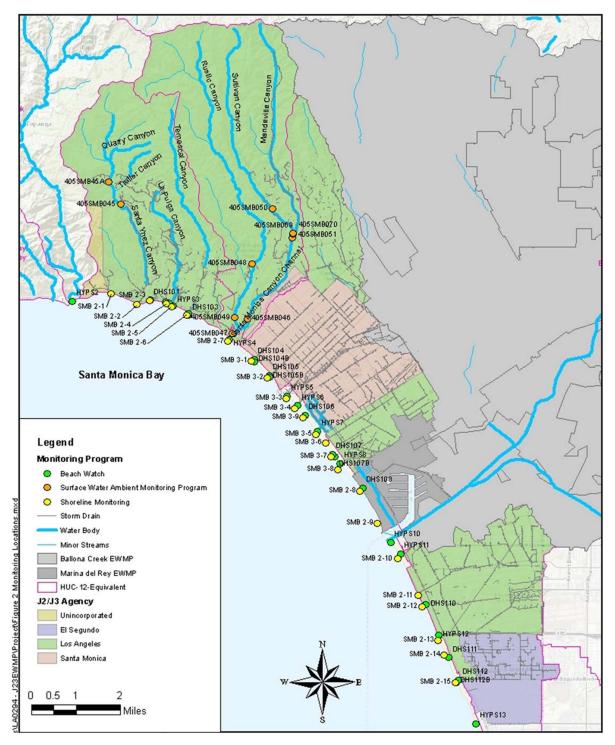


Figure A-4

# Existing Monitoring Locations within Santa Monica Bay EWMP Group Area

# 3.2.3 Bight Regional Monitoring

A regional monitoring program to assess the health of the Southern California Bight has been coordinated through Southern California Coastal Water Research Project (SCCWRP) at five-year intervals including 1994, 1998, 2003, 2008, and 2013. The Bight Regional Monitoring programs include:

- Coastal Ecology
- Shoreline Microbiology
- Offshore Water Quality
- Rocky Reef
- Areas of Special Biological Significance (ASBS)
- Coastal Wetlands and Estuaries

Through these programs, the SCCWRP has been able to conduct a regional assessment of the cumulative impacts from multiple sources. Past sampling (1994 – 2008) was conducted at the sites shown in **Figure A-5** and the current sampling locations are shown in **Figure A-6**. The monitoring site were analyzed for trace metals, Polychlorinated biphenyls (PCBs), Polycyclic aromatic hydrocarbons (PAHs), Poly Brominated Diphenyl Ethers, chlorinated hydrocarbons, total organic carbon (TOC), nitrogen, phosphorus, and grain size.

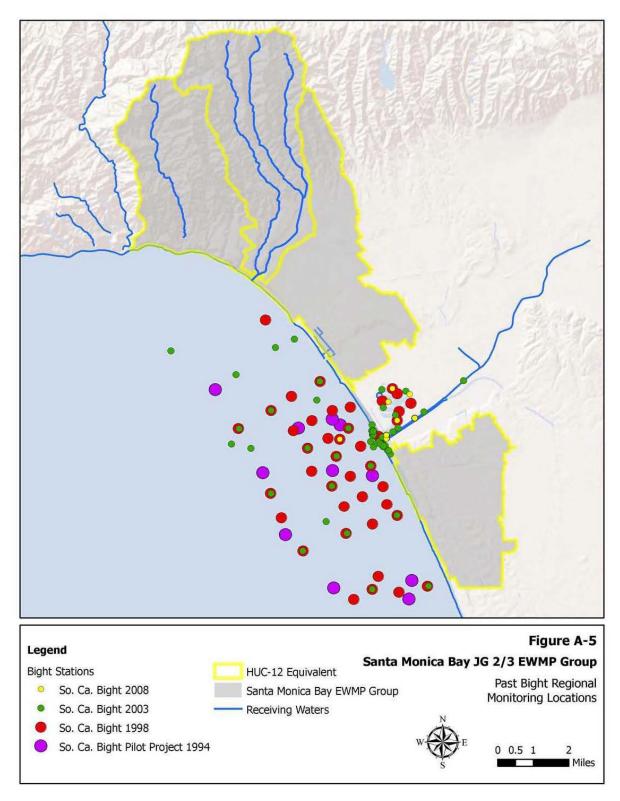


Figure A-5 Past Bight Regional Monitoring Locations

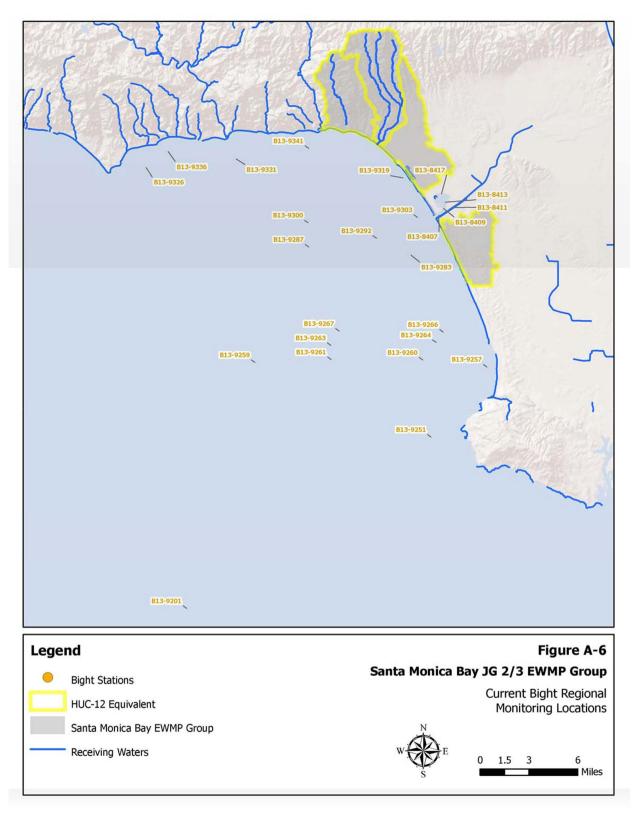


Figure A-6 Current Bight Regional Monitoring Locations

# 3.3 Existing Total Maximum Daily Load Monitoring Programs

The existing TMDL monitoring program within SMB EWMP Group that is currently being implemented is the Santa Monica Bay MS4 Coordinated Shoreline Monitoring. The monitoring program is detailed in the section below and presented in **Figure A-7**.

## 3.3.1 Santa Monica Bay MS4 Coordinated Shoreline Monitoring

The Santa Monica Bay beaches were designated as impaired and included on California's 1998 Clean Water ACT (CWA) §303(d) list of impaired waters due to excessive amounts of coliform bacteria. The presence of coliform bacteria in surface waters is an indicator that water quality may not be sufficient to maintain the beneficial use of these waters for human body contact recreation (REC-1). In 2003, the USEPA approved the SMBBB TMDL for dry- and wet-weather conditions. To comply with the requirements of the TMDL, the Jurisdictional Groups developed a Coordinated Shoreline Monitoring Plan (CSMP) and began monitoring compliance sites on November 1, 2004 subsequent to Regional Board approval.

The TMDL prescribed numeric limits for total coliform density, fecal coliform/*E. coli* density, and Enterococcus density, are shown in **Table A-2**. Within SMB EWMP Group, a total of 24 shoreline monitoring sites, as shown in **Figure A-7** and detailed in **Table A-11**, are monitored for bacteria. Results from the shoreline monitoring are shared with the Southern California Coastal Water Research Project's (SCCWRP's) Beach Watch program.

Site ID	JG	Туре	LFD	Description	
SMB-2-1	2	Point Zero	Yes	Castlerock (Parker Mesa)storm drain	
SMB-2-2	2	Point Zero	Yes	Santa Ynez storm drain	
SMB-2-3	2	Open Beach	No	Will Rogers State Beach, <sup>1</sup> / <sub>4</sub> mile east of Gladstone's restaurant (DHS101)	
SMB-2-4	2	Point Zero	Yes	Pulga storm drain (S3)	
SMB-2-5	2	Point Zero	Yes	Bay Club Storm drain in front of the Bel Air Bay Club (DHS102)	
SMB-2-6	2	Point Zero	Yes	Temescal Canyon storm drain(DHS103)	
SMB-2-7	2	Point Zero	Yes	Santa Monica Canyon	
SMB-2-8	2	Open Beach	No	Venice Beach, 50 yards south of the pier (DHS108)	
SMB-2-9	2	Open Beach	No	Venice Beach at Topsail Street(DHS109)	
SMB-2-10	2	Point Zero	Yes	Culver storm drain (S11)	
SMB-2-11	2	Point Zero	Yes	North Westchester storm drain	
SMB-2-12	2	Open Beach	No	Dockweiler Beach at World Way (DHS110)	
SMB-2-13	2	Point Zero	Yes	Imperial storm drain (S12)	
SMB-2-14	2	Open Beach	No	Dockweiler Beach opposite the HTP (DHS111)	
SMB-2-15	2	Point Zero	Yes	Dockweiler Beach, at the wav ewash of Grand Avenue storm drain outlet (DHS112)	
SMB-3-1	3	Point Zero	Yes	Montana storm drain (DHS104)	
SMB-3-2	3	Point Zero	Yes	Wilshire storm drain (DHS105)	
SMB-3-3	3	Point Zero	Yes	Santa Monica Pier storm drain(S5)	

Table A-11

### Santa Monica Bay Beaches Bacteria TMDL Monitoring Sites

Site ID	JG	Туре	LFD	Description
SMB-3-4	3	Point Zero	Yes	Pico-Kenter storm drain (S6)
SMB-3-5	3	Point Zero	Yes	Ashland storm drain (S7)
SMB-3-6	3	Point Zero	Yes	Rose storm drain
SMB-3-7	3	Point Zero	Yes	Brooks storm drain (DHS107)
SMB-3-8	3	Point Zero	Yes	Windward storm drain (S8)
SMB-3-9	3	Open Beach	No	Santa Monica Beach at Strand Street (DHS106)

Previous Santa Monica Bay storm drain identification from the SMBBB TMDL monitoring have identified and provided an inventory of existing outfalls. These monitoring sites attribute a significant amount of historical bacteria data. Although, the SMB EWMP Group considers the shoreline monitoring sites provide a representative characterization of the surf zone area to assess the health risk for bathing, swimming and beach notification, the shoreline monitoring sites may not accurately represent the overall impact of the MS4 onto Santa Monica Bay due to the close proximity of the outfalls. Therefore, additional monitoring sites were considered for the CIMP's Santa Monica Bay receiving water monitoring.

# 3.3.3 Summary of TMDL Compliance Points

Within SMB EWMP Group area, TMDLs have only been identified in Santa Monica Bay. For TMDL monitoring compliance, the existing 24 shoreline monitoring sites for the SMBBB TMDL will continue to be sampled, and one new monitoring site will be sampled to comply with the SMB DDT and PCB TMDL, (shown as the triangle), as shown in **Figure A-7**.

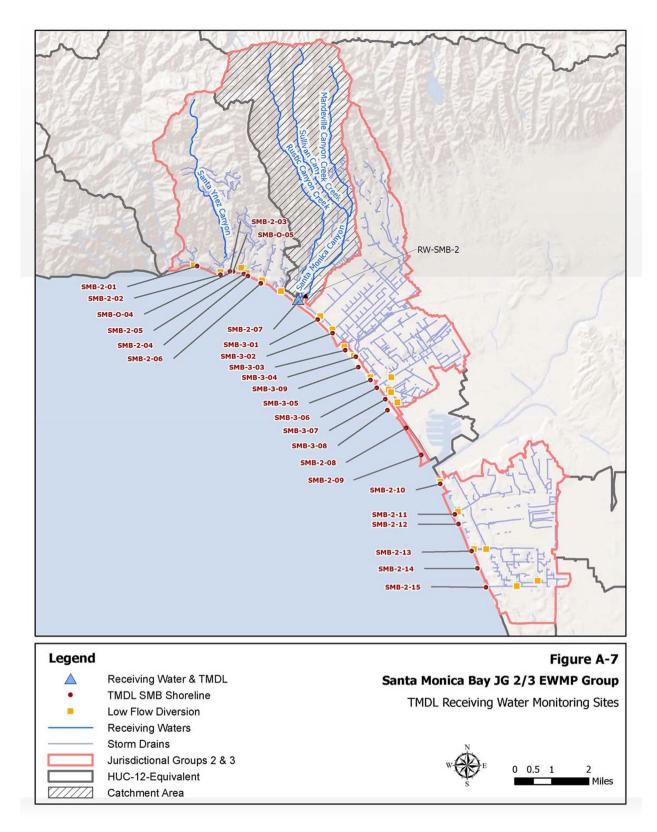


Figure A-7 TMDL Receiving Water Monitoring Sites

# Section 4 Water Quality Priorities and Supporting Information for Monitoring to Address Priorities

In accordance with the Permit Section IV.C.5(a), water quality priorities have been established for the EWMP. The water quality priorities identified provide the basis for prioritizing project implementation; selecting and scheduling BMPs; and focusing monitoring activities developed in the CIMP. The identification of water quality priorities is an important first step in the EWMP process. Water quality priorities are defined for individual constituents within a specific water body, termed as water body-pollutant combinations (WBPCs). Categories of the WBPCs are defined in the Permit are the following and are summarized in the subsections below:

- Category 1 WBPC Subject to TMDL
- Category 2 WBPC on 2010 303(d) List
- Category 3 WBPC with RWL Exceedances

Priorities are assigned to the WBPCs based on the categorization. The water quality priorities will provide the basis for prioritizing implementation activities within the EWMP, and the selection and scheduling of BMPs in the RAA.

# 4.1 Category 1 Water Body-Pollutant Combinations Subject to TMDL

WBPCs under Category 1 (highest priority) are defined in the Permit as "water body-pollutant combinations for which water quality-based effluent limitations and/or receiving water limitations are established in Part VI.E and Attachments L through R [of *the Permit*]." **Table A-12** presents the Category 1 WBPCs for SMB EWMP Group.

# Table A-12

Category	Water Body	Pollutant	Compliance Deadline
	SMB Beaches	Summer dry weather bacteria	7/15/2006 (Final: Single sample summer AEDs)
			7/15/2009 (Interim: 10% single sample ED reduction)
			7/15/2013 (interim: 25% single sample ED reduction)
	SMB Beaches	Wet weather bacteria	7/15/2018 (Interim: 50% single sample ED reduction)
			7/15/2021 (Final: Single sample AED)
			7/15/2021 (Final: Geometric Mean [GM] )
	SMB Beaches	Winter dry weather bacteria	11/1/2009 (Final: Single sample winter AEDs met) <sup>1</sup>
1			3/20/2016 (20% load reduction)
		Debris	3/20/2017 (40% load reduction)
	SMB Offshore/ Nearshore		3/20/2018 (60% load reduction)
	Inearshore		3/20/2019 (80% load reduction)
			3/20/2020 (100% load reduction)
	SMB	DDTs	[Compliance schedule to be developed through the $EWMP$ ] <sup>2</sup>
	SMB	PCBs	[Compliance schedule to be developed through the $EWMP$ ] <sup>2</sup>

### Category 1 Water Body Pollutant Prioritization

<sup>1</sup> Compliance date per 2013 reopened TMDL, which is not yet effective (i.e., USEPA and Office of Administrative Law approval is pending). <sup>2</sup> Although the TMDL lacks a formal compliance schedule for the WQBEL, the TMDL Executive Summary does state, "The

<sup>2</sup> Although the TMDL lacks a formal compliance schedule for the WQBEL, the TMDL Executive Summary does state, "The time frame for attainment of the TMDL targets for the rest of Santa Monica Bay (other than the Palos Verdes shelf) is 11 years for DDT and 22 years for PCBs."

# 4.2 Category 2 Water Body-Pollutant Combinations on 2010 303(d) List

Category 2 (high priority) WBPCs are defined as "pollutants for which data indicate water quality impairment in the receiving water according to the State's Water Quality Control Policy for Developing California's Clean Water Act Section 303(d) List (State Listing Policy) and for which MS4 discharges may be causing or contributing to the impairment." **Table A-13** presents the Category 2 WBPCs for SMB EWMP Group.

### Table A-13

Category	Water Body	Pollutant	Compliance Deadline
2	Santa Monica Canyon Channel	Lead	Not Applicable
2	Santa Monica Canyon Channel	Indicator bacteria	Not Applicable

### Category 2 Water Body Pollutant Prioritization

# 4.3 Category 3 Water Body-Pollutant Combinations with RWL Exceedances

Category 3 (Medium Priority) designations are to be applied to WBPCs that are not 303(d)-listed, but which exceed applicable receiving water limitations contained in the Permit, and for which MS4 discharges may be causing or contributing to the exceedance.

As part of the SWAMP, locations were each sampled twice for a suite of parameters (one in March of 2003 and one in February of 2004). The weather conditions (wet or dry) at the time of sampling were not available from the data source. An analysis of available freshwater monitoring data for the sites showed one exceedance of the receiving water limits for pH (value not between 6.5 and 8.5 pH units) at each of four monitoring locations between 2003 and 2004. Additionally, based on available data, exceedances of the *E. coli* freshwater daily maximum objective of 235 MPN/100mL at sites with an existing or intermittent REC-1 beneficial use were measured at three monitoring locations between 2003 and 2004 (SWAMP). Exceedances of the fecal coliform freshwater objective of 400 MPN/100mL applicable to sites with an existing or intermittent REC-2 beneficial use were measured at four monitoring locations between 2003 and 2004 (SWAMP).

Given both the limited amount of data available and the fact that such data was collected more than ten years ago, pH, E. coli, and fecal coliform will not be considered Category 3 pollutants. Furthermore, two samples are considered insufficient to characterize the water bodies. Future monitoring under the CIMP will help determine if the SMB EWMP will need to be revised to include these, or other parameters for specific water bodies. Category 3 WBPCs will be identified based on data collected as part of the approved CIMP.

# 4.4 Water Qualities Priorities Summary

The water quality prioritization process of the Permit determines the water body-pollutant combinations (WBPCs) that will be addressed within the EWMP area. The permit defines several categories of WBPCs to be used:

- **Category 1** are those subject to an established TMDL;
- **Category 2** are those on the State Water Resources Control Board (SWRCB) 2010 CWA Section 303(d) list or those constituents that have sufficient exceedances to be listed; and
- **Category 3** for those with observed exceedances but too infrequent to be listed. The outcome of the preliminary water quality prioritization is summarized in **Table A-14**. WBPCs are listed in order of compliance deadline with interim and final deadlines included.

#### Table A-14

# Water Body-Pollutant Prioritization

Category	Water Body	Pollutant	Compliance Deadline	
		Summer dry weather	7/15/2006 (Final: Single sample summer	
	SMB Beaches	bacteria	AEDs met)	
			7/15/2009 (Interim: 10% single sample ED	
			reduction)	
			7/15/2013 (interim: 25% single sample ED	
	SMB Beaches	Wet weather bacteria	reduction)	
	SIVID Beaches	wet weather bacteria	7/15/2018 (Interim: 50% single sample ED	
			reduction)	
			7/15/2021 (Final: Single sample AED)	
			7/15/2021 (Final: Geometric Mean [GM])	
	SMB Beaches	Winter dry weather	11/1/2009 (Final: Single sample winter	
1	SIVID Beaches	bacteria	AEDs) <sup>1</sup>	
			3/20/2016 (20% load reduction)	
			3/20/2017 (40% load reduction)	
	SMB Offshore/ Nearshore	Debris	3/20/2018 (60% load reduction)	
			3/20/2019 (80% load reduction)	
			3/20/2020 (100% load reduction)	
	SMB	DDTs	[Compliance schedule to be developed	
		2210	through the EWMP] <sup>2</sup>	
	SMB	PCBs	[Compliance schedule to be developed	
	SIVID	1 CD3	through the $\text{EWMP}$ <sup>2</sup>	
	Santa Monica Canyon	Lead	NA	
2	Channel	Leau	INA	
2	Santa Monica Canyon	Indicator bacteria	NA	
	Channel		11/1	
3	None	None	None	

<sup>1</sup> Compliance date per 2013 reopened TMDL, which is not yet effective (i.e., USEPA and Office of Administrative Law approval

is pending). <sup>2</sup> Although the TMDL lacks a formal compliance schedule for the WQBEL, the TMDL Executive Summary does state, "The time frame for attainment of the TMDL targets for the rest of Santa Monica Bay (other than the Palos Verdes shelf) is 11 years for DDT and 22 years for PCBs."

# Attachment B

# **Monitoring Location Fact Sheets**

# Section 1 Receiving Water Sites

As presented in **Section 3** of the CIMP, receiving water monitoring will be conducted in Santa Monica Bay and Santa Monica Canyon Channel.

# **1.1** Overview of Sites and Justification

Three receiving water monitoring sites are chosen, two within Santa Monica Bay and one within Santa Monica Canyon Channel. Previously monitored SMBBB TMDL monitoring sites will remain and utilized in accordance to the approved Coordinated Shoreline Monitoring Plan (CSMP).

### 1.1.1 Santa Monica Bay (RW-SMB-1)

RW-SMB-1 will be located at the point of initial mixing and will be dependent on the intensity of the qualifying storm event. Samples will be collected within plumes generated during the storm event, in the vicinity and across from Santa Monica Canyon Channel (SMBBB TMDL monitoring location SMB 2-7). A boat will be used to gather the sample from the plume. Receiving water monitoring site RW-SMB-1 will represent the drainage characteristics of JG2. **Section 1.2** below shows comparative analysis of the land use composition of JG2 and RW-SMB-1 drainage area.

### 1.1.2 Santa Monica Canyon Channel (RW-SMB-2)

Monitoring site RW-SMB-2 will be used to monitor the receiving water monitoring for Santa Monica Canyon Channel and SMB Toxics TMDL monitoring. Monitoring site RW-SMB-2 will be located immediately upstream of the low flow diversion (LFD) weir in Santa Monica Canyon Channel. RW-SMB-2 will monitor runoff from Santa Monica Canyon Channel, Rustic Canyon, Mandeville Canyon, and Sullivan Canyon Creeks. The catchment area of RW-SMB-2 will encompass 100% of the Santa Monica Canyon (180701040402) HUC-12 area of SMB EWMP Group.

Catchment areas for RW-SMB-1 and RW-SMB-2 are identical, but the representative samples will differ as RW-SMB-1 will characterize the mixing of Santa Monica Canyon Channel with Santa Monica Bay, and RW-SMB-2 will characterize the runoff from Santa Monica Canyon Channel and all upstream creeks.

#### 1.1.3 Santa Monica Bay (RW-SMB-3)

RW-SMB-3 will be located at the point of initial mixing and will be dependent on the intensity of a qualifying storm event. Samples will be collected within plumes generated during a qualifying storm event, in the vicinity and across from Pico Kenter storm drain (SMBBB TMDL monitoring location SMB 3-4). This sampling site is critical to the SMB EWMP Group for demonstrating compliance and water quality data collected by the SMB EWMP Group would be valuable for assessing the impact of JG3's discharges on the receiving water. **Section 1.4** shows comparative analysis of the land use composition of JG3 and the RW-SMB-3 drainage area.

# 1.2 Summary Sheet for RW-SMB-1

Site ID: RW-SMB-1	Monitoring Type: Receiving Water							
Latitude: 34.025198	Watershed: Santa Monica Bay							
Longitude: -118.523621	Represented Area	Represented Area: Jurisdictional Group 2						
	Catchme	ent Area	JO	62				
Land Use	Acres	% of Total	Acres	% of Total				
Agricultural	12.82	0.13%	16.37	0.07%				
Commercial	35.01	0.35%	529.39	2.12%				
Industrial	60.92	0.61%	1,304.25	5.23%				
Education	35.14	0.35%	294.1	1.18%				
Single Family Residential	2,089.65	20.81%	5,160.31	20.71%				
Multi-Family Residential	46.1	0.46%	597.68	2.40%				
Open Space	7,764.02	77.30%	14,945.23	59.97%				
Transportation	0%	0%	2,074.91	8.33%				
Total	10,043.66	100%	24,922.24	100%				
Jurisdictions								
City of Los Angeles	9,778	97.35%	22,087	88.62%				
City of Santa Monica	266	2.65%	266	1.07%				
City of El Segundo	0%	0%	2,180	8.75%				
County of Los Angeles	0%	0%	389	1.56%				
Site Description: RW-SMB-	1 is a receiving wate	er monitoring locatio	n in Santa Monica	Bay located at the				

**Site Description:** RW-SMB-1 is a receiving water monitoring location in Santa Monica Bay located at the point of initial mixing, and across from Santa Monica Canyon Channel (SMBBB TMDL monitoring location SMB 2-7). This sampling location is selected to characterize the impact of the MS4 to Santa Monica Bay within Jurisdiction 2.

# Site Location: Please see Figure 7



# 1.3 Summary Sheet for RW-SMB-2

Site ID: RW-SMB-2	Monitoring Type:	Monitoring Type: Receiving Water and TMDL					
Latitude: 34.028797	Watershed: Santa	Watershed: Santa Monica Bay					
Longitude: -118.517841	Represented Area	Represented Area: Santa Monica Canyon Channel					
	Catchme	nt Area	HU	IC			
Land Use	Acres	% of Total	Acres	% of Total			
Agricultural	12.82	0.13%	12.82	0.13%			
Commercial	35.01	0.35%	35.01	0.35%			
Industrial	60.92	0.61%	60.92	0.61%			
Education	35.14	0.35%	35.14	0.35%			
Single Family Residential	2089.65	20.81%	2089.65	20.81%			
Multi-Family Residential	46.1	0.46%	46.1	0.46%			
Open Space	7764.02	77.30%	7764.02	77.30%			
Transportation	0	0%	0	0%			
Total	10043.66	100%	10043.66	100%			
Jurisdictions							
City of Los Angeles	9778	97.35%	9778	97.35%			
City of Santa Monica	266	2.65%	266	2.65%			
City of El Segundo	0	0%	0	0%			
County of Los Angeles	0	0%	0	0%			
Site Description: RW-SMB-2 is Santa Monica Canyon Channel i							

Santa Monica Canyon Channel immediately upstream of the low flow diversion (LFD) weir. Access to the site of the LFD weir is located in a parking lot next to 148 W. Channel Road, Santa Monica, CA 90402. Site Location: Please See Figure 7

Site View:



# 1.4 Summary Sheet for RW-SMB-3

Site ID: RW-SMB-3         Monitoring Type: Receiving Water					
Latitude: 34.003262	Watershed: San				
Longitude: -118.496438	-	ea: Jurisdictional G	roup 3		
	Catchme	ent Area	JG3		
Land Use	Acres	% of Total	Acres	% of Total	
Agricultural	0	0%	0	0%	
Commercial	602.74	13.02%	1123.12	12.40%	
Industrial	219.94	4.75%	262.64	2.90%	
Education	137.38	2.97%	274.21	3.03%	
Single Family Residential	1,786.79	38.60%	3,487.38	38.50%	
Multi-Family Residential	696.42	15.04%	2,172.03	23.98%	
Open Space	1,106.71	23.91%	1,490.23	16.45%	
Transportation	79.02	1.71%	247.38	2.73%	
Total	4,629.00	100%	9,056.99	100%	
Jurisdictions	·				
City of Los Angeles	2,760	59.62%	4,242	47.33%	
City of Santa Monica	1,869	40.38%	4,721	52.67%	
City of El Segundo	0	0%	0	09	
County of Los Angeles	0	0%	0	00	
Site Description: RW-SMB-3 is point of mixing, and across fro selected to characterize the impace Site Location: Please See Figure Site View:	m the shoreline mo t of the MS4 to Santa	onitoring site SMB	3-4. This sampl		
point of mixing, and across fro selected to characterize the impace Site Location: Please See Figure	m the shoreline mo t of the MS4 to Santa	onitoring site SMB	3-4. This sampl		

# Section 2 Stormwater Outfall Site

Compliance with municipal action limits (MALs), WQBELs derived from TMDL WLAs, as well as the potential to cause or contribute exceedances of RWLs derived from TMDL WLAs or receiving water quality objectives are assessed through stormwater outfall monitoring. The majority of SMB EWMP Group storm drains generally drain towards Santa Monica Bay through multiple jurisdictions. For each monitoring site a land use analysis for was conducted for each HUC-12, drainage area and SMB EWMP Group area.

# 2.1 Overview of Sites

Four stormwater outfall monitoring sites, as shown in **Figure 11**, were selected. The four monitoring sites comprise about 46% of the drainages area of the SMB EWMP Group. The selected sites are representative of a combination of the HUC-12s, jurisdictions, and/or land uses within each drainage area. A synopsis of each potential outfall drainage area, along with an analysis of its land use/zoning characteristics is summarized below.

## 2.1.1 OF-SMB-1

Stormwater outfall monitoring site OF-SMB-1 was selected to represent the Santa Monica Beach – Frontal Santa Monica Bay (180701040403) HUC-12 JG2 area. Catchment area from OF-SMB-1 will encompass approximately 4.55% of the HUC-12 area, which primarily drains the County of Los Angeles and the City of Los Angeles. **Section 2.2** below shows an analysis comparing the land use composition within OF-SMB-1 drainage area, HUC-12 and SMB EWMP Group area. OF-SMB-1 is representative of the drainage area of the County of Los Angeles, as well as open space and single family residential land uses. Based on this comparison, OF-SMB-1 would be an ideal outfall monitoring site to assess water quality for open space and single family residential land uses, City of Los Angeles and the County of Los Angeles.

### 2.1.2 OF-SMB-2

Stormwater outfall monitoring site OF-SMB-2 will be an outfall monitoring site for Santa Monica Canyon Channel. OF-SMB-2 will receive stormwater runoff from Sullivan Canyon storm drain and Mandeville Canyon storm drain as OF-SMB-2 will be located in Santa Monica Canyon Channel at the confluence of Sullivan Canyon and Mandeville Canyon storm drains. Drainage from OF-SMB-2 will encompass approximately 41.42% of the HUC-12 area, which primarily drains the City of Los Angeles. An analysis comparing the land use composition within OF-SMB-2 drainage area, HUC-12 and SMB EWMP Group area is not representative of the SMB EWMP Group areas land use. However the drainage from OF-SMB-2 is representative of open space and single family residential land use, and will characterize the upstream portion of Santa Monica Canyon Channel. Based on this comparison, OF-SMB-2 would be an ideal outfall monitoring site to represent the water quality assessment for open space and single family residential land use, and Santa Monica Canyon Channel.

### 2.1.3 OF-SMB-3

OF-SMB-3 was selected to represent the Santa Monica Beach – Frontal Santa Monica Bay (180701040403) HUC-12 JG3 area and the City of Santa Monica. Drainage from OF-SMB-3 will encompass approximately 51.11% of the HUC-12 area, which primarily drains the City of Santa Monica

and the City of Los Angeles. As shown in **Section 2.4** below, an analysis comparing the land use composition within OF-SMB-3 drainage area, HUC-12 and SMB EWMP Group area, indicates OF-SMB-3 is representative of the HUC-12 and the SMB EWMP Group area. OF-SMB-3 is also representative of commercial, mix residential, and open space land use. Based on this comparison, OF-SMB-3 would be an ideal outfall monitoring site.

# 2.1.4 OF-SMB-4

The stormwater outfall monitoring site OF-SMB-4 has been selected to represent the Manhattan Beach – Frontal Santa Monica Bay (180701040500) HUC-12 area and the City of El Segundo. Drainage from OF-SMB-4 will encompass approximately 6.58% of the HUC-12 area, which primarily drains the City of El Segundo and a small portion of the City of Los Angeles. As shown in **Section 2.5** below, an analysis comparing the land use composition within OF-SMB-4 drainage area, HUC-12 and SMB EWMP Group area, is representative of commercial, industrial, mix residential land use and the drainage of the City of El Segundo. Based on this comparison, OF-SMB-4 would be an ideal outfall monitoring site to represent the water quality assessment for commercial, industrial, mix residential land use area and the City of El Segundo.

# 2.2 Summary Sheet for OF-SMB-1

Site ID: OF-SMB-1	Monitoring Type: Stor				
Latitude: 34.041362	Watershed: Santa Monica Bay				
Longitude: -118.567045	Represented Area: Co	Represented Area: County of Los Angeles and City of Los Angeles			
Thomas Guide Grid: pg 630 F6	Drainage System: Cas	stlerock (Parker Mesa)	)		
Outfall Shape: 60" X 96" HUC-1	2: Santa Monica Beach -	- Frontal Santa Monica	a Bay (180701040403)		
Outfall Type:	Nearest Street Addres				
Reinforced Concrete Box	17946 Pacific Coast Hig	ghway, Malibu, CA 90	265		
	Catchment Area	HUC	SWB EWMP Area		
Land Use	% of Total	% of Total	% of Total		
Agricultural	0%	0.04%	0.05%		
Commercial	4.67%	1.49%	4.86%		
Industrial	0%	0%	4.61%		
Education	0%	0.82%	1.67%		
Single Family Residential	42.63%	20.36%	25.45%		
Multi-Family Residential	1.82%	2.37%	8.15%		
Open Space	50.88%	74.67%	48.37%		
Transportation	0%	0.25%	6.83%		
Total	100%	100%	100%		
Jurisdictions	· ·				
City of Los Angeles	42.25%	95.26%	77.70%		
City of Santa Monica	0%	0%	14.72%		
City of El Segundo	0%	0%	6.43%		
County of Los Angeles	57.75%	4.74%	1.15%		
Site Description: Construction nea					
is located near the intersection of C					
Castlerock storm drain as well as			currently has a LFD up		
gradient of the discharge point, which <b>Site Location:</b> Please See <b>Figure</b>		IOWS.			
Site Location: Please See Figure	12				

02/25/2014 07:33

# 2.3 Summary Sheet for OF-SMB-2

Site ID: OF-SMB-2 Monitoring Type: Stormwater Outfall						
Latitude: 34.060797	Watershed: Sa					
Longitude: -118.495236		rea: City of Los Angeles				
Thomas Guide Grid: pg 631 E3		m: Sullivan and Mandeville	Canvon Creek			
Outfall Shape: N/A	HUC-12: Santa Monica Canyon (180701040402)					
Outfall Type:	Nearest Street Address:					
Reinforced Concrete Channel	13125 W. Sunset Blvd., Los Angeles, CA 90049					
	HUC	Catchment Area	SMB EWMP Area			
Land Use	% of Total	% of Total	% of Total			
Agricultural	0.13%	0.31%	0.05%			
Commercial	0.35%	0.07%	4.86%			
Industrial	0.61%	1.46%	4.61%			
Education	0.35%		1.67%			
Single Family Residential	20.81%	15.40%	25.45%			
Multi-Family Residential	0.46%	0.21%	8.15%			
Open Space	77.30%	82.55%	48.37%			
Transportation	100.000/	400.000/	6.83%			
Total Jurisdictions	100.00%	100.00%	100.00%			
	07.050/	400.000/	77 700/			
City of Los Angeles City of Santa Monica	97.35% 2.65%	100.00%	77.70%			
City of El Segundo	2.05%		14.72%			
City of El Segundo			<u> </u>			
Site Description: Sample location OF-SMB-2 is near the confluence of Sullivan Canyon Creek and Mandeville Canyon Creek. Site Location: Please See Figure 13 Site View:						
		02/25/2014	09:11			

# 2.4 Summary Sheet for OF-SMB-3

Site ID: OF-SMB-3		Monitoring Type: Stormwater Outfall			
Latitude: 34.006370		Watershed: Santa Monica Bay			
Longitude: -118.491840		Represented Area: City of Santa Monica and City of Los Angeles			
Thomas Guide Grid: pg 67		Drainage System: Pic			
Outfall Shape: 48"X552"	HUC-12:	Santa Monica Beach -	Frontal Santa Monica	Bay (180701040403)	
Outfall Type:		Nearest Street Addre			
Reinforced Concrete Chann	el	1 Pico Boulevard, San			
		Catchment Area	HUC	SWB EWMP Area	
Land Use		% of Total	% of Total	% of Total	
Agricultural		0%	0%	0.05%	
Commercial		13.02%	12.40%	4.86%	
Industrial		4.75%	2.90%	4.61%	
Education		2.97%	3.03%	1.67%	
Single Family Residential		38.60%	38.50%	25.45%	
Multi-Family Residential		15.04%	23.98%	8.15%	
Open Space		23.91%	16.45%	48.37%	
Transportation		1.71%	2.73%	6.83%	
Total		100%	100%	100%	
Jurisdictions					
City of Los Angeles		59.62%	47.33%	77.70%	
City of Santa Monica		40.38%	52.67%	14.72%	
City of El Segundo		0%	0%	6.43%	
County of Los Angeles		0%	0%	1.15%	
Site Description: Outfall r The Pico-Kenter storm drain during dry-weather is dive outfall is located south of Sa Site Location: Please See	n is gener rted to th anta Monio	ally blocked by sand fro ne Santa Monica Urbar ca Pier and can be found	m June to the first larg	ge storm event. All flow facility (SMURTF). The	
Site View:					

Page B-10

# 2.5 Summary Sheet for OF-SMB-4

Site ID: OF-SMB-4		Monitoring Type: Stormwater Outfall				
Latitude: 33.917430		Watershed: Santa Monica Bay				
Longitude: -118.428580		Represented Area: Ci	ty of El Segundo and Cit	ty of Los Angeles		
Thomas Guide Grid: pg 732	D2	Drainage System: Gra	and Avenue			
Outfall Shape: 34"	HU	C-12: Manhattan Beach	<ul> <li>Frontal Santa Monica</li> </ul>	Bay (180701040500)		
Outfall Type: Reinforced Concrete Pipe		Nearest Street Addres 12700 Vista Del Mar B	<b>ss:</b> oulevard, Playa del Rey,	CA 90293		
		Catchment Area	HUC	SWB EWMP Area		
Land Use		% of Total	% of Total	% of Total		
Agricultural		0%	0%	0.05%		
Commercial		27.71%	5.58%	4.86%		
Industrial		27.57%	18.64%	4.61%		
Education		1.50%	2.87%	1.67%		
Single Family Residential		21.93%	20.97%	25.45%		
Multi-Family Residential		11.77%	5.35%	8.15%		
Open Space		6.81%	15.79%	48.37%		
Transportation		2.71%	30.80%	6.83%		
Total		100%	100%	100%		
Jurisdictions	Jurisdictions					
City of Los Angeles		2.51%	67.36%	77.70%		
City of Santa Monica		0%	0%	14.72%		
City of El Segundo		97.49%	32.64%	6.43%		
County of Los Angeles		0%	0%	1.15%		
Site Description: OF-SMB-4	is lo	cated in the parking lot o	of Dockweiler State Bea	ch near the intersection		

**Site Description:** OF-SMB-4 is located in the parking lot of Dockweiler State Beach near the intersection of W Grand Avenue and Vista Del Mar Boulevard. OF-SMB-4 drains from the Grand Avenue storm drain, which is a 34" diameter reinforce concrete pipe. At the time of field reconnaissance, no dry-weather flow was observed. OF-SMB-4 has a LFD up gradient, which diverts dry-weather flow.

# Site Location: Please See Figure 14

Site View:



# Section 3 Non-Stormwater Outfall Sites and Justification

At this time, non-stormwater outfall monitoring sites have not been identified. To determine the number of outfalls that are required to be monitored for the non-stormwater outfall monitoring, SMB EWMP Group has developed an outfall screening and monitoring program. Further details of the non-stormwater outfall monitoring and screening program are discussed in **Section 6** of the CIMP. Within 90 days of the approval of this CIMP the SMB EWMP Group will initiate the steps identified to identify, inventory, prioritize, and monitor the non-stormwater discharges.

# Attachment C

# Analytical and Monitoring Procedures

# Section 1 Analytical Procedures

The sections below discuss the analytical procedures for data generated in the field and in the laboratory.

# 1.1 Field Parameters

Field meters will be calibrated in accordance to **Section 2.1.3**. Portable field meters will measure field parameters within specifications outlined in **Table C-1**.

Parameter	Method	Range	Project RL			
Current velocity	Electromagnetic	-0.5 to +20 ft/s	0.05 ft/s			
pH	Electrometric	0 – 14 pH units	NA			
Temperature	High stability thermistor	-5 – 50 oC	NA			
Dissolved oxygen	Membrane or Optical	0-50  mg/L	0.5 mg/L			
Turbidity	Nephelometric	0 – 3000 NTU	0.2 NTU			
Conductivity	Graphite electrodes	0-10  mmhos/cm	2.5 umhos/cm			
Salinity	Conductivity and Temperature	0 – 70 ppt	0.01 ppt			

Analytical Methods and F	Project Reporting	Limits for Field Parameters
--------------------------	-------------------	-----------------------------

Table C-1

RL – Reporting Limit NA – Not applicable

# **1.2** Analytical Methods and Method Detection and Reporting Limits

Method detection limits (MDL) and reporting limits (RLs) must be distinguished for proper understanding and data use. The MDL is the minimum analyte concentration that can be measured and reported with a 99% confidence that the concentration is greater than zero. The RL represents the concentration of an analyte that can be routinely measured in the sampled matrix within stated limits and with confidence in both identification and quantitation.

Under this monitoring program, RLs must be verifiable by having the lowest non-zero calibration standard or calibration check sample concentration at or less than the RL. RLs have been established in this CIMP based on the verifiable levels and general measurement capabilities demonstrated for each method. These RLs should be considered as maximum allowable RLs to be used for laboratory data reporting. Note that samples diluted for analysis may have sample-specific RLs that exceed these RLs. This will be unavoidable on occasion. However, if samples are consistently diluted to overcome matrix interferences, the analytical laboratory will be required to notify the SMB EWMP Group regarding how the sample preparation or test procedure in question will be modified to reduce matrix interferences so that project RLs can be met consistently.

Analytical methods and RLs required for samples analyzed in the laboratory is summarized in

**Table** C-2. For organic constituents, environmentally relevant detection limits will be used to the extent practicable. The RLs listed in

**Table** C-2 are consistent with the requirements of the available minimum levels provided in the MRP, except for total dissolved solids, which was set equal to the minimum level identified in the California State Water Resources Control Board's Surface Water Ambient Monitoring Program's (SWAMP) Quality Assurance Project Plan. Alternative methods with RLs that are at or below those presented in

Table C-2 are considered equivalent and can be used in place of the methods presented in

Table C-2.

Prior to the analysis of any environmental samples, the laboratory must have demonstrated the ability to meet the minimum performance requirements for each analytical method presented in

**Table** C-2. The initial demonstration of capability includes the ability to meet the project RLs, the ability to generate acceptable precision and accuracy, and other analytical and quality control parameters documented in this CIMP. Data quality objectives for precision and accuracy are summarized in

# Table C-2

# EPA Approved Analytical Methods and Project Reporting Limits (RL) for Laboratory Analysis of Water Samples

Parameter/Constituent	Method <sup>(1)</sup>	Units	Project RL	MRP Table E-2 ML
Toxicity				1
Ceriodaphnia dubia	EPA-821-R-02-013 (1002.0) and EPA- 821-R-02-012 (2002.0)	TUc	2	NA
Strongylocentrotus purpuratus	EPA-600-R-95-136 (1002.0)	TUc	2	NA
Haliotis rufescens	EPA-600-R-95-136	TUc	2	NA
Bacteria				
Total coliform (marine waters)	SM 9222 or 9223	CFU/100ml or MPN/100mL	1-67	10,000
Enterococcus (marine waters)	SM 9230	CFU/100ml or MPN/100mL	1-10	104
Fecal coliform/ <i>E. coli</i> (marine and fresh waters)	SM 9222 or 9223	CFU/100ml or MPN/100mL	1-67	400
E. coli (fresh)	SM 9221 or 9223	MPN/100mL	2-67	235
<b>Conventional Pollutants</b>				
Oil and Grease	EPA 1664A	mg/L	5	5
Cyanide	SM 4500-CN E	mg/L	0.005	0.005
General				
Specific Conductance	EPA 120.1	µs/cm	1	1
Total Hardness	SM 2340C	mg/L	2	2
Dissolved Organic Carbon	SM 5310B	mg/L	0.6	NA
Total Organic Carbon	SM 5310B	mg/L	1	1
Total Petroleum Hydrocarbon	EPA 1664	mg/L	5	5
Biochemical Oxygen Demand	SMOL-5210	mg/L	5	2
Chemical Oxygen Demand	SM 5220D	mg/L	20	20-900
MBAS	SM 5540C	mg/L	0.5	0.5
Chloride	EPA 300.0	mg/L	1	2
Fluoride	EPA 300.0	mg/L	0.1	0.1
Perchlorate	EPA 314.0	μg/L	4	4
Dissolved Phosphorus	SM 4500-P E	mg/L	0.05	0.05
Total Phosphorus	SM 4500-P E	mg/L	0.05	0.05
Orthophosphate-P	EPA 300.0	mg/L	0.2	NA
Ammonia (as N)	SM 4500-NH3 C	mg/L	0.1	0.1
Nitrate + Nitrite (as N)	EPA 300.0	mg/L	0.1	0.1

Parameter/Constituent	Method <sup>(1)</sup>	Units	<b>Project RL</b>	MRP Table E-2 ML
Nitrate (as N)	EPA 300.0	mg/L	0.1	0.1
Nitrite (as N)	EPA 300.0	mg/L	0.1	0.1
Total Kjehdahl Nitrogen (TKN)	SM 4500-NH3 C	mg/L	0.1	0.1
Total Alkalinity	SM 2320B	mg/L	2	2
Solids			,	
Suspended Sediment Concentration (SSC)	ASTMD 3977-97	mg/L	3	NA
Total Suspended Solids (TSS)	SM 2540D	mg/L	2	2
Total Dissolved Solids (TDS)	SM 2540C	mg/L	10	2
Volatile Suspended Solids	EPA 1684	mg/L	1	2
Metals in Freshwater (dissolved a	nd total)		,	
Aluminum	EPA 200.8	μg/L	100	100
Antimony	EPA 200.8	μg/L	0.5	0.5
Arsenic	EPA 200.8	μg/L	1	1
Beryllium	EPA 200.8	μg/L	0.5	0.5
Cadmium	EPA 200.8	μg/L	0.25	0.25
Chromium (total)	EPA 200.8	μg/L	0.5	0.5
Chromium (Hexavalent)	EPA 200.8	μg/L	5	5
Copper	EPA 200.8	μg/L	0.5	0.5
Iron	EPA 200.8	μg/L	100	100
Lead	EPA 200.8	μg/L	0.5	0.5
Mercury	EPA 1631	μg/L	0.5	0.5
Nickel	EPA 200.8	μg/L	1	1
Selenium	EPA 200.8	μg/L	1	1
Silver	EPA 200.8	μg/L	0.25	0.25
Thallium	EPA 200.8	μg/L	1	1
Zinc	EPA 200.8	μg/L	1	1
Metals in Seawater (dissolved and	total)		,	
Copper	EPA 1640	μg/L	1	NA
Lead	EPA 1640	μg/L	1	NA
Mercury	EPA 1631	μg/L	1	NA
Nickel	EPA 1640	μg/L	1	NA
Selenium	EPA 1640	μg/L	1	NA
Silver	EPA 1640	μg/L	1	NA
Zinc	EPA 1640	μg/L	1	NA
Organochlorine Pesticides				
Aldrin	EPA 608	ng/L	5	5
alpha-BHC	EPA 608	ng/L	10	10
beta-BHC	EPA 608	ng/L	5	5
delta-BHC	EPA 608	ng/L	5	5

Parameter/Constituent	Method <sup>(1)</sup>	Units	Project RL	MRP Table E-2 ML
gamma-BHC (Lindane)	EPA 608	ng/L	20	20
Chlordane-alpha	EPA 608	ng/L	100	100
Chlordane-gamma	EPA 608	ng/L	100	100
Oxychlordane	EPA 608	ng/L	200	NA
Cis-nonachlor	EPA 608	ng/L	200	NA
Trans-nonachlor	EPA 608	ng/L	200	NA
2,4'-DDD	EPA 608	ng/L	2	NA
2,4'-DDE	EPA 608	ng/L	2	NA
2,4'-DDT	EPA 608	ng/L	2	NA
4,4'-DDD	EPA 608	ng/L	50	50
4,4'-DDE	EPA 608	ng/L	50	50
4,4'-DDT	EPA 608	ng/L	10	10
Dieldrin	EPA 608	ng/L	10	10
Endosulfan I	EPA 608	ng/L	20	20
Endosulfan II	EPA 608	ng/L	10	10
Endosulfan Sulfate	EPA 608	ng/L	50	50
Endrin	EPA 608	ng/L	10	10
Endrin Aldehyde	EPA 608	ng/L	10	10
Heptachlor	EPA 608	ng/L	10	10
Heptachlor Epoxide	EPA 608	ng/L	10	10
Toxaphene	EPA 608	ng/L	500	500
PCBs				
Congeners <sup>(2)</sup>	EPA 625/ 8270C	ng/L	2	NA
Aroclors (1016, 1221, 1232, 1242, 1248, 1254, 1260)	EPA 608	ng/L	500	500
Organophosphorus Pesticides				
Chlorpyrifos	EPA 614	ng/L	50	50
Diazinon	EPA 614	ng/L	10	10
Malathion	EPA 614	ng/L	1000	1000
Triazine				
Atrazine	EPA 530	μg/L	2	2
Cyanazine	EPA 530	μg/L	2	2
Prometryn	EPA 530	μg/L	2	2
Simazine	EPA 530	μg/L	2	2
Herbicides				
2,4-D	EPA 8151A	μg/L	10	10
Glyphosate	EPA 547	μg/L	5	5
2,4,5-TP-SILVEX	EPA 8151A	μg/L	0.5	0.5
Semivolatile Organic Compounds (			1	1
1,2-Diphenylhydrazine	EPA 625	μg/L	1	1

Parameter/Constituent	Method <sup>(1)</sup>	Units	Project RL	MRP Table E-2 ML
2,4,6-Trichlorophenol	EPA 625	μg/L	10	10
2,4-Dichlorophenol	EPA 625	μg/L	1	1
2,4-Dimethylphenol	EPA 625	μg/L	2	2
2,4-Dinitrophenol	EPA 625	μg/L	5	5
2,4-Dinitrotoluene	EPA 625	μg/L	5	5
2,6-Dinitrotoluene	EPA 625	μg/L	5	5
2-Chloronaphthalene	EPA 625	μg/L	10	10
2-Chlorophenol	EPA 625	μg/L	2	2
2-Methyl-4,6-dinitrophenol	EPA 625	μg/L	5	5
2-Nitrophenol	EPA 625	μg/L	10	10
3,3'-Dichlorobenzidine	EPA 625	μg/L	5	5
4-Bromophenyl phenyl ether	EPA 625	μg/L	5	5
4-Chloro-3-methylphenol	EPA 625	μg/L	1	1
4-Chlorophenyl phenyl ether	EPA 625	μg/L	5	5
4-Nitrophenol	EPA 625	μg/L	5	5
Acenaphthene	EPA 625	μg/L	1	1
Acenaphthylene	EPA 625	μg/L	2	2
Anthracene	EPA 625	μg/L	2	2
Benzidine	EPA 625	μg/L	5	5
Benzo(a)anthracene	EPA 625	μg/L	5	5
Benzo(a)pyrene	EPA 625	μg/L	2	2
Benzo(b)fluoranthene	EPA 625	μg/L	10	10
Benzo(g,h,i)perylene	EPA 625	μg/L	5	5
Benzo(k)fluoranthene	EPA 625	μg/L	2	2
Benzyl butyl phthalate	EPA 625	μg/L	10	10
bis(2-Chloroethoxy) methane	EPA 625	μg/L	5	5
bis(2-Chloroisopropyl) ether	EPA 625	μg/L	2	2
bis(2-Chloroethyl) ether	EPA 625	μg/L	1	1
bis(2-Ethylhexyl) phthalate	EPA 625	μg/L	5	5
Chrysene	EPA 625	μg/L	5	5
Dibenzo(a,h)anthracene	EPA 625	μg/L	0.1	0.1
Diethyl phthalate	EPA 625	μg/L	2	2
Dimethyl phthalate	EPA 625	μg/L	2	2
Di-n-butylphthalate	EPA 625e	μg/L	10	10
Di-n-octylphthalate	EPA 625	μg/L	10	10
Fluoranthene	EPA 625	μg/L	0.05	0.05
Fluorene	EPA 625	μg/L	0.1	0.1
Hexachlorobenzene	EPA 625	μg/L	1	1
Hexachlorobutadiene	EPA 625	μg/L	1	1

Parameter/Constituent	Method <sup>(1)</sup>	Units	Project RL	MRP Table E-2 ML
Hexachloro-cyclo pentadiene	EPA 625	μg/L	5	5
Hexachloroethane	EPA 625	μg/L	1	1
Indeno(1,2,3-cd)pyrene	EPA 625	μg/L	0.05	0.05
Isophorone	EPA 625	μg/L	1	1
Naphthalene	EPA 625	μg/L	0.2	0.2
Nitrobenzene	EPA 625	μg/L	1	1
N-Nitroso-dimethyl amine	EPA 625	μg/L	5	5
N-Nitrosodiphenylamine	EPA 625	μg/L	1	1
N-Nitroso-di-n-propyl amine	EPA 625	μg/L	5	5
Pentachlorophenol	EPA 625	μg/L	2	2
Phenanthrene	EPA 625	μg/L	0.05	0.05
Total Phenols	EPA 625	mg/L	0.2	0.1
Phenol	EPA 625	μg/L	1	1
Pyrene	EPA 625	μg/L	0.05	0.05
Volatile Organic Compounds			<u>.</u>	
1,2,4-Trichlorobenzene	EPA 625	μg/L	1	1
1,2-Dichlorobenzene	EPA 625	μg/L	1	1
1,3-Dichlorobenzene	EPA 625	μg/L	1	1
1,4-Dichlorobenzene	EPA 625	μg/L	1	1
2-Chloroethyl vinyl ether	EPA 625	μg/L	1	1
Methyl tert-butyl ether (MTBE)	EPA 625	μg/L	1	1

RL – Reporting Limit NA – Not applicable

1. RLs are equal to those specified in the MRP of the Permit. Methods may be substituted by an equivalent method that is lower than or meets the project RL.

 To allow comparison of potential source and effect all congeners across each matrix is analyzed. Analysis for PCB congeners includes the following constituents: PCB-8, 18, 28, 31, 33, 37, 44, 49, 52, 56, 60, 66, 70, 74, 77, 81, 87, 95, 97, 99, 101, 105, 110, 114, 118, 119, 123, 126, 128, 132, 138, 141, 149, 151, 153, 156, 157, 158, 167, 168, 169, 170, 174, 177, 180, 183, 187, 189, 194, 195, 201, 203, 206, and 209.

Parameter	Accuracy	Precision	Recovery	Completeness				
Field Measurements								
Water Velocity (for Flow calc.)	2%	NA	NA	90%				
рН	+ 0.2 pH units	+ 0.5 pH units	NA	90%				
Temperature	+ 0.5 oC	+ 5%	NA	90%				
Dissolved Oxygen	+ 0.5 mg/L	+ 10%	NA	90%				
Turbidity	10%	10%	NA	90%				
Conductivity	5%	5%	NA	90%				
Laboratory Analyses – Water								
Conventionals and Solids	80 - 120%	0-25%	80-120%	90%				
Aquatic Toxicity	(1)	(2)	NA	90%				
Nutrients <sup>(3)</sup>	80 - 120%	0-25%	90-110%	90%				
Metals <sup>(3)</sup>	75 - 125%	0-25%	75 - 125%	90%				
Semi-Volatile Organics <sup>(3)</sup>	50 - 150%	0-25%	50-150%	90%				
Volatile Organics <sup>(3)</sup>	50 - 150%	0-25%	50-150%	90%				
Triazines <sup>(3)</sup>	50 - 150%	0-25%	50-150%	90%				
Herbicides <sup>(3)</sup>	50 - 150%	0-25%	50-150%	90%				
OC Pesticides <sup>(3)</sup>	50 - 150%	0-25%	50-150%	90%				
PCB Congeners <sup>(3)</sup>	50 - 150%	0-25%	50-150%	90%				
PCB Aroclors <sup>(3)</sup>	50-150%	0-25%	50-150%	90%				
OP Pesticides <sup>(3)</sup>	50-150%	0-25%	50-150%	90%				

Table C-3 Data Quality Objectives

1. Must meet all method performance criteria relative to the reference toxicant test.

2. Must meet all method performance criteria relative to sample replicates.

3. See

4. Table C-2 for a list of individual constituents in each suite for water.

### 1.2.1 Method Detection Limit Studies

Any laboratory performing analyses under this program must routinely conduct MDL studies to document that the MDLs are less than or equal to the project-specified RLs. If any analytes have MDLs that do not meet the project RLs, the following steps must be taken:

- Perform a new MDL study using concentrations sufficient to prove analyte quantitation at concentrations less than or equal to the project-specified RLs per the procedure for the Determination of the Method Detection Limit presented in Revision 1.1, 40 Code of Federal Regulations (CFR) 136, 1984.
- No samples may be analyzed until the issue has been resolved. MDL study results must be available for review during audits, data review, or as requested. Current MDL study results must be reported for review and inclusion in project files.

An MDL is developed from seven aliquots of a standard containing all analytes of interest spiked at five times the expected MDL. These aliquots are processed and analyzed in the same manner as environmental samples. The results are then used to calculate the MDL. If the calculated MDL is less than 0.33 times the spiked concentration, another MDL study should be performed using lower spiked concentrations.

# 1.2.2 **Project Reporting Limits**

Laboratories generally establish RLs that are reported with the analytical results—these may be called reporting limits, detection limits, reporting detection limits, or several other terms by the reporting laboratory. These laboratory limits must be less than or equal to the project RLs listed in

**Table** C-2. Wherever possible, project RLs are lower than the relevant numeric criteria or toxicity thresholds. Laboratories performing analyses for this project must have documentation to support quantitation at the required levels.

# 1.2.3 Laboratory Standards and Reagents

All stock standards and reagents used for standard solutions and extractions must be tracked through the laboratory. The preparation and use of all working standards must be documented according to procedures outlined in each laboratory's Quality Assurance (QA) Manual; standards must be traceable according to USEPA, A2LA or National Institute for Standards and Technology (NIST) criteria. Records must have sufficient detail to allow determination of the identity, concentration, and viability of the standards, including any dilutions performed to obtain the working standard. Date of preparation, analyte or mixture, concentration, name of preparer, lot or cylinder number, and expiration date, if applicable, must be recorded on each working standard.

# 1.2.4 Sample Containers, Storage, Preservation, and Holding Times

Sample containers must be pre-cleaned and certified free of contamination according to the USEPA specification for the appropriate methods. Sample container, storage and preservation, and holding time requirements are provided in **Table C-4**. The analytical laboratories will supply sample containers that already contain preservative (**Table C-4**), including ultra-pure hydrochloric and nitric acid, where applicable. After collection, samples will be stored at <8°C until arrival at the contract laboratory.

e C-4

## Sample Container, Sample Volume, Initial Preservation, and Holding Time Requirements for Parameters Analyzed at a Laboratory

Parameter	Sample Container	Sample Volume <sup>(1)</sup>	Immediate Processing and Storage	Holding Time
Water				
Toxicity				
Initial Screening	Glass or			
Follow-Up Testing	FLPE-lined	40 L	Store at 4°C	36 hours <sup>(2)</sup>
Phase I TIE	jerrican			
Total coliform, fecal coliform, and <i>Enterococcus</i> (marine waters)	Sterile, PE	120 mL	Store at 8°C	6 hours
Fecal coliform, E. coli (fresh waters)	PE	120 mL	Na2S2O3 and Store at 4°C	
Oil and Grease	PE	250 mL	HCl and Store at 4°C	28 days
Cyanide	PE	1 L	NaOH and Store at 4°C	14 days

Parameter	Sample Container	Sample Volume <sup>(1)</sup>	Immediate Processing and Storage	Holding Time	
Dissolved Organic Carbon (DOC)	PE	250 mL	Store at 4°C	Filter/28 days	
Total Organic Carbon (TOC)	PE	250 mL	H2SO4 and Store at 4°C	28 days	
Total Petroleum Hydrocarbon	Glass	1 L	HCL or H2SO4 and Store at 4°C	7/40 days <sup>(3)</sup>	
Biochemical Oxygen Demand	PE	1L	Store at 4°C	48 hours	
Chemical Oxygen Demand	PE	500 mL	H2SO4 and Store at 4°C	28 days	
MBAS	PE	1 L	Store at 4°C	48 hours	
Fluoride	PE	500 mL	None required	28 days	
Chloride	PE	250 mL	Store at 4°C	28 days	
Perchlorate	PE	500 mL	Store at 4°C	28 days	
Nitrate Nitrogen					
Nitrite Nitrogen	PE	250 mL	Store at 4°C	48 hours	
Orthophosphate-P					
Ammonia Nitrogen					
Total and Dissolved Phosphorus		0.50 T		28 days	
Organic Nitrogen	Glass	250-mL	H2SO4 and Store at 4°C		
Nitrate + Nitrite (as N)					
Total Kjehdahl Nitrogen (TKN)	PE	250 mL	H2SO4 and Store at 4°C	28 days	
Total Alkalinity	PE	500 mL	Store at 4°C	14 days	
Suspended Sediment Concentration (SSC)	PE	250 mL	Store at 4°C	120 days	
Total Suspended Solids (TSS)	PE	250 mL	Store at 4°C	7 days	
Total Dissolved Solids (TDS)	PE	250 mL	Store at 4°C	7 days	
Volatile Suspended Solids	PE	250 mL	Store at 4°C	7 days	
Hardness	PE	500 mL	HNO3 and Store at 4°C	180 days	
Metals	PE	500 mL	HNO3 and Store at 4°C	6 months <sup>(4)</sup>	
Mercury	Glass	500 mL	HCL and Store at 4°C	6 months	
PCBs, OC Pesticides, OP Pesticides, Triazine Pesticides	Amber glass	4 x 1 L	Store at 4°C	7/40 days <sup>(3)</sup>	
Suspended Solids Analysis for Organics and Metals	Amber glass	6 x 1 L	Store at 4°C	1 year <sup>(5)</sup>	
Herbicides	Glass	2 x 40 mL	Thiosulfate and Store at 4°C	14 days	
Semivolatile Organic Compounds	Glass	2 x 1 L	Store at 4°C	7 days	
Volatile Organic Compounds	VOA	3 x 40 mL	HCl and Store at 4°C	14 days	

PE - Polyethylene

1. Additional volume may be required for QC analyses.

2. Tests should be initiated within 36 hours of collection. The 36-hour hold time does not apply to subsequent analyses for TIEs. For interpretation of toxicity results, samples may be split from toxicity samples in the laboratory and analyzed for specific chemical parameters. All other sampling requirements for these samples are as specified in this document for the specific analytical method. Results of these analyses are not for any other use (e.g., characterization of ambient conditions) because of potential holding time exceedances and variance from sampling requirements.

3. 7/40 = 7 days to extract and 40 days from extraction to analysis.

4. 6 months after preservation.

Parameter	Sample Container	Sample Volume <sup>(1)</sup>	Immediate Processing and Storage	Holding Time
-----------	---------------------	---------------------------------	-------------------------------------	--------------

5. One year if frozen, otherwise 14 days to extract and 40 days from extraction to analysis.

# **1.3** Aquatic Toxicity Testing and Toxicity Identification Evaluations

The aquatic toxicity testing requirements outlines in the MS4 Permit, are intended to identify sources of toxicity in urban runoff. Monitoring begins in the receiving water and the information gained is used to identify constituents for monitoring at outfalls to support the identification of pollutants that need to be addressed in the EWMP, through the implementation of BMPs. The proceeding sections below describe the detailed process for conducting aquatic toxicity monitoring, evaluating results, and the technical and logistical rationale. Control measures and management actions to address confirmed toxicity caused by urban runoff are addressed by the EWMP, either via currently identified management actions or those that are identified via adaptive management of the EWMP.

# **1.1.1 Sensitive Species Selection**

The MRP (page E-32) states that a sensitivity screening to select the most sensitive test species should be conducted unless "a sensitive test species has already been determined, or if there is prior knowledge of potential toxicant(s) and a test species is sensitive to such toxicant(s), then monitoring shall be conducted using only that test species." Previous relevant studies conducted in the watershed should be considered. Such studies may have been completed via previous MS4 sampling, wastewater NPDES sampling, or special studies conducted within the watershed. The following sub-sections discuss the species section process for assessing aquatic toxicity in receiving waters.

## (*i*) Freshwater Sensitive Species Selection

As described in the MRP (page E-31), if samples are collected in receiving waters with salinity less than 1 part per thousand (ppt), or from outfalls discharging to receiving waters with salinity less than 1 ppt, toxicity tests should be conducted on the most sensitive test species in accordance with species and short-term test methods in Short-term Methods for Estimating the Chronic Toxicity of Effluents and Receiving Waters to Freshwater Organisms (EPA/821/R-02/013, 2002; Table IA, 40 CFR Part 136). Static renewal freshwater toxicity test species identified in the MRP are:

- A static renewal toxicity test with the fathead minnow, *Pimephales promelas* (Larval Survival and Growth Test Method 1000.0).
- A static renewal toxicity test with the daphnid, *Ceriodaphnia dubia* (Survival and Reproduction Test Method 1002.0).
- A static non-renewal toxicity test with the green alga, *Selenastrum capricornutum* (also named *Raphidocelis subcapitata*) (Growth Inhibition Test Method 1003.0).

Prior low salinity (fresh) receiving water toxicity testing studies, within the EWMP area, were not identified during CIMP preparation. Available toxicity data for the similar and adjacent Los Angeles River, Ballona Creek, and Dominguez Channel watersheds, suggest that organophosphate pesticides, pyrethroids, and metals are occasionally observed aquatic toxicants in regional urban runoff receiving waters. Based on the occasional presence of these toxicants in the EWMP area, the relative sensitivity of the three species to these pollutants was considered in evaluating which species would most likely be affected by local water samples.

*Ceriodaphnia dubia* (*C. dubia*) is often used locally and reported upon nationally, as a broad spectrum test species that is sensitive for historical and current use pesticides and metals, and studies indicate that it is more sensitive to the toxicants of concern than *Pimephales promelas* (*P. promelas*) or *Selenastrum* 

capricornutum (S. capricornutum). In Aquatic Life Ambient Freshwater Quality Criteria - Copper, the USEPA reports greater sensitivity of C. dubia to copper (species mean acute value of 5.93  $\mu$ g/l) than for P. promelas (species mean acute value of 69.93 µg/l; EPA, 2007). C. dubia's relative sensitivity to copper, extends to multiple metals. Additionally, researchers at the University of California (UC), Davis reviewed available reported species sensitivity values in developing pesticide criteria for the Central Valley Regional Water Quality Control Board. In developing pesticide criteria for the Central Valley Regional Water Quality Control Board (CVRWQCB), researchers at University of California at Davis, reported higher sensitivity of C. dubia to diazinon and bifenthrin (species mean acute value of 0.34 µg/l and 0.105 µg/l) compared to P. promelas (species mean acute value of 7804 µg/l and 0.405 µg/l; Palumbo et al., 2010a,b). Additionally, in a stormwater study for the City of Stockton, urban stormwater runoff found acute and chronic toxicity to C. dubia, with no toxicity to S. capricornutum or P. promelas (Lee and Lee, 2001). The toxicity was attributed to organophosphate pesticides, indicating a higher sensitivity of C. dubia compared to S. capricornutum or P. promelas. While P. promelas is generally less sensitive to metals and pesticides, this species can be more sensitive to ammonia than C, dubia. However, as ammonia is not typically a constituent of concern for urban runoff and ammonia is not consistently observed above the toxic thresholds in the watershed, P. promelas is not considered a particularly sensitive species for evaluating the impacts of urban runoff in freshwater receiving waters in this watershed.

*S. capricornutum* is a species sensitive to herbicides. However, while sometimes present in urban runoff, herbicides are not identified as a potential toxicant in the SMB watershed. Additionally, *S. capricornutum* is not considered the most sensitive species as it is not sensitive to pyrethroids or organophosphate pesticides and is not as sensitive to metals as *C. dubia*. Additionally, the *S. capricornutum* growth test can be affected by high concentrations of suspended and dissolved solids, color, and pH extremes, which can interfere with the determination of sample toxicity. As a result, it is common to manipulate the sample by centrifugation and filtration to remove solids in order to conduct the toxicity test; however, this process may affect the toxicity of the sample. In a study of urban highway stormwater runoff (Kayhanian et. al, 2008), *S. capricornutum* response to the stormwater samples was more variable than the *C. dubia* and the *P. promelas* and in some cases the algal growth was possibly enhanced due to the presence of stimulatory nutrients. Also, in a study on the City of Stockton urban stormwater runoff (Lee and Lee, 2001) the *S. capricornutum* tests rarely detected toxicity where the *C. dubia* and *P. promelas* regularly detected toxicity.

Based on best professional judgment and local experience with the Permit, *C. dubia* is identified as the most sensitive fresh water species to the broadest range of potential toxicant(s) typically found in local fresh receiving waters impacted by urban runoff and will be selected for fresh water toxicity testing by the SMB EWMP Group. The species can be maintained in laboratory cultures making them generally available year round. The ease of interpreting results of the test and relatively small sample volume necessary to run the test, make the test a valuable screening tool. The ease of sample collection and higher sensitivity will support assessing the presence of ambient receiving water toxicity or long term effects of toxic stormwater over time. As such, toxicity testing in the freshwater portions of the watershed will be conducted using *C. dubia*. However, *C. dubia* test organisms are typically cultured in moderately hard waters (80-100 mg/L CaCO3) and can have increased sensitivity to elevated water hardness greater than 400 mg/L CaCO3), which is beyond their typical habitat range. Because of this, in instances where hardness in site waters exceeds 400 mg/L (CaCO3), an alternative test species may be used. Daphnia magna is more tolerant to high hardness levels and is a suitable substitution for *C. dubia* in these instances (Cowgill and Milazzo, 1990).

## (ii) Saltwater Sensitive Species Selection

Samples collected in receiving waters with salinity equal to or greater than 1 ppt or from outfalls discharging to receiving waters with salinity that is equal to or greater than 1 ppt, should be tested using the most sensitive test species in accordance with *Short-term Methods for Estimating the Chronic Toxicity of Effluents and Receiving Waters to West Coast Marine and Estuarine Organisms (EPA/600/R-95/136, 1995)*.

The marine and estuarine test species identified in the MRP are:

- A static renewal toxicity test with the topsmelt, *Atherinops affinis* (Larval Survival and Growth Test Method 1006.0).
- A static non-renewal toxicity test with the purple sea urchin, *Strongylocentrotus purpuratus* (Fertilization Test Method 1008.0).
- A static non-renewal toxicity test with the giant kelp, *Macrocystis pyrifera* (Germination and Growth Test Method 1009.0).

In addition to the three species identified in the MRP, the red abalone, *Haliotis rufescens* (*H. rufescens*), larval development test was also considered given the extensive use in region.

Although all the species mentioned have been demonstrated as sensitive to a wide variety of toxicants and have been subject to numerous inter- and intra-laboratory testing using standardized toxicants, two species: *Macrocystis pyrifera* (*M. pyrifera*) and *Atherinops affinis* (*A. affinis*); have limitations when used to assess the toxicity of stormwater compared to the sea urchin *Strongylocentrotus purpuratus* (*S. purpuratus*) fertilization test and the red abalone larval *Haliotis rufescens* (*H. rufescens*) development test.

The method for *M. pyrifera* is a 48-hour chronic toxicity test that measures the percent zoospore germination and the length of the gametophyte germ tube. Although the test may be sensitive to herbicides, fungicides, and treatment plant effluent, the use of *M. pyrifera* as a test species for stormwater monitoring may not be ideal. Obtaining sporophylls for stormwater testing could also be a limiting factor for selecting this test. Collection of *M. pyrifera* sporophylls from the field is necessary prior to initiating the test and the target holding time for any receiving water or stormwater sample is 36 hours; however, 72 hours is the maximum time a sample may be held prior to test initiation. During the dry season, meeting the 36-72 hour holding time will be achievable; however, field collection during wet weather may be delayed beyond the maximum holding time due to heavy seas and inaccessible collection sites. In addition, collection of *M. pyrifera* sporophylls during the storm season may include increased safety risks that can be avoided by selection of a different species.

The *A. affinis* test measures the survival and growth test of a larval fish over seven days. At the end of seven days of exposure to a suspected toxicant, the number of surviving fish are recorded, along with their weights, and compared to those exposed to non-contaminated seawater. Positive characteristics of the *A. affiniss* chronic test include the ability to purchase test organisms from commercial suppliers as well as being one of the few indigenous test species that may be used to test undiluted stormwater by the addition of artificial sea salts to within the range of marine receiving waters. Unfortunately, the tolerance of *A. affinis* to chemicals in artificial sea salts may also explain their lack of sensitivity to changes in water quality compared to other test organisms such as the sea urchin or red abalone. Further, there are concerns with the comparability of conducting a seven-day exposure test when most rain events do not occur over a seven-day period.

The *Strongylocentrotus purpuratus* (*S. purpuratus*) fertilization test measures the ability of *S. purpuratus* sperm to fertilize an egg when exposed to a suspected toxicant. The *S. purpuratus* fertilization has been selected as a chronic toxicity test organism in previous MS4 permits and has been used to assess ambient receiving water toxicity, sediment pore water toxicity, as well as stormwater toxicity. The *S. purpuratus* fertilization test is also among the most sensitive test species to metals. The adult test organisms may be purchased and held in the lab prior to fertilization, and the sample volume necessary to conduct the test is small with respect to the other suggested tests. The minimal exposure period (20 min) allows for a large number of tests to be conducted over a short period of time and permits the testing of toxicants that may lose their potency over long periods of time.

The *H. rufescens* red abalone larval development test measures the percent of abnormal shell development in larvae exposed to toxic samples for 48 hours. The *H. rufescens* red abalone is commonly used to test treatment plant effluent, but has had limited use in stormwater compared to the *S. purpuratus* fertilization test. The advantages of the red abalone test include a sensitive endpoint, the ability to purchase abalone from commercial suppliers and hold test organisms prior to spawning, and low variability in results compared to other species (e.g., *S. purpuratus* fertilization test). Thus, though not listed as a potential test species for use in stormwater monitoring in the MS4 permit, it was considered as a potentially sensitive species for the purposes of selecting the most sensitive species.

Due to the limitations of the giant kelp germination and growth test and the topsmelt survival and growth test, in addition to not being particularly sensitive to the constituents identified as problematic in stormwater water runoff from this watershed, these tests are not considered particularly helpful in supporting the identification of pollutants of concern. Based on the sensitivity, smaller test volume requirements, their ability to be housed in the lab prior to testing, and shorter exposure times, the *S. purpuratus* fertilization test and the *H. rufescens* development test will be considered during sensitive species selection to measure toxicity in marine and estuarine environments. Species screening was determined to be appropriate for these two species (as opposed to selecting just one) as testing conducted within the region with both species have shown varying sensitivity. Thus, it is appropriate to test both to determine sensitivity at a given site. After the screening testing is completed, monitoring will be conducted with the most-sensitive species for the duration of the permit (4 years).

# 1.3.1 Testing Period

The following subsections characterize the toxicity testing periods for samples collected during dry and wet weather conditions.

# (*i*) Freshwater Testing Periods

Although wet weather conditions in the region generally persist for less than the chronic testing periods (7 days), the C. dubia chronic test will be used for wet weather toxicity testing in accordance with *Short-term Methods for Estimating the Chronic Toxicity of Effluents and Receiving Waters to Freshwater Organisms* (EPA, 2002b). Utilization of chronic tests on wet weather samples are not expected to generate results representative of the typical conditions found in the receiving water intended to be simulated by toxicity testing.

Chronic toxicity tests will be used to assess both survival and reproductive/growth endpoints for *C. dubia* in dry weather samples. Chronic testing will be conducted on undiluted grab samples in accordance with *Short-term Methods for Estimating the Chronic Toxicity of Effluents and Receiving Waters to Freshwater Organisms* (USEPA, 2002a).

# (*ii*) Saltwater Testing Period

Two marine and estuarine toxicity species tests utilize methods that have short durations (20 minutes for the *S. purpuratus* fertilization test and 48 hours for the *H. rufescens* development test). The end points are sub-lethal and can be considered representative of acute or chronic effects. Both test species and test methods are suitable for wet weather and dry weather monitoring.

## 1.3.2 Toxicity Endpoint Assessment and Toxicity Identification Evaluation Triggers

Per the MRP, toxicity test endpoints will be analyzed using the Test of Significant Toxicity (TST) t-test approach specified by the USEPA (USEPA, 2010). The Permit specifies that the chronic in-stream waste concentration (IWC) be set at 100% receiving water for receiving water samples and 100% effluent for outfall samples. Using the TST approach, a t-value is calculated for a test result and compared with a critical t-value from USEPA's TST Implementation Document (USEPA, 2010). Follow-up triggers are generally based on the Permit specified statistical assessment as described below.

For chronic *C. dubia* toxicity testing, if a  $\geq$ 50% reduction in survival is observed between the sample and laboratory control that is statistically significant, a toxicity identified evaluation (TIE) will be performed.

TIE procedures will be initiated as soon as possible after the toxicity trigger threshold is observed to reduce the potential for loss of toxicity due to extended sample storage. If the cause of toxicity is readily apparent or is caused by pathogen related mortality (PRM) or epibiont interference with the test, the result will be rejected. If necessary, a modified testing procedure will be developed for future testing.

In cases where significant endpoint toxicity effects  $\geq$ 50% are observed in the original sample, but the follow-up TIE baseline "signal" is not statistically significant, the cause of toxicity will be considered non-persistent. No immediate follow-up testing is required on the sample. However, future test results should be evaluated to determine if parallel TIE treatments are necessary to provide an opportunity to identify the cause of toxicity.

For the chronic marine and estuarine tests, the percent effect will be calculated. The percent effect is defined as the difference between the mean control response and the mean IWC response divided by the control response, multiplied by 100. A TIE will be performed if the percent effect value is equal to or greater than 50 percent. The TIE procedures will be initiated as soon as possible after the toxicity trigger threshold is observed to reduce the potential for loss of toxicity during sample storage. If the cause of toxicity is readily apparent or is caused by pathogen related mortality (PRM) or epibiont interference, the result will be rejected. In cases where significant endpoint toxicity effects greater than 50% are observed in the original sample, but the follow-up TIE positive control "signal" is not statistically significant, the cause of toxicity will be considered non-persistent and no sample follow-up testing is required. Future test results should be evaluated to determine if parallel TIE treatments are necessary to provide an opportunity to identify the cause of toxicity.

# **1.3.3 Toxicity Identification Evaluation Approach**

The results of toxicity testing will be used to trigger further investigations to determine the cause of observed laboratory toxicity. The primary purpose of conducting TIEs is to support the identification of management actions that will results in the removal of pollutants causing toxicity in the receiving waters. Successful TIEs will direct monitoring at outfall sites to inform management actions. As such, the goal of conducting TIEs is to identify pollutant(s) that should be sampled during outfall monitoring so that management actions can be identified to address the pollutant(s).

The TIE approach is divided into three phases as described in USEPA's 1991 Methods for Aquatic Toxicity Identification Evaluations – Phase I Toxicity Characterization Procedures – Second Edition (EPA/600/6-9/003) and briefly summarized as follows:

- Phase I utilizes methods to characterize the physical/chemical nature of the constituents which cause toxicity. Such characteristics as solubility, volatility and filterability are determined without specifically identifying the toxicants. Phase I results are intended as a first step in specifically identifying the toxicants but the data generated can also be used to develop treatment methods that remove toxicity without specifically identifying the toxicants.
- Phase II utilizes methods to specifically identify toxicants, or toxicant pollutant class.
- Phase III utilizes methods to confirm the identity of suspected toxicant(s).

A Phase I TIE will be conducted on samples that exceed a TIE trigger described above. Water quality data will be reviewed to further support evaluation of potential toxicants. A range of sample manipulations may be conducted as part of the TIE process. The most common manipulations are described in **Table C-5**. Information from previous chemical testing and/or TIE efforts will be used to determine which of these (or other) sample manipulations are most likely to provide useful information for identification of primary toxicants. TIE methods will generally adhere to USEPA procedures documented in conducting TIEs (USEPA, 1991, 1992, 1993a-b).

#### Table C-5

TIE Sample Manipulation	Expected Response
Adjust to between pH 7 and 8.5	Alters toxicity in pH sensitive compounds (i.e., ammonia and some trace metals)
Filtration or centrifugation	Removes particulates and associated toxicants
Ethylene Diamine Tetra Acetic Acid (EDTA)	Chelates trace metals, particularly divalent cationic metals
Sodium thiosulfate (STS) addition	Reduces toxicants attributable to oxidants (i.e., chlorine) and some trace metals
Piperonyl Butoxide (PBO)	Reduces toxicity from organophosphate pesticides such as diazinon, chlorpyrifos and malathion, and enhances pyrethroid toxicity
Carboxylesterase addition <sup>(1)</sup>	Hydrolyzes pyrethroids
Temperature adjustments <sup>(2)</sup>	Pyrethroids become more toxic when test temperatures are decreased
Solid Phase Extraction (SPE) with C18 column*	Removes non-polar organics (including pesticides) and some relatively non-polar metal chelates
Sequential Solvent Extraction of C18 column	Further resolution of SPE-extracted compounds for chemical analyses
No Manipulation	Baseline test for comparing the relative effectiveness of other manipulations

#### Aquatic Toxicity Identification Evaluation Sample Manipulations

\* Denotes treatments that will be conducted during the initiation of toxicity monitoring, but may be revised as the program is implemented. These treatments were recommended for initial stormwater testing in Appendix E (Toxicity Testing Tool for Storm Water Discharges) of the State Water Resources Control Board's June 2012 Public Review Draft "Policy for Toxicity Assessment and Control".

1. Carboxylesterase addition has been used in recent studies to help identify pyrethroid-associated toxicity (Wheelock et al., 2004; Weston and Amweg, 2007). However, this treatment is experimental in nature and should be used along with other

pyrethroid-targeted TIE treatments (e.g., PBO addition).

2. Temperature adjustments are another recent manipulation used to evaluate pyrethroid-associated toxicity. Lower temperatures increase the lethality of pyrethroid pesticides. (Harwood, You and Lydy, 2009)

The SMB EWMP Group will identify the cause(s) of toxicity using a selection of treatments in **Table C-5** and, if possible, using the results of water column chemistry analyses. After any initial determinations of the cause of toxicity, the information may be used during future events to modify the targeted treatments to more closely target the expected toxicant or to provide additional treatments to narrow the toxicant cause(s). Moreover, if the toxicant or toxicant class is not initially identified, toxicity monitoring during subsequent events will confirm if the toxicant is persistent or a short-term episodic occurrence.

As the primary goal of conducting TIEs is to identify pollutants for incorporation into outfall monitoring, narrowing the list of toxicants following Phase I TIEs via Phase II or III TIEs is not necessary if the toxicant class determined during the Phase I TIE is sufficient for: (1) identifying additional pollutants for outfall monitoring; and/or (2) identifying control measures. Thus, if the specific pollutant(s) or the analytical class of pollutant(s) (e.g., metals that are analyzed via USEPA Method 200.8) are identified then sufficient information is available to inform the addition of pollutants to outfall monitoring.

Phase II TIEs may be utilized to identify specific constituents causing toxicity in a given sample if the results of Phase I TIE testing and a review of available chemistry data fails to provide information necessary to identify constituents that warrant additional monitoring activities or management actions to identify likely sources of the toxicants and lead to elimination of the sources of these contaminants. Phase III TIEs will be conducted following any Phase II TIEs.

For the purposes of determining whether a TIE is inconclusive, TIEs will be considered inconclusive if:

- The toxicity is persistent (i.e., observed in the baseline), and
- The cause of toxicity cannot be attributed to a class of constituents (e.g., insecticides, metals, etc.) that can be targeted for monitoring.

If (1) a combination of causes that act in a synergistic or additive manner are identified; (2) the toxicity can be removed with a treatment or via a combination of the TIE treatments; or (3) the analysis of water quality data collected during the same event identify the pollutant or analytical class of pollutants, the result of a TIE is considered conclusive.

In cases where significant endpoint toxicity effects greater than 50% are observed in the original sample, but the follow-up TIE baseline "signal" is not statistically significant, the cause of toxicity will be considered non-persistent. No immediate follow-up testing is required on the sample. However, future test results should be evaluated to determine if parallel TIE treatments are necessary to provide an opportunity to identify the cause of toxicity.

Note that the MRP (page E-33) allows a TIE Prioritization Metric (as described in Appendix E of the Southern California Stormwater Monitoring Coalition's (SMC) Model Monitoring Program) for use in ranking sites for TIEs. However, as the extent to which TIEs will be conducted is unknown, prioritization cannot be conducted at this time. Prioritization may be utilized in the future based on the results of toxicity monitoring and an approach to prioritization will be developed through the CIMP adaptive management process and will be described in future versions of the CIMP.

### 1.3.4 Follow Up on Toxicity Testing Results

Per Parts VIII.B.c.vi and XI.G.1.d of the MRP, if the results of a TIE on a receiving sample are inconclusive, a toxicity test conducted during the same condition (i.e., wet or dry weather), using the same test species, will be conducted at applicable upstream outfalls as soon as feasible (i.e., the next monitoring event that is at least 45 days following the toxicity laboratory's report transmitting the results of a inconclusive TIE). The same TIE evaluation triggers and TIE approach presented in Sections 1.1.3 and 1.1.4, respectively will be followed based on the results of the outfall sample.

If a toxicant or class of toxicants is identified through a TIE, the MRP (page E-33) indicates the following actions should be taken:

- SMB EWMP Group Members shall analyze for the toxicant(s) during the next scheduled sampling event in the discharge from the outfall(s) upstream of the receiving water location.
- If the toxicant is present in the discharge from the outfall at levels above the applicable receiving water limitation, a toxicity reduction evaluation (TRE) will be performed for that toxicant.

The list of constituents monitored at outfalls identified in the CIMP will be modified based on the results of the TIEs. Monitoring for constituents identified based on the results of a TIE will occur as soon as feasible following the completion of a successful TIE (i.e., the next monitoring event that is at least 45 days following the toxicity laboratory's report transmitting the results of a successful TIE).

The requirements of the TREs will be met as part of the adaptive management process in the SMB EWMP rather than conducted via the CIMP. The identification and implementation of control measures to address the causes of toxicity are tied to management of the stormwater program, not the CIMP. It is expected that the requirements of TREs will only be conducted for toxicants that are not already addressed by an existing Permit requirement (i.e., TMDLs) or existing or planned management actions.

### 1.3.5 Summary of Aquatic Toxicity Monitoring

The approach to conducting aquatic toxicity monitoring as described in the previous sections is summarized in detail in **Figure C-1**. The intent of the approach is to identify the cause of toxicity observed in receiving water to the extent possible with the toxicity testing tools available, thereby directing outfall monitoring for the pollutants causing toxicity with the ultimate goal of supporting the development and implementation of management actions.

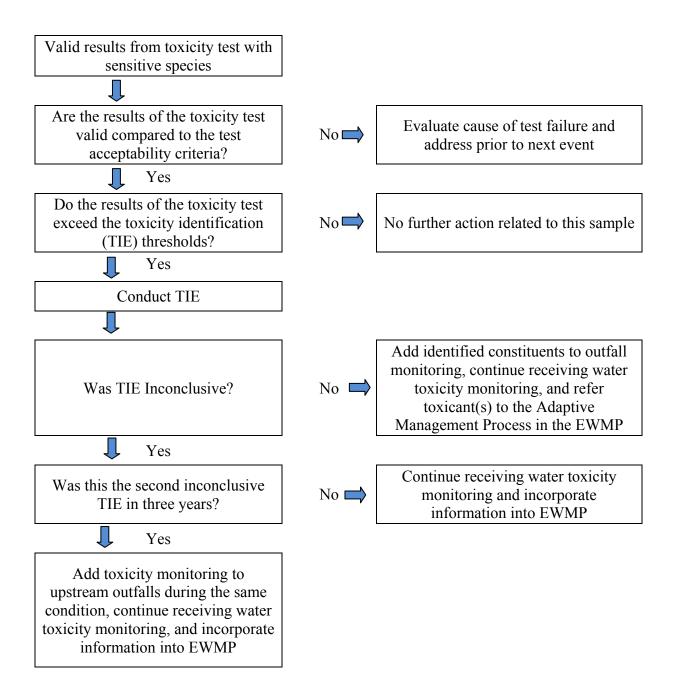


Figure C-1. Aquatic Toxicity Assessment Process

### 1.4 List of Laboratories Conducting Analysis

The chosen laboratories will be able to meet the measurement quality objectives set forth in

**Table** C-2. Sample container and volumes, as listed in **Table C-4**, will vary based on the chosen laboratories. The chosen laboratories will meet California Environmental Laboratory Accreditation Program (ELAP) and/or National Environmental Laboratory Accreditation Program (NELAP) certifications and any data quality requirements specified in this document. Due to contracting procedures and solicitation requirements, qualified laboratories have not yet been selected to carry out the analytical responsibilities described in this CIMP. Selected laboratories will be listed, per the example shown in **Table C-6**, along with lab certification information. Following the completion of the first monitoring year, the pertinent laboratory specific information will be included in the Integrated Monitoring Compliance Report Section of the Annual Report. At the end of all future monitoring years the SMB EWMP Group will assess the laboratories performance and at that time a new laboratory may be chosen.

### Table C-6

### Summary of Laboratories Conducting Analysis for the SMB EWMP Group CIMP

Laboratory <sup>(1)</sup>	General Category of Analysis	Lab Certification No. & Expiration Date <sup>(2)</sup>

1. Information for all laboratories will be added to this table following their selection and upon CIMP update.

2. Lab certifications are renewed on an annual basis.

### 1.6.1 Alternate Laboratories

In the event that the laboratories selected to perform analyses for the CIMP are unable to fulfill data quality requirements outlined herein (e.g., due to instrument malfunction), alternate laboratories need to meet the same requirements that the primary labs have met. The original laboratory selected may recommend a qualified laboratory to act as a substitute. However, the final decision regarding alternate laboratory selection rests with the SMB EWMP Group.

## Section 2 Sampling Methods and Sample Handling

The sections below discuss the steps to be taken to properly prepare for and initiate water quality sampling for the CIMP. SMBBB TMDL monitoring will continue per the CSMP.

### 2.1.1 Monitoring Event Preparation

Monitoring event preparation includes preparation of field equipment, placing bottle orders, and contacting the necessary personnel regarding site access and schedule. The following steps will be completed two weeks prior to each sampling event (a condensed timeline may be appropriate in storm events, which may need to be completed on short notice):

- 1. Contact laboratories to order sample containers and to coordinate sample transportation details.
- 2. Confirm scheduled monitoring date with field crew(s), and set-up sampling day itinerary including sample drop-off.
- 3. Prepare equipment.
- 4. Prepare sample container labels and apply to bottles.
- 5. Prepare the monitoring event summary and field log sheets to indicate the type of field measurements, field observations and samples to be collected at each of the monitoring sites.
- 6. Verify that field measurement equipment is operating properly (i.e., check batteries, calibrate, etc.)

**Table C-7** provides a checklist of field equipment to prepare prior to each monitoring event.

	Monitoring Plan			
	Sample Containers plus Extras with Extra Lids			
	Pre-Printed, Waterproof Labels (extra blank sheets)			
	Event Summary Sheets			
	Field Log Sheets			
	Chain of Custody Forms			
	Bubble Wrap			
	Coolers with Ice			
	Tape Measure			
	Paper Towels or "Rags in a Box"			
	Safety Equipment			
	First Aid Kit			
	Cellular Telephone			
	Gate Keys			
	Hip Waders			
	Plastic Trash Bags			
	Sealable Plastic Bags			
	Grab Pole			
	Clean Secondary Container(s)			
	Field Measurement Equipment			
	New Powder-Free Nitrile Gloves			
	Writing Utensils			
	Stop Watch			
	Camera			
	Blank Water			

Table C-7

### Field Equipment Checklist

### 2.1.1 Bottle Order/Preparation

Sample container orders will be placed with the appropriate analytical laboratory at least two weeks prior to each sampling event. Containers will be ordered for all water samples, including quality control samples, as well as extra containers in case the need arises for intermediate containers or a replacement. The containers must be the proper type and size and contain preservative as appropriate for the specified laboratory analytical methods.

**Table C-4** presents the proper container type, volume, and immediate processing and storage needs. The field crew must inventory sample containers upon receipt from the laboratory to ensure that adequate containers have been provided to meet analytical requirements for each monitoring event. After each event, any bottles used to collect water samples will be cleaned by the laboratory and either picked up by or shipped to the field crew.

### 2.1.2 Container Labeling and Sample Identification Scheme

Samples will be identified with a unique identification code to ensure that results are properly reported and interpreted. The following scheme will be used by the SMB EWMP Group, but alternative methods may be utilized in the future. Samples will be identified such that the site, sampling location, matrix, sampling equipment and sample type (i.e., environmental sample or QC sample) can be distinguished by a data reviewer or user. Sample identification codes will consist of a site identification code, a matrix code, and a unique sample identification code. The format for sample identification codes is AAA-SMB-AA-#### - XXX, where:

- AAAA indicates the unique site ID for each site.
- SMB indicates that the sample was collected as part of the SMB EWMP Group CIMP.
- ###- identifies the sequentially numbered monitoring event, and the # is an optional indicator for re-samples collected for the same event. Sample events are numbered from 001 to 999 and will not be repeated. XXX identifies the sample number unique to a sample bottle collected for a single event. Sample bottles are numbered sequentially from 001 to 999 and will not be repeated within a single event.

Custom bottle labels should be produced using blank waterproof labels and labeling software. This approach will allow the site and analytical constituent information to be entered in advance and printed as needed prior to each monitoring event. Labels will be placed on the appropriate bottles in a dry environment; applying labels to wet sample bottles should be avoided. Labels should be placed on sides of bottles rather than on bottle caps. All sample containers will be pre-labeled before each sampling event to the extent practicable. Pre-labeling sample containers simplifies field activities, leaving only sample collection time and date and field crew initials to be filled out in the field. Labels should include the following information:

Program Name	Date	Analytical Requirements
Station ID	Collection Time	Preservative Requirements
Sample ID	Sampling Personnel	Analytical Laboratory

### 2.1.3 Field Meter Calibration

Calibration of field measurement equipment is performed as described in the owner's manuals for each individual instrument. Each individual field crew will be responsible for calibrating their field measurement equipment. Field monitoring equipment must meet the requirements outlined in **Table C-1** and be calibrated before field events based on manufacturer guidance, but at a minimum prior to each event. **Table C-8** outlines the typical field instrument calibration procedures for each piece of equipment requiring calibration. Each calibration will be documented on each event's calibration log sheet (presented in **Appendix A**).

If calibration results do not meet manufacturer specifications, the field crew should first try to recalibrate using fresh aliquots of calibration solution. If recalibration is unsuccessful, new calibration solution should be used and/or maintenance should be performed. Each attempt should be recorded on the equipment calibration log. If the calibration results cannot meet manufacturer's specifications, the field crew should use a spare field measuring device that can be successfully calibrated. If a spare field measuring device that can be successfully calibrated is unavailable, field crews shall note the use of unsuccessfully calibrated equipment on each appropriate field log sheet. Additionally, the SMB EWMP Group should be notified.

Calibration should be verified using at least one calibration fluid within the expected range of field measurements, both immediately following calibration and at the end of each monitoring day. Individual parameters should be recalibrated if the field meters do not measure a calibration fluid within the range of accuracy presented in **Table C-1**. Calibration verification documentation will be retained in the event's calibration verification log.

### Table C-8

Equipment / Instrument	Calibration and Verification Description	Frequency of Calibration	Frequency of Calibration Verification	Responsible Party		
pH Probe	Calibration using standard buffer solutions. Use of mid-range buffer to verify successful calibration.					
Temperature	Requires no subsequent calibration.					
Dissolved Oxygen Probe	Calibrated using water saturated air environment. DO measurement of water-saturated air will be performed and compared to a standard table of DO concentrations in water as a function of temperature and barometric pressure to verify successful calibration.	Day prior to or 1st day of sampling event	After calibration and at the end of each sampling day	Individual Sampling Crews		
Conductivity	Follow manufacturer's specifications. Use of mid-range conductivity standard to verify successful calibration.					
Turbidity	Follow manufacturer's specifications. Use of mid-range turbidity standard to verify successful calibration.					

### Calibration of Field Measurement Equipment

### 2.1.4 Weather Conditions

To ensure a cohesive and cost-effective CIMP, dry- and wet-weather conditions will be defined as the following:

- Wet weather, will be defined as a storm event of greater than or equal to 0.1 inch of precipitation, as measured from at least 50 percent of the Los Angeles County controlled rain gauges within the watershed.
- Dry weather will occur on days with less than 0.1 inch of rain and not within three days after a rain event of 0.1 inch or greater within the watershed, as measured from at least 50 percent of Los Angeles County controlled rain gauges within the watershed.

Note that if rainfall begins after dry weather monitoring has been initiated, then dry weather monitoring will be suspended and continued on a subsequent day when weather conditions meet the dry weather conditions. Grab samples will be collected during dry weather and composite samples will be collected during wet weather. Grab samples will be used for dry-weather sampling events because the composition of the receiving water will change less over time; and thus, the grab sample can sufficiently characterize the receiving water. Grab samples during dry-weather are consistent with similar programs within the region. However, to sufficiently characterize the receiving water during wet-weather, composite samples will generally be used for wet-weather sampling events. Grab samples may be utilized to collect wet

weather sampling in certain situations, which may include, but are not limited to, when the constituent of interest requires the use of grab samples (e.g., *E. coli* and oil and grease), situations where it is unsafe to collect composite samples, or to perform investigative monitoring where composite sampling or installation of an automatic sample compositor (autosampler) may not be warranted.

The MRP includes specific criteria for the time of monitoring events. With the exception of bacteria, most constituents will be monitored during dry weather monitoring events. For dry weather toxicity monitoring, sampling must take place during the historically driest month. Historical precipitation data for rain gauge Santa Monica 634C was gathered from the 1996 - 2013 Los Angeles County Department of Public Works Hydrological Reports. Based on the historical precipitation data, the historically driest month was determined to be August for the SMB EWMP Group. As a result, the dry weather monitoring event that includes toxicity monitoring will be conducted in August. The second dry weather monitoring event will take place during another month that is deemed to be preferable.

The first significant rain event of the storm year (first flush) will be monitored. The targeted storm events for wet weather sampling will be selected based on a reasonable probability that the events will result in substantially increased flows in Santa Monica Canyon Channel and into Santa Monica Bay over at least 12 hours. Sufficient precipitation is needed to produce runoff and increase flow. The decision to sample a storm event will be made in consultation with weather forecasting information services after a quantitative precipitation forecast (QPF) has been determined. All efforts will be made to collect wet weather samples from all sites during a single targeted storm event. However, safety or other factors may make it infeasible to collect wet weather samples during holidays and/or weekends may not be sampled due to sample collection or laboratory staffing constraints.

For a storm to be tracked, the first flush event will have a predicted rainfall of at least 0.25 inches with at least a 70 percent probability of rainfall 24 hours prior to the forecasted time of initial rainfall. Because a significant storm event is based on predicted rainfall, it is recognized that this monitoring may be triggered without 0.25 inches of rainfall actually occurring. In this case, the monitoring event will still qualify as meeting this requirement provided that sufficient sample volume is collected to do all required laboratory analysis. Documentation will be provided showing the predicted rainfall amount. Subsequent storm events must meet the tracking requirements, flow objectives, as well as be separated by a minimum of three days of dry weather. Antecedent conditions will be based on the LACDPW rain gage listed in **Table C-9**. Data can be obtained at <a href="http://dpw.lacounty.gov/wrd/Precip/index.cfm">http://dpw.lacounty.gov/wrd/Precip/index.cfm</a> by clicking the 'See Data' link in the "Near Real-Time Precipitation Map" section. The web page displays a map showing real-time rainfall totals (in inches) for different rain gages. Although the default precipitation period is 24 hours, the user can view rainfall totals over different durations. Data from the rain gages is updated every 10 minutes.

Table	C-9
-------	-----

### Real-Time Rain Gage Used to Define Weather Conditions for CIMP Monitoring<sup>(1)</sup>

Rainfall Gage	Rainfall Gage Operator		Longitude
Electric Ave Pump Plant (461)	Los Angeles County Department of Public Works	33°59'35.15"N	118°28'22.15"W

1. Information for the gage can be found at <u>http://dpw.lacounty.gov/wrd/Precip/alertlist.cfm</u>.

For the purpose of triggering wet weather sampling preparation, a predicted rainfall of 0.1-0.5 inches in a 6- to 12-hour period would be sufficient to mobilize for wet weather sampling. The National Weather Service's weather forecast for the SMB EWMP Group EWMP area can be accessed on-line at <a href="http://www.wrh.noaa.gov/lox/">http://www.wrh.noaa.gov/lox/</a> then click on the location of the SMB EWMP Group EWMP area on the area map. From the forecast page, the link to "Quantitative Precipitation Forecast" provides forecasted precipitation in inches for the next 24 hours, in 3-hour increments for the first 12 hours and in 6-hour increments for the last 12 hours.

### 2.2 Sample Handling

Proper sample handling ensures the samples will comply with the monitoring methods and analytical hold time and provides traceable documentation throughout the history of the sample.

### 2.2.1 Documentation Procedures

The SMB EWMP Group is responsible for ensuring that each field sampling team adheres to proper custody and documentation procedures. Field log sheets documenting sample collection and other monitoring activities for each site will be bound in a separate master logbook for each event and/or scanned and stored electronically. Field personnel have the following responsibilities:

- 1. Keep an accurate written record of sample collection activities on the field log sheets.
- 2. Ensure that all field log sheet entries are legible and contain accurate and inclusive documentation of all field activities.
- 3. Note errors or changes using a single line to cross out the entry and date and initial the change.
- 4. Ensure that a label is affixed to each sample collected and that the labels uniquely identify samples with a sample ID, site ID, date and time of sample collection and the sampling crew initials.
- 5. Complete the chain of custody forms accurately and legibly.

### 2.2.2 Field Documentation/Field Log

Field crews will keep a field log book, and/or filed electronically, for each sampling event that contains a calibration log sheet, a field log sheet for each site, and appropriate contact information. The following items should be recorded on the field log sheet for each sampling event:

- Monitoring station location (Station ID);
- Date and time(s) of sample collection;
- Name(s) of sampling personnel;
- Sample collection depth;
- Sample ID numbers and unique IDs for any replicate or blank samples;
- QC sample type (if appropriate);
- Requested analyses (specific parameters or method references);
- Sample type (e.g., grab or composite);
- The results of field measurements (e.g., flow, temperature, dissolved oxygen, pH, conductivity, turbidity) and the time that measurements were made;
- Qualitative descriptions of relevant water conditions (e.g., water color, flow level, clarity) or weather (e.g., wind, rain) at the time of sample collection;
- Trash observations (presence/absence);
- A description of any unusual occurrences associated with the sampling event, particularly those that may affect sample or data quality.

The field log will be scanned into a PDF within one week of the conclusion of each sampling event. Alternatively, all measurements could be collected on an electronic device such as laptop or tablet computer. **Appendix A** contains an example of the field log sheet.

### 2.2.3 Chain-of Custody Forms

Sample custody procedures provide a mechanism for documenting information related to sample collection and handling. Sample custody must be traceable from the time of sample collection until results are reported. A sample is considered under custody if:

- It is in actual possession.
- It is in view after in physical possession.
- It is placed in a secure area (accessible by or under the scrutiny of authorized personnel only after in possession).

A COC form must be completed after sample collection and prior to sample shipment or release. The COC form, sample labels, and field documentation will be cross-checked to verify sample identification, type of analyses, number of containers, sample volume, preservatives, and type of containers. A complete COC form is to accompany the transfer of samples to the analyzing laboratory. A typical COC form is presented in **Appendix A**.

### 2.2.4 Sample Handling and Shipment

The field crews will maintain custody of samples during each monitoring event. Chain-of-custody (COC) forms will accompany all samples during shipment to contract laboratories to identify the shipment contents. All water quality samples will be transported to the analytical laboratory by the field crew or by courier. The original COC form will accompany the shipment, and a signed copy of the COC form will be sent, typically via email or fax, by the laboratory to the field crew to be retained in the project file.

While in the field, samples will be stored on ice in an insulated container. Samples that must be shipped to the laboratory must be examined to ensure that container lids are tight and placed on ice to maintain the appropriate temperature. The ice packed with samples must be approximately 2 inches deep at the top and bottom of the cooler, and must contact each sample to maintain temperature. The original COC form(s) will be double-bagged in re-sealable plastic bags and either taped to the outside of the cooler or to the inside lid. Samples must be shipped to the contract laboratory according to transportation standards. The method(s) of shipment, courier name, and other pertinent information should be entered in the "Received By" or "Remarks" section of the COC form.

Coolers must be sealed with packing tape before shipping, unless transported by field or lab personnel, and must not leak. It is assumed that samples in tape-sealed ice chests are secure whether being transported by common carrier or by commercial package delivery. The laboratory's sample receiving department will examine the shipment of samples for correct documentation, proper preservation and compliance with holding times.

The following procedures are used to prevent bottle breakage and cross-contamination:

- Bubble wrap or foam pouches are used to keep glass bottles from contacting one another to prevent breakage, re-sealable bags will be used if available.
- All samples are transported inside hard plastic coolers or other contamination-free shipping containers.
- If arrangements are not made in advance, the laboratory's sample receiving personnel must be

notified prior to sample shipment.

All samples remaining after successful completion of analyses will be disposed of properly. It is the responsibility of the personnel of each analytical laboratory to ensure that all applicable regulations are followed in the disposal of samples or related chemicals. Samples will be stored and transported as noted in **Table C-4**. Samples not analyzed locally will be sent on the same day that the sample collection process is completed, if possible. Samples will be delivered to the appropriate laboratory as will be indicated in **Table C-10**. Note that due to procurement procedures, the analytical laboratories have not been identified at this time. Information for all laboratories will be added to this table following their selection. All appropriate contacts will be listed along with lab certification information in **Table C-10**.

### Table C-10

Laboratory <sup>(1)</sup>	General Category of Analysis	Shipping Method	Contact	Phone	Address	Lab Certification No. & Expiration Date <sup>(2)</sup>
<ol> <li>Information for all laboratories will be added to this table following their selection and upon CIMP update.</li> <li>Lab certifications are renewed on an annual basis.</li> </ol>						

### Information on Laboratories Conducting Analysis for the SMB EWMP Group CIMP

### 2.2.5 Laboratory Custody Procedures

Laboratories will follow sample custody procedures as outlined in the laboratory's Quality Assurance (QA) Manual. A copy of each contract laboratory's QA Manual should be available at the laboratory upon request. Laboratories shall maintain custody logs sufficient to track each sample submitted and to analyze or preserve each sample within specified holding times. The following sample control activities must be conducted at the laboratory:

- Initial sample login and verification of samples received with the COC form;
- Document any discrepancies noted during login on the COC;
- Initiate internal laboratory custody procedures;
- Verify sample preservation (e.g., temperature);
- Notify the SMB EWMP Group if any problems or discrepancies are identified; and,
- Perform proper sample storage protocols, including daily refrigerator temperature monitoring and sample security.

Laboratories shall maintain records to document that the above procedures are followed. Once samples have been analyzed, samples will be stored at the laboratory for at least 60 days. After this period, samples may be disposed of properly.

### 2.3 Field Protocols

Briefly, the key aspects of quality control associated with field protocols for sample collection for eventual chemical and toxicological analyses are as follows:

- 1. Field personnel will be thoroughly trained in the proper use of sample collection gear and will be able to distinguish acceptable versus unacceptable water samples in accordance with pre-established criteria.
- 2. Field personnel will be thoroughly trained to recognize and avoid potential sources of sample contamination (e.g., engine exhaust, ice used for cooling).
- 3. Sampling gear and utensils which come in direct contact with the sample will be made of noncontaminating materials (e.g., borosilicate glass, high-quality stainless steel and/or Teflon<sup>™</sup>, according to protocol) and will be thoroughly cleaned between sampling stations according to appropriate cleaning protocol (rinsing thoroughly at minimum).
- 4. Sample containers will be of the recommended type and will be free of contaminants (i.e., precleaned).
- 5. Conditions for sample collection, preservation, and holding times will be followed.

Field crews will comprise of a minimum of two persons per crew. To ensure safety, field crews will have the necessary Personal Protective Equipment (PPE). Other constraints on sampling events include, but are not limited to, lab closures and toxicity testing organism availability. Sampling events should proceed in the following manner:

- 1. Before leaving the sampling crew base of operations, confirm number and type of sample containers as well as the complete equipment list.
- 2. Proceed to the first sampling site.
- 3. Fill-out the general information on the field log sheet.
- 4. Collect the environmental and quality assurance/quality control (QA/QC) samples indicated on the event summary sheet and store samples appropriately. Using the field log sheet, confirm that all appropriate containers were filled.
- 5. Collect field measurements and observations, and record these on the field log sheet.
- 6. Repeat the procedures in steps 3, 4, and 5 for each of the remaining sampling sites.
- 7. Complete the COC forms using the information on the field log sheets.
- 8. After sample collection is completed, deliver and/or ship samples to appropriate laboratory.

### 2.4 Sample Collection

All samples will be collected in a manner appropriate for the specific analytical methods to be used. The proper sampling techniques, outlined in this section, will ensure that the collected samples are representative of the waterbodies sampled. Should field crews feel that it is unsafe to collect samples for any reason, the field crews **SHOULD NOT COLLECT** a sample and note on the field log that the sample was not collected, why the sample was not collected, and provide photo documentation, if feasible.

### 2.4.1 Overview of Sampling Techniques

As described below, the method used to collect water samples is dependent on the depth, flow, and sampling location (receiving water, outfall). Nonetheless, in all cases:

- 1. Throughout each sample collection event, the sampler should exercise aseptic techniques (i.e., do not touch the inner surfaces or lip edges of the sample bottle or cap).
- 2. The sampler should use clean, powder-free, nitrile gloves for each site to prevent contamination.
- 3. When collecting the sample, the sampler should not breathe, sneeze, or cough in the direction of the container.
- 4. Gloves should be changed if they are soiled, or if the potential for cross-contamination exists from handling sampling materials or samples.
- 5. While the sample is collected, the bottle lid shall not be placed on the ground.
- 6. The sampler should not eat or drink during sample collection.
- 7. The sampler should not smoke during sample collection.
- 8. Each person on the field crew should wear clean clothing that is free of dirt, grease, or other substances that could contaminate the sampling apparatus or sample bottles.
- 9. Sampling should not occur near a running vehicle. Vehicles should not be parked within the immediate sample collection area.
- 10. When the sample is collected, ample air space should be left in the bottle to facilitate mixing by shaking for lab analysis, unless otherwise required by the method.
- 11. After the sample is collected and the cap is tightly screwed back on the bottle, the time of sampling should be recorded on the field log sheet.
- 12. Any QA/QC samples that are collected should be also be noted on the field log sheet and labeled according the convention described in **Section 2.1.1** of this Attachment.

- 13. Samples should be stored as previously described.
- 14. COC forms should be filled out as described in **Section 2.2** of this Attachment and delivered to the appropriate laboratory as soon as feasible to ensure hold times are met.

To prevent contamination of samples, clean metal sampling techniques using USEPA protocols outlined in USEPA Method 1669<sup>1</sup> will be used throughout all phases of the water sample collection. The protocol for clean metal sampling, based on USEPA Method 1669, is summarized below:

- 1. Samples are collected in rigorously pre-cleaned sample bottles with any tubing specially processed to clean sampling standards.
- 2. At least two persons, wearing clean, powder-free nitrile or latex gloves at all times, are required on a sampling crew.
- 3. One person, referred to as "dirty hands", opens only the outer bag of all double-bagged sample bottles.
- 4. The other person, referred to as "clean hands", reaches into the outer bag, opens the inner bag and removes the clean sample bottle.
- 5. Clean hands rinses the bottle at least two times by submerging the bottle, removing the bottle lid, filling the bottle approximately one-third full, replacing the bottle lid, gently shaking and then emptying the bottle. Clean hands then collects the sample by submerging the bottle, removing the lid, filling the bottle and replacing the bottle cap while the bottle is still submerged.
- 6. After the sample is collected, the sample bottle is double-bagged in the opposite order from which it was removed from the same double-bagging.
- 7. Clean, powder-free gloves are changed whenever something not known to be clean has been touched.

### 2.4.2 Field Measurements and Observations

Field measurements will be collected and observations made at each sampling site before sample collection to avoid compromising sample integrity. Field measurements will include the parameters identified in the CIMP for which a laboratory analysis is not being conducted. Field monitoring equipment must meet the requirements outlined in

<sup>1</sup> USEPA. April 1995. *Method 1669: Sampling Ambient Water for Trace Metals at EPA Water Quality Criteria Levels*. EPA 821-R-95-034.

**Table C-3**. All field measurement results and field observations will be recorded on a field log sheet similar to the one presented in **Appendix A** and as described in **Section 2.2** of this Attachment.

Measurements (except for flow) will be collected at approximately mid-stream, mid-depth at the location of greatest flow (if feasible) with a Hydrolab DS4 multi-probe meter, or comparable instrument(s). If at any time the collection of field measurements by wading appears to be unsafe, field crews will not attempt to collect mid-stream, mid-depth measurements. Rather, field measurements will be made either directly from a stable, unobstructed area at the channel edge, or by using a telescoping pole and intermediate container to obtain a sample for field measurements and for filling sample containers. For situations where flows are not sufficiently deep to submerge the probes, an intermediate container will be utilized. The location of field measurements will be documented on the field log sheet.

Flow measurements will be collected as outlined in the following subsections at freshwater receiving water and non-stormwater outfall monitoring sites. Regardless of measurement technique used, if a staff gage is present the gage height will be noted. Field crews may not be able to measure flow at several sites during wet weather because of inaccessibility of the site. If this is the case, site inaccessibility will be documented on the field log sheet.

The field sampling crew has the primary responsibility for responding to failures in the sampling or measurement systems. Deviations from established monitoring protocols will be documented in the comment section of the field log sheet and noted in the post event summaries. If monitoring equipment fails, monitoring personnel will report the problem in the notes section of the field log sheet and will not record data values for the variables in question. Broken equipment will be replaced or repaired prior to the next field use. Data collected using faulty equipment will not be used.

### *(i)* Velocity Meter Flow Measurements

For sampling sites where water is deep enough (>0.1-foot) a velocity meter will be utilized. For these cases, velocity will be measured at approximately equal increments across the width of the flowing water using a Marsh-McBirney Flo-Mate® velocity meter2 or equivalent, which uses an electromagnetic velocity sensor. A "flow pole" will be used to measure the water depth at each measurement point and to properly align the sensor so that the depth of each velocity measurement is approximately equal to 0.6 \* total depth, which is representative of the average velocity. The distance between velocity measurements taken across the stream is dependent on the total width. No more than 10% of the flow will pass through any one cross section.

### *(ii)* Shallow Sheet Flow Measurements

If the depth of flow does not allow for the measurement of flow with a velocity meter (<0.1-foot) a "float" will be used to measure the velocity of the flowing water. The width, depth, velocity, cross section, and corresponding flow rate will be estimated as follows:

• Sheet flow width: The width (W) of the flowing water (not the entire part of the channel that is damp) is measured at the "top", "middle", and "bottom" of a marked-off distance – generally 10

feet (e.g., for a 10-foot marked-off section,  $W_{Top}$  is measured at 0-feet,  $W_{Mid}$  is measured at 5

<sup>2</sup> For more information, see http://marsh-mcbirney.com/Products/2000.htm

feet, and  $W_{Bottom}$  is measured at 10 feet).

- Sheet flow depth: The depth of the sheet flow is measured at the top, middle, and bottom of the marked-off distance. Specifically, the depth (D) of the sheet flow is measured at 25%, 50%, and 75% of the flowing width (e.g.,  $D_{50\%}^{Mid}$  is the depth of the water at middle of the section in the middle of the sheet flow) at each of the width measurement locations. It is assumed that the
- depth at the edge of the sheet flow (i.e., at 0% and 100% of the flowing width) is zero. **Representative cross-section:** Based on the collected depth and width measurements, the representative cross-sectional area across the marked-off sheet flow is approximated as follows:

Representative Cross Section =

$$\begin{aligned} Average \ \left\{ \left[ \frac{W_{Top}}{4} \times \left( \frac{D_{25\%}^{Top}}{2} + \frac{\left( D_{50\%}^{Top} + D_{25\%}^{Top} \right)}{2} + \frac{\left( D_{75\%}^{Top} + D_{50\%}^{Top} \right)}{2} + \frac{D_{75\%}^{Top}}{2} \right) \right], \\ \left[ \frac{W_{Mid}}{4} \times \left( \frac{D_{25\%}^{Mid}}{2} + \frac{\left( D_{50\%}^{Mid} + D_{25\%}^{Mid} \right)}{2} + \frac{\left( D_{75\%}^{Mid} + D_{50\%}^{Mid} \right)}{2} + \frac{D_{75\%}^{Mid}}{2} \right) \right], \\ \left[ \frac{W_{Bottom}}{4} \times \left( \frac{D_{25\%}^{Bottom}}{2} + \frac{\left( D_{50\%}^{Bottom} + D_{25\%}^{Bottom} \right)}{2} + \frac{\left( D_{75\%}^{Bottom} + D_{50\%}^{Bottom} \right)}{2} + \frac{D_{75\%}^{Bottom}}{2} \right) \right] \right\} \end{aligned}$$

Sheet flow velocity: Velocity is calculated based on the amount of time it took a float to travel the marked-off distance (typically 10-feet or more). Floats are normally pieces of leaves, litter, or floatables (suds, etc.). The time it takes the float to travel the marked-off distance is measured at least three times. Then average velocity is calculated as follows:

Distance Marked off for Float Measurement Average Surface Velocity = Average Time for Float to Travel Marked off Distance

Flow Rate calculation: For sheet flows, based on the above measurements/estimates, the estimated flow rate, Q, is calculated by:

Q = f x (Representative Cross Section) x (Average Surface Velocity)

The coefficient f is used to account for friction effects of the channel bottom. That is, the float travels on the water surface, which is the most rapidly-traveling portion of the water column. The average velocity, not the surface velocity, determines the flow rate, and thus f is used to "convert" surface velocity to average velocity. In general, the value of f typically ranges from 0.60 - 0.90 (USGS 1982). Based on flow rate measurements taken during the LA River Bacteria Source Identification Study (CREST 2008) a value of 0.75 will be used for f.

#### (iii) Free-flowing outfalls

Some storm drain outfalls are free-flowing, meaning the runoff falls from an elevated outfall into the channel, which allows for collection of the entire flowing stream of water into a container of known volume (e.g., graduated bucket or graduated Ziploc bag). The time it takes to fill the known volume is measured using a stopwatch, and recorded on the field log. The time it takes to fill the container will be measured three times and averaged to ensure that the calculated discharge is representative. In some cases, a small portion of the runoff may flow around or under the container. For each measurement, "percent capture", or the proportion of flow estimated to enter the bucket, will be recorded. For freeflowing outfalls, the estimated flow rate, Q, is calculated by:

 $Q = Average \ [\frac{Filled \ container \ Volume}{(Time \ to \ Fill \ Container \ ) \times (Estimated \ Capture \ )}]$ 

Based on measurements of free-flowing outfalls during the LA River Bacteria Source Identification Study (CREST, 2008), estimated capture typically ranges from 0.75 - 1.0.

### 2.4.3 Sampling Techniques for the Collection of Water

The following subsections provide details on the various techniques that can be utilized to collect water quality samples. Should field crews feel that it is unsafe to collect samples for any reason, the field crews **SHOULD NOT COLLECT** a sample and note on the field log that the sample was not collected, why the sample was not collected, and provide photo documentation, if feasible.

### (i) Direct Submersion: Hand Technique

Where practical, all grab samples will be collected by direct submersion at mid-stream, mid-depth using the following procedures:

- 1. Follow the standard sampling procedures described in Section 2.4.1 of this Attachment.
- 2. Remove the lid, submerge the container to mid-stream/mid-depth, let the container fill and secure the lid. In the case of mercury samples, remove the lid underwater to reduce the potential for contamination from the air.
- 3. Place the sample on ice.
- 4. Collect the remaining samples including quality control samples, if required, using the same protocols described above.
- 5. Follow the sample handling procedures described in **Section 2.2** of this Attachment.

### (ii) Intermediate Container Technique

Samples may be collected with the use of a clean intermediate container, if necessary, following the steps listed below. An intermediate container may include a container that is similar in composition to the sample container, a pre-cleaned pitcher made of the same material as the sample container, or a Ziploc bag. An intermediate container should not be reused at a different site without appropriate cleaning.

- 1. Follow the standard sampling procedures described in Section 2.4.1 of this Attachment.
- 2. Submerge the intermediate container to mid-stream/mid-depth (if possible), let the container fill, and quickly transfer the sample into the individual sample container(s) and secure the lid(s).
- 3. Place the sample(s) on ice.
- 4. Collect remaining samples including quality control samples, if required, using the same protocols described above.
- 5. Follow the sample handling procedures described in Section 2.2 of this Attachment.

Some flows may be too shallow to fill a container without using an intermediate container. When collecting samples from shallow sheet flows it is very important to not scoop up algae, sediment, or other particulate matter on the bottom because such debris is not representative of flowing water. To prevent scooping up such debris either: (1) find a spot where the bottom is relatively clean and allow the sterile intermediate container to fill without scooping; or (2) lay a clean sterile Ziploc® bag on the bottom and collect the water sample from on top of the bag. A fresh Ziploc® bag must be used at each site.

### (iii) Pumping

Samples may be collected with the use of a peristaltic pump and specially cleaned tubing following the steps listed below. Sample tubing should not be reused at a different site without appropriate cleaning.

- 1. Follow the standard sampling procedures described in Section 2.4.1 of this Attachment.
- 2. Attach pre-cleaned tubing into the pump, exercising caution to avoid allowing tubing ends to touch any surface known not to be clean. A separate length of clean tubing must be used at each sample location for which the pump is used.
- 3. Place one end of the tubing below the surface of the water. To the extent possible, avoid placing the tubing near the bottom so that settled solids are not pumped into the sample container.
- 4. Hold the other end of the tubing over the opening of the sample container, exercising care not to touch the tubing to the sample container.
- 5. Pump the necessary sample volume into the sample container and secure the lid.
- 6. Place the sample on ice.
- 7. Collect remaining samples including quality control samples, if required, using the same protocols described above.
- 8. Follow the sample handling procedures described in **Section 2.2** of this Attachment.

### (iv) Autosamplers

Automatic sample compositors (autosamplers) are used to characterize the entire flow of a storm in one analysis. They can be programmed to take aliquots at either time- or flow-based specified intervals. Before beginning setup in the field, it is recommended to read the manufacturer's instructions. The general steps to set up the autosampler are described below:

- 1. Install pre-cleaned tubing into the pump. Clean tubing will be used at each site and for each event, in order to minimize contamination.
- 2. Attach strainer to intake end of the tubing and install in sampling channel.
- 3. If running flow based composite samples; install flow sensor in sampling channel and connect it to the automatic compositor.
- 4. Label and install composite bottle(s). If sampler is not refrigerated, then add enough ice to the composite bottle chamber to keep sample cold for the duration of sampling or until such time as ice can be refreshed. Make sure not to contaminate the inside of the composite bottle with any of the ice.
- 5. Program the autosampler as per the manufacturer's instructions and make sure the autosampler is powered and running before leaving the site.

After the sample collection is completed the following steps must be taken to ensure proper sample handling:

- 1. Upon returning to the site, check the status of the autosampler and record any errors or missed samples. Note on the field log the time of the last sample, as this will be used for filling out the COCs.
- 2. Remove the composite bottle and store on ice. If dissolved metals are required, then begin the sample filtration process outlined in the following subsection, within 15 minutes of the last composite sample, unless compositing must occur at another location, in which case the filtration process should occur as soon as possible upon sample compositing.
- 3. Power down autosampler and leave sampling site.
- 4. The composite sample will need to be split into the separate analysis bottles either before being shipped to the laboratory or at the laboratory. This is best done in a clean and weatherproof

environment, using clean sampling technique.

### (v) Dissolved Metals Field Filtration

Samples for dissolved metals can be filtered in the laboratory or the field. In the event samples for dissolved metals are filtered in the field, the following method for dissolved field filtration will be conducted. A 50mL plastic syringe or peristaltic pump with a  $0.45\mu$ m filter attached will be used to collect and filter the dissolved metals sample in the field. The apparatus will either come certified precleaned from the manufacturer and confirmed by the analytical laboratory or be pre-cleaned by and confirmed by the analytical laboratory at least once per year. The apparatus will be double bagged in Ziploc plastic bags. Alternative an equivalent method may be utilized, if necessary.

To collect the sample for dissolved metals, first collect the total metals sample using clean sampling techniques. The dissolved sample will be taken from this container. Immediately prior to collecting the dissolved sample, shake the total metals sample. To collect the dissolved metals sample using clean sampling techniques, remove the syringe from the bag and place the tip of the syringe into the bottle containing the total metals sample and draw up 50 mL of sample into the syringe. Next, remove the filter from the zip-lock bag and screw it tightly into the tip of the syringe. Then put the tip of the syringe with the filter into the clean dissolved metals container and push the sample through the filter taking care not to touch the inside surface of the sample container with the apparatus. The sample volume needs to be a minimum of 20 mL. If the filter becomes clogged prior to generating 20 mL of sample, remove and dispose of the used filter and replace it with a new clean filter (using the clean sampling techniques). Continue to filter the sample. When 20 mL has been collected, cap the sample bottle tightly and store on ice for delivery to the laboratory.

### 2.4.4 Receiving Water Sample Collection

A grab sample is a discrete individual sample. A composite sample is a mixture of samples collected over a period of time either as time or flow weighted. A time-weighted composite is created by mixing multiple aliquots collected at specified time intervals. A flow-weighted composite is created by mixing multiple aliquots collected at equal time intervals but where the volume of the aliquot is based on flow rate. Generally, grab samples will be collected during dry weather and composite samples will be collected during wet weather. Should field crews feel that it is unsafe to collect samples for any reason, the field crews **SHOULD NOT COLLECT** a sample and note on the field log that the sample was not collected, why the sample was not collected, and provide photo documentation, if feasible.

Grab samples will be used for dry weather sampling events, because the composition of the receiving water will change less over time; and thus, the grab sample can sufficiently characterize the receiving water. Grab samples will be collected as described in **Section 2.4.3** of this Attachment. Monitoring site configuration and consideration of safety will dictate grab sample collection technique. The potential exists for monitoring sites to lack discernable flow. The lack of discernable flow may generate unrepresentative data. To address the potential confounding interference that can occur under such conditions, sites sampled should be assessed for the following conditions and sampled or not sampled accordingly:

- Pools of water with no flow or no visible connection to another surface water body should not be sampled. The field log should be completed for non-water quality data (including date and time of visit) and the site condition should be photo-documented.
- Flowing water (i.e., based on visual observations, flow measurements, and a photo-documented assessment of conditions immediately upstream and downstream of the sampling site) site should be sampled.

Wet weather samples will generally be collected as either time- or flow-weighted composites. Grab samples may be utilized to collect wet weather sampling in certain situations, which may include, but are not limited to, situations where it is unsafe to collect composite samples or to perform investigative monitoring where composite sampling or installation of an autosampler may not be warranted.

It is the combined responsibility of all members of the sampling crew to determine if the performance requirements of the specific sampling method have been met, and to collect additional samples if required. If the performance requirements outlined above or documented in sampling protocols are not met, the sample will be re-collected. If contamination of the sample container is suspected, a fresh sample container will be used. The SMB EWMP Group will be contacted if at any time the sampling crew has questions about procedures or issues based on site-specific conditions.

### 2.4.5 Stormwater Outfall Sample Collection

Stormwater outfalls will be monitored with similar methods as discussed in **Section 2.4.4** of this Attachment. Sampling will not be undertaken if the outfalls are not flowing or if conditions exist where the receiving water is back-flowing into the outfall. It is the combined responsibility of all members of the sampling crew to determine if the performance requirements of the specific sampling method have been met, and to collect additional samples if required. If the performance requirements outlined above or documented in sampling protocols are not met, the sample will be re-collected. If contamination of the sample container is suspected, a fresh sample container will be used. The SMB EWMP Group will be contacted if at any time the sampling crew has questions about procedures or issues based on site-specific conditions.

### 2.4.6 Non-Stormwater Outfall Screening Surveys and Sample Collection

The outfall screening process is designed to identify outfalls that have significant non-stormwater (NSW) discharges. The collection of water quality data will support the determination of significant NSW discharges as well as to characterize dry weather loading.

### (i) Preparation for Outfall Surveys

Preparation for outfall surveys includes preparation of field equipment, placing bottle orders, and contacting the necessary personnel regarding site access and schedule. The following steps should be completed two weeks prior to each outfall survey:

- 1. Check weather reports and LACDPW rain gage to ensure that antecedent dry weather conditions are suitable.
- 2. Contact appropriate Flood Maintenance Division personnel from LACDPW to notify them of dates and times of any activities in flood control channels.
- 3. Contact laboratories to order bottles and to coordinate sample pick-ups.
- 4. Confirm scheduled sampling date with field crews.
- 5. Set-up sampling day itinerary including sample drop-offs and pick-ups.
- 6. Compile field equipment.
- 7. Prepare sample labels.
- 8. Prepare event summaries to indicate the type of field measurements, field observations, and samples to be taken at each of the outfalls.
- 9. Prepare COCs.
- 10. Charge the batteries of field tablets (if used).

### (ii) Non-Stormwater Sample Collection

Water quality samples will be collected consistent with the dry weather requirements outlined in the receiving water monitoring section using the direct submersion, intermediate container, shallow sheet flow, or pumping methods described in **Section 2.4.3** of this Attachment.

### 2.4.7 Stormborne Sediment Collection

The Santa Monica Total DDT and PCB TMDL include requirements for sediment analysis to assess the WLA contribution of Total DDT and PCB into Santa Monica Bay. Use of filtration methods in combination with conventional analytical methods requires collection of extremely large volumes of stormwater and challenging filtration processes. Use of conventional analytical methods for analysis of the filtered sediment is then expected to require at least 5 grams of sediment (typically 10 grams is preferred by laboratories) for each analyte (Total DDT and PCBs) in order to achieve detection limits necessary to quantify loads. In addition, the direct impacts of filtering samples with high sediment content are not well understood. Sediment analyses within the SMB EWMP Group area have not been conducted, however, efforts by the City of Los Angeles and Los Angeles County in the Ballona Creek and Marina del Rey watersheds, respectively, have demonstrated the challenges associated with collecting and analyzing suspended sediments. Assuming samples contain sediment at an average TSS concentration of 100 mg/L and that all sediment could be recovered, analyses might require as much as 50 liters for each test method (total of 200 liters). An ongoing special study is underway in Marina del Rey to evaluate various methods for capturing sufficient sediment to conduct analysis. In Ballona Creek, the City of Los Angeles has been successful in collecting sufficient volumes of sediment over the course of a year to conduct the analysis. This allows for the quantification of annual loading; however, it does not allow for an evaluation of concentrations and loads under various storm conditions. Although use of lower sediment volumes may be possible, both detection limits and quality control measures might be impacted. In Ballona Creek, duplicate and quality control analysis have been limited to the available sediment, resulting in situations where either certain target constituents or quality control analysis are not completed.

An alternative approach for assessing the loads of the constituents of interest will be utilized in this CIMP to substantially reduce the amount of sample needing to be handled and potential for introduction of error. This approach will utilize High Resolution Mass Spectrometry (HRMS) to analyze for OC pesticides (USEPA 1699), and PCBs (USEPA 1668). HRMS analyses are quantified by isotope dilution techniques. Analytical performance is measured by analysis of Ongoing Precision and Recovery (OPR) analyses and labeled compound recovery. Conventional methods for analyzing for metals of interest are sufficiently sensitive to assess concentrations on suspended sediments. During the first three years, analyses will be conducted on whole water samples. These test methods provide detection limits that are roughly 100 times more sensitive than conventional analytical methods. In addition, these extremely low detection limits can be achieved with as little as 3-6 liters of stormwater.

Use of this approach is expected to greatly enhance the ability to consistently obtain appropriate samples for measuring and comparing loads of constituents of interest associated with each sampling event. This will assure that all key toxics can be quantified at levels suitable for estimation of mass loads. Due to relatively low levels of sediment in stormwater, efforts in Los Angeles County related to TMDL monitoring of suspended sediments have often led to the need to composite sediments collected over multiple storm events. The approach contained herein provides the opportunity to quantify concentrations, and therefore loads, for each stormwater sampling event.

For purposes of load calculations, it would be assumed that 100% of DDT and PCBs were associated with suspended solids. Separate analyses of TSS would be used to normalize the data. After the first year of monitoring (three storm events) the data will be reevaluated to assess whether continued use of the HRMS approach remains to be beneficial. If deemed necessary, a modified approach will be evaluated for analysis of filtered suspended sediments.

### (i) Sampling Procedures

Stormwater samples will be collected using autosamplers. Based on TSS measurements at the monitoring site RW-SMB-2, in Santa Monica Canyon Channel, use of a TSS concentration of 100 mg/L is expected to provide a conservative basis for estimating reporting limits for DDT and PCBs in suspended sediments based upon 1-liter samples. However, two liters of storm water will be provided for each organic analytical suite for a total of four liters. An accurate measure of suspended sediments is critical to this sampling approach.

Since detection limits will depend upon the concentration of suspended sediment in the sample, the laboratory analyzing the suspended sediment concentrations will be asked to provide a rush analysis to provide information that can be used to direct processing of the samples for the organic compounds. If TSS is less than 150 mg/L, two liters will be extracted for subsequent HRMS analysis. If TSS concentrations are greater than 200 mg/L, the additional liter may be used as a field duplicate for each analysis. A field duplicate from the site will be analyzed if adequate sample volumes are obtained.

### 2.4.8 Bioaccumulation Sample Collection

No Bioaccumulation sampling will be conducted under this program.

### 2.4.9 Trash Monitoring

The SMB EWMP Group members are implementing the Santa Monica Marine Debris TMDLs through the installation of full capture devices. As such, no specific monitoring is required or will be conducted for the Marine Debris TMDLs for these jurisdictions.

### 2.4.10 Plastic Pellet Monitoring

See Attachment A for details on plastic pellet monitoring and reporting requirements.

### 2.4.11 Quality Control Sample Collection

Quality control samples will be collected in conjunction with representative samples to verify data quality. Quality control samples collected in the field will generally be collected in the same manner as environmental samples. Detailed descriptions of quality control samples are presented in **Section 3** of this Attachment.

# Section 3 Quality Assurance/Quality Control

This section describes the quality assurance and quality control requirements and processes. Quality control samples will be collected in conjunction with environmental samples to verify data quality. Quality control samples collected in the field will generally be collected in the same manner as environmental samples. There are no requirements for quality control for field analysis of general parameters (e.g., temperature, pH, conductivity, dissolved oxygen, and pH) outlined in the SWAMP. However, field crews will be required to calibrate equipment as outlined in **Section 2** of this Attachment. **Table C-11** presents the quality assurance parameter addressed by each quality assurance requirement as well as the appropriate corrective action if the acceptance limit is exceeded. Decisions to reject or qualify data will be made by the SMB EWMP Group, based on the evaluation of field and laboratory quality control data, in accordance to procedures outlined in Section 13 of Caltrans document No. CTSW-RT-03-105, *Guidance Manual: Stormwater Monitoring Protocols* included in **Attachment E**.

### Table C-11

Quality Control Sample Type	QA Parameter	Frequency <sup>(1)</sup>	Acceptance Limits	Corrective Action	
Quality Contro	Requirements	s – Field			
Equipment Blanks	Contamination	5% of all samples <sup>(2)</sup>	< MDL	Identify equipment contamination source. Qualify data as needed.	
Field Blank	Contamination	1 per Sampling Event	< MDL	Examine field log. Identify contamination source. Qualify data as needed.	
Field Duplicate	Precision	5% of all samples	RPD < 25% if  Difference  > RL	Reanalyze both samples if possible. Identify variability source. Qualify data as needed.	
Quality Contro	Requirements	- Laboratory			
Method Blank	Contamination	1 per analytical batch	< MDL	Identify contamination source. Reanalyze method blank and all samples in batch. Qualify data as needed.	
Lab Duplicate	Precision	1 per analytical batch	RPD < 25% if  Difference  > RL	Recalibrate and reanalyze.	
	Accuracy	1 per analytical batch	80-120% Recovery for GWQC	Check LCS/CRM recovery. Attempt	
Matrix Spike			75-125% for Metals	to correct matrix problem and reanalyze samples. Qualify data as	
			50-150% Recovery for Pesticides <sup>(3)</sup>	needed.	

RPD < 30% if

Precision

1 per analytical

Matrix Spike

**Quality Control Requirements** 

Check lab duplicate RPD. Attempt

Quality Control Sample Type	QA Parameter	Frequency <sup>(1)</sup>	Acceptance Limits	Corrective Action
Duplicate		batch	Difference  > RL	to correct matrix problem and reanalyze samples. Qualify data as needed.
Laboratory		1 per analytical batch	80-120% Recovery for GWQC	
Control Sample (or CRM or Blank Spike)	Accuracy		75-125% for Metals	Recalibrate and reanalyze LCS/ CRM and samples.
			50-150% Recovery for Pesticides <sup>(3)</sup>	
Blank Spike Duplicate	Precision	1 per analytical batch	RPD < 25% if  Difference  > RL	Check lab duplicate RPD. Attempt to correct matrix problem and reanalyze samples. Qualify data as needed.
Surrogate Spike (Organics Only)	Accuracy	Each environmental and lab QC sample	30-150% Recovery3	Check surrogate recovery in LCS. Attempt to correct matrix problem and reanalyze sample. Qualify data as needed.

MDL = Method Detection Limit RL = Reporting Limit RPD = Relative Percent Difference

LCS = Laboratory Control Sample/Standard CRM = Certified/ Standard Reference Material

GWQC = General Water Quality Constituents

 "Analytical batch" refers to a number of samples (not to exceed 20 environmental samples plus the associated quality control samples) that are similar in matrix type and processed/prepared together under the same conditions and same reagents (equivalent to preparation batch).

2. Equipment blanks will be collected by the field crew before using the equipment to collect sample.

3. Or control limits set at + 3 standard deviations based on actual laboratory data.

### 3.1 QA/QC Requirements and Objectives

### 3.1.1 Comparability

Comparability of the data can be defined as the similarity of data generated by different monitoring programs. For this monitoring program, this objective will be ensured mainly through use of standardized procedures for field measurements, sample collection, sample preparation, laboratory analysis, and site selection; adherence to quality assurance protocols and holding times; and reporting in standard units. Additionally, comparability of analytical data will be addressed through the use of standard operating procedures and extensive analyst training at the analyzing laboratory.

### 3.1.2 Representativeness

Representativeness can be defined as the degree to which the environmental data generated by the monitoring program accurately and precisely represent actual environmental conditions. For the CIMP, this objective will be addressed by the overall design of the program. Representativeness is attained through the selection of sampling locations, methods, and frequencies for each parameter of interest, and by maintaining the integrity of each sample after collection. Sampling locations were chosen that are representative of various areas within the watershed and discharges from the MS4, which will allow for the characterization of the watershed and impacts MS4 discharges may have on water quality.

### 3.1.3 Completeness

Data completeness is a measure of the amount of successfully collected and validated data relative to the amount of data planned to be collected for the project. It is usually expressed as a percentage value. A project objective for percent completeness is typically based on the percentage of the data needed for the program or study to reach valid conclusions.

Because the CIMP is intended to be a long term monitoring program, data that are not successfully collected during a specific sample event will not be recollected at a later date. Rather subsequent events conducted over the course of the monitoring will provide robust data sets to appropriately characterize conditions at individual sampling sites and the watershed in general. For this reason, most of the data planned for collection cannot be considered absolutely critical, and it is difficult to set a meaningful objective for data completeness.

However, some reasonable objectives for data are desirable, if only to measure the effectiveness of the program when conditions allow for the collection of samples (i.e., flow is present). The program goals for data completeness, shown in

**Table C-3**, are based on the planned sampling frequency, SWAMP recommendations, and a subjective determination of the relative importance of the monitoring element within the CIMP. If, however, sampling sites do not allow for the collection of enough samples to provide representative data due to conditions (i.e., no flow) alternate sites will be considered. Data completeness will be evaluated on a yearly basis.

### 3.2 QA/QC Field Procedures

Quality control samples to be prepared in the field will consist of equipment blanks, field blanks, and field duplicates as described below.

### 3.2.1 Equipment Blanks

The purpose of analyzing equipment blanks is to demonstrate that sampling equipment is free from contamination. Equipment blanks will be collected by the analytical laboratory responsible for cleaning equipment and analyzed for relevant pollutants before sending the equipment to the field crew. Equipment blanks will consist of laboratory-prepared blank water (certified to be contaminant-free by the laboratory) processed through the sampling equipment that will be used to collect environmental samples.

The equipment blanks will be analyzed using the same analytical methods specified for environmental samples. If any analytes of interest are detected at levels greater than the MDL, the source(s) of contamination will be identified and eliminated (if possible), the affected batch of equipment will be recleaned, and new equipment blanks will be prepared and analyzed before the equipment is returned to the field crew for use.

### 3.2.2 Field Blanks

The purpose of analyzing field blanks is to demonstrate that sampling procedures do not result in contamination of the environmental samples. Per the Quality Assurance Management Plan for SWAMP (SWRCB, 2008) field blanks are to be collected as follows:

- At a frequency of one per sampling event for the following constituents: trace metals in water (including mercury), VOC samples in water and sediment, DOC samples in water, and bacteria samples.
- Field blanks for other media and analytes should be conducted upon initiation of sampling, and if field blank performance is acceptable (as described in **Table C-11**), further collection and analysis of field blanks for these other media and analytes need only be performed on an asneeded basis, or during field performance audits. An as-needed basis for the SMB EWMP Group CIMP will be annually.

Field blanks will consist of laboratory-prepared blank water (certified to be contaminant-free by the laboratory) processed through the sampling equipment using the same procedures used for environmental samples.

If any analytes of interest are detected at levels greater than the MDL, the source(s) of contamination should be identified and eliminated, if possible. The sampling crew should be notified so that the source of contamination can be identified (if possible) and corrective measures taken prior to the next sampling event.

### 3.2.3 Field Duplicates

The purpose of analyzing field duplicates is to demonstrate the precision of sampling and analytical processes. Field duplicates will be prepared at the rate of 5% of all samples, and analyzed along with the associated environmental samples. Field duplicates will consist of two samples collected simultaneously, to the extent practicable. If the Relative Percent Difference (RPD) of field duplicate results is greater than the percentage stated in **Table C-11** and the absolute difference is greater than the RL, both samples should be reanalyzed, if possible. The sampling crew should be notified so that the source of sampling variability can be identified (if possible) and corrective measures taken prior to the next sampling event.

### 3.3 QA/QC Laboratory Analyses

Quality control samples prepared in the laboratory will consist of method blanks, laboratory duplicates, matrix spikes/duplicates, laboratory control samples (standard reference materials), and toxicity quality controls.

### 3.3.1 Method Blanks

The purpose of analyzing method blanks is to demonstrate that sample preparation and analytical procedures do not result in sample contamination. Method blanks will be prepared and analyzed by the contract laboratory at a rate of at least one for each analytical batch. Method blanks will consist of laboratory-prepared blank water processed along with the batch of environmental samples. If the result for a single method blank is greater than the MDL, or if the average blank concentration plus two standard deviations of three or more blanks is greater than the RL, the source(s) of contamination should be corrected, and the associated samples should be reanalyzed.

### 3.3.2 Laboratory Duplicates

The purpose of analyzing laboratory duplicates is to demonstrate the precision of the sample preparation and analytical methods. Laboratory duplicates will be analyzed at the rate of one pair per sample batch. Laboratory duplicates will consist of duplicate laboratory fortified method blanks. If the RPD for any analyte is greater than the percentage stated in **Table C-11** and the absolute difference between duplicates is greater than the RL, the analytical process is not being performed adequately for that analyte. In this case, the sample batch should be prepared again, and laboratory duplicates should be reanalyzed.

### 3.3.3 Matrix Spikes and Matrix Spike Duplicates

The purpose of analyzing matrix spikes and matrix spike duplicates is to demonstrate the performance of the sample preparation and analytical methods in a particular sample matrix. Matrix spikes and matrix spike duplicates will be analyzed at the rate of one pair per sample batch. Each matrix spike and matrix spike duplicate will consist of an aliquot of laboratory-fortified environmental sample. Spike concentrations should be added at five to ten times the reporting limit for the analyte of interest.

If the matrix spike recovery of any analyte is outside the acceptable range, the results for that analyte have failed to meet acceptance criteria. If recovery of laboratory control samples is acceptable, the analytical process is being performed adequately for that analyte, and the problem is attributable to the sample matrix. An attempt will be made to correct the problem (e.g., by dilution, concentration, etc.), and the samples and matrix spikes will be re-analyzed.

If the matrix spike duplicate RPD for any analyte is outside the acceptable range, the results for that analyte have failed to meet acceptance criteria. If the RPD for laboratory duplicates is acceptable, the analytical process is being performed adequately for that analyte, and the problem is attributable to the

sample matrix. An attempt will be made to correct the problem (e.g., by dilution, concentration, etc.), and the samples and matrix spikes will be re-analyzed.

### 3.3.4 Laboratory Control Samples

The purpose of analyzing laboratory control samples (or a standard reference material) is to demonstrate the accuracy of the sample preparation and analytical methods. Laboratory control samples will be analyzed at the rate of one per sample batch. Laboratory control samples will consist of laboratory fortified method blanks or a standard reference material. If recovery of any analyte is outside the acceptable range, the analytical process is not being performed adequately for that analyte. In this case, the sample batch should be prepared again, and the laboratory control sample should be reanalyzed.

### 3.3.5 Surrogate Spikes

Surrogate recovery results are used to evaluate the accuracy of analytical measurements for organics analyses on a sample-specific basis. A surrogate is a compound (or compounds) added by the laboratory to method blanks, samples, matrix spikes, and matrix spike duplicates prior to sample preparation, as specified in the analytical methodology. Surrogates are generally brominated, fluorinated or isotopically labeled compounds that are not usually present in environmental media. Results are expressed as percent recovery of the surrogate spike. Surrogate spikes are applicable for analysis of PCBs and pesticides.

### 3.3.6 Toxicity Quality Control


For aquatic toxicity tests, the acceptability of test results is determined primarily by performance-based criteria for test organisms, culture and test conditions, and the results of control bioassays. Control bioassays include monthly reference toxicant testing. Test acceptability requirements are documented in the method documents for each bioassay method.


## Section 4 Instrument/Equipment Calibration and Frequency

Frequencies and procedures for calibration of analytical equipment used by each contract laboratory are documented in the QA Manual for each laboratory. Any deficiencies in analytical equipment calibration should be managed in accordance with the QA Manual for each contract laboratory. Any deficiencies that affect analysis of samples submitted through this program must be reported to the SMB EWMP Group. Laboratory QA Manuals are available for review at the analyzing laboratory.

### Attachment D

### Photographic Log

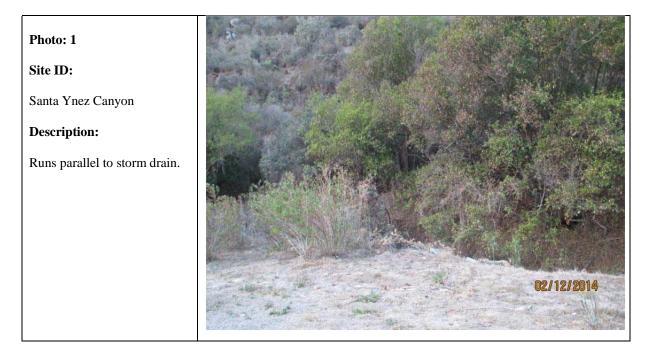

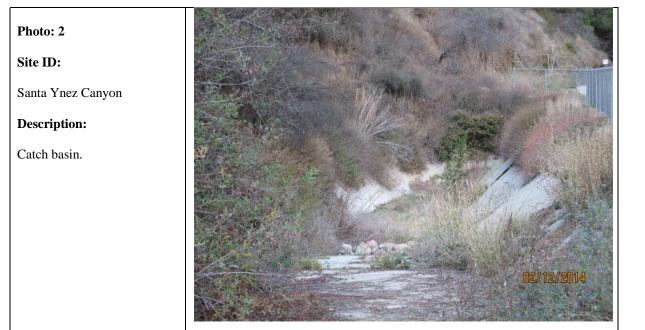

### Site ID:

Sullivan Canyon Creek

### **Description:**

Natural portion of Sullivan Canyon Creek.



### Photo: 4

Site ID:

Sullivan Canyon Creek

### **Description:**

Natural portion of Sullivan Canyon Creek.



### Site ID:

Sullivan Canyon Creek

### **Description:**

Natural portion of Sullivan Canyon Creek. Flows to underground storm drain.



#### Photo: 6

### Site ID:

Sullivan Canyon Creek

### **Description:**

Drain at the end of Sullivan Canyon Creek. Flows to underground storm drain.



### Site ID:

Mandeville Canyon (Storm drain)

### **Description:**

Natural ditch that run parallel to underground storm drain (Mandeville Canyon).



### Photo: 8

Site ID:

Mandeville Canyon (Storm drain)

**Description:** 

Catch basin in natural ditch.



### Site ID:

Mandeville Canyon (Storm drain)

### **Description:**

Upper most area of Mandeville Canyon storm drain entry. Natural flow up gradient.



### Photo: 10

Site ID:

Mandeville Canyon (Storm drain)

### **Description:**

Upper most area of Mandeville Canyon storm drain.



#### Site ID:

Mandeville Canyon Storm Drain

### **Description:**

Outlet of Mandeville Canyon Storm Drain to Santa Monica Canyon Channel.



#### Photo: 12

Site ID:

Sullivan Canyon Storm Drain

#### **Description:**

Outlet of Sullivan Canyon Storm Drain to Santa Monica Canyon Channel.



Site ID:

OF-SMB-2

#### **Description:**

Confluence at Sullivan Canyon and Mandeville Canyon.



#### Photo: 14

Site ID:

Santa Monica Canyon Channel

#### **Description:**

Inlet to Santa Monica Canyon Channel near Riviera Country Club.



#### Site ID:

Rustic Canyon Creek

#### **Description:**

Area of Rustic Canyon that goes from concrete bottom to soft bottom.



#### Photo: 16

Site ID:

Temescal Canyon

#### **Description:**

Temescal Cayon is flows underground from Sunset Boulevard down to PCH.



#### Site ID:

Temescal Canyon

#### **Description:**

LFD for Temescal Canyon is located at Temescal Canyon Rd and and PCH.



#### Photo: 18

#### Site ID:

Temescal Canyon

#### **Description:**

Open/natural creek area at Mountains Recreation Park near the corner of Sunset Boulevard. and Temescal Canyon Road.





Site ID:

Temescal Canyon

**Description:** 

Open/natural creek area.



#### Site ID:

Temescal Canyon

## **Description:**

Inlet location just upstream from Sunset Blvd. with trickle flow down to LFD at PCH.




#### Photo: 22

Site ID:

Temescal Canyon Outfall

**Description:** 

Temescal Canyon outfall downstream of LFD.

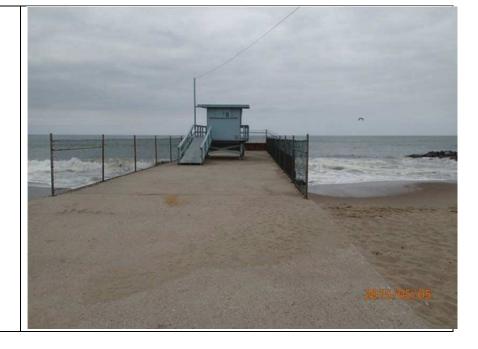

Site ID:

La Pulga Canyon

### **Description:**

The canyon is in private property with no access.



#### Photo: 24

Site ID:

La Pulga Canyon Outfall

**Description:** 

La Pulga Canyon Outfall downstream of LFD.



# Attachment E

Section 13 of Caltrans document No. CTSW-RT-03-105, *Guidance Manual: Stormwater Monitoring Protocols* 

# **SECTION 13** *QA/QC DATA EVALUATION*

All data reported by the analytical laboratory must be carefully reviewed to determine whether the project's data quality acceptability limits or objectives (DQOs) have been met. This section describes a process for evaluation of all laboratory data, including the results of all QA/QC sample analysis.

Before any results are reported by the laboratory, the deliverable requirements should be clearly communicated to the laboratory, as described in the "Laboratory Data Package Deliverables" discussion in *Section 12*.

The current section discusses QA/QC data evaluation in the following two parts:

## KEY TOPICS

# Y Initial Data Quality ScreeningY Data Quality Evaluation

The initial data quality screening identifies problems with laboratory reporting while they may still be corrected. When the data reports are received, they should be immediately checked for conformity to chain of custody requests to ensure that all requested analyses have been reported. The data are then evaluated for conformity to holding time requirements, conformity to reporting limit requests, analytical precision, analytical accuracy, and possible contamination during sampling and analysis. The data evaluation results in rejection, qualification, and narrative discussion of data points or the data as a whole. Qualifications. It is the decision of the data user, based on specifics of the data application, whether or not to include qualified data points.

## Y INITIAL DATA QUALITY SCREENING

The initial screening process identifies and corrects, when possible, inadvertent documentation or process errors introduced by the field crew or the laboratory. The initial data quality control screening should be applied using the following three-step process:

1. Verification check between sampling and analysis plan (SAP), chain of custody forms, and laboratory data reports: Chain of custody records should be compared with field logbooks and laboratory data reports to verify the accuracy of all sample identification and to ensure that all samples submitted for analysis have a value reported for each parameter requested. Any deviation from the SAP that has not yet been documented in the field notes or project records should be recorded and corrected if possible.

Sample representativeness should also be assessed in this step. The minimum acceptable storm capture parameters (number of aliquots and percent storm capture) per amount of rainfall are specified in Section 10. Samples not meeting these criteria are generally not analyzed; however, selected analyses can be run at the Caltrans task manager's discretion. If samples not meeting the minimum sample representativeness criteria are analyzed, the resulting data should be rejected ("R") or qualified as estimated ("J"), depending upon whether the analyses were approved by Caltrans. Grab samples should be taken according to the timing protocols specified in the SAP. Deviations from the protocols will result in the rejection of the data for these samples or qualification of the data as estimated. The decision to reject a sample based on sample representativeness should be made prior to the submission of the sample to the laboratory, to avoid unnecessary analytical costs.

2. *Check of laboratory data report completeness*: As discussed in *Section 12*, the end product of the laboratory analysis is a data report that should include a number of QA/QC results along with the environmental results. QA/QC sample results reported by the lab should include both analyses requested by the field crew (field blanks, field duplicates, lab duplicates and MS/MSD analysis), as well as internal laboratory QA/QC results (method blanks and laboratory control samples).

There are often differences among laboratories in terms of style and format of reporting. Therefore, it is prudent to request in advance that the laboratory conform to the style and format approved by Caltrans as shown in *Section 14*. The Caltrans data reviewer should verify that the laboratory data package includes the following items:

- Y A narrative which outlines any problems, corrections, anomalies, and conclusions.
- Y Sample identification numbers.
- Y Sample extraction and analysis dates.
- Y Reporting limits for all analyses reported.
- Y Results of method blanks.
- Y Results of matrix spike and matrix spike duplicate analyses, including calculation of percent recovered and relative percent differences.
- Y Results of laboratory control sample analyses.
- Y Results of external reference standard analyses.
- Y Surrogate spike and blank spike analysis results for organic constituents.
- Y A summary of acceptable QA/QC criteria (RPD, spike recovery) used by the laboratory.

Items missing from this list should be requested from the laboratory.

3. Check for typographical errors and apparent incongruities: The laboratory reports should be reviewed to identify results that are outside the range of normally observed values. Any type of suspect result or apparent typographical error should be verified with the laboratory. An example of a unique value would be if a dissolved iron concentration has been reported lower than 500  $\mu$ g/L for every storm event monitored at one location and then a value of 2500  $\mu$ g/L is reported in a later event. This reported concentration of 2500  $\mu$ g/L should be verified with the laboratory for correctness.

Besides apparent out-of-range values, the indicators of potential laboratory reporting problems include:

- Significant lack of agreement between analytical results reported for laboratory duplicates or field duplicates.
- Consistent reporting of dissolved metals results higher than total or total recoverable metals.
- Unusual numbers of detected values reported for blank sample analyses.
- Inconsistency in sample identification/labeling.

If the laboratory confirms a problem with the reported concentration, the corrected or recalculated result should be issued in an amended report, or if necessary the sample should be re-analyzed. If laboratory results are changed or other corrections are made by the laboratory, an amended laboratory report should be issued to update the project records.

## Y DATA QUALITY EVALUATION

The data quality evaluation process is structured to provide systematic checks to ensure that the reported data accurately represent the concentrations of constituents actually present in stormwater. Data evaluation can often identify sources of contamination in the sampling and analytical processes, as well as detect deficiencies in the laboratory analyses or errors in data reporting. Data quality evaluation allows monitoring data to be used in the proper context with the appropriate level of confidence.

QA/QC parameters that should be reviewed are classified into the following categories:

- Y Reporting limits
- Y Holding times
- Y Contamination check results (method, field, trip, and equipment blanks)
- Y Precision analysis results (laboratory, field, and matrix spike duplicates)
- Y Accuracy analysis results (matrix spikes, surrogate spikes, laboratory control samples, and external reference standards)

Each of these QA/QC parameters should be compared to data quality acceptability criteria, also known as the project's data quality objectives (DQOs). The key steps that should be adhered to in the analysis of each of these QA/QC parameters are:

- 1. Compile a complete set of the QA/QC results for the parameter being analyzed.
- 2. Compare the laboratory QA/QC results to accepted criteria (DQOs).
- 3. Compile any out-of-range values and report them to the laboratory for verification.
- 4. Prepare a report that tabulates the success rate for each QA/QC parameter analyzed.

This process should be applied to each of the QA/QC parameters as discussed below.

## **Reporting Limits**

Stormwater quality monitoring program DQOs should contain a list of acceptable reporting limits that the lab is contractually obligated to adhere to, except in special cases of insufficient sample volume or matrix interference problems. The reporting limits used should ensure a high probability of detection. Table 12-1 provides recommended reporting limits for selected parameters.

## Holding Times

Holding time represents the elapsed time between sample collection time and sample analysis time. Calculate the elapsed time between the sampling time and start of analysis, and compare this to the required holding time. For composite samples that are collected within 24-hours or less, the time of the final sample aliquot is considered the "sample collection time" for determining sample holding time. For analytes with critical holding times ( $\leq$ 48 hours), composite samples lasting longer than 24-hours require multiple bottle composite samples. Each of these composite samples should represent less than 24 hours of monitored flow, and subsamples from the composites should have been poured off and analyzed by the laboratory for those constituents with critical holding times (*see Section 12*). It is important to review sample holding times to ensure that analyses occurred within the time period that is generally accepted to maintain stable parameter concentrations. Table 12-1 contains the holding times for selected parameters. If holding times are exceeded, inaccurate concentrations or false negative results may be reported. Samples that exceed their holding time prior to analysis are qualified as "estimated", or may be rejected depending on the circumstances.

## Contamination

Blank samples are used to identify the presence and potential source of sample contamination and are typically one of four types:

1. *Method blanks* are prepared and analyzed by the laboratory to identify laboratory contamination.

- 2. *Field blanks* are prepared by the field crew during sampling events and submitted to the laboratory to identify contamination occurring during the collection or the transport of environmental samples.
- 3. *Equipment blanks* are prepared by the field crew or laboratory prior to the monitoring season and used to identify contamination coming from sampling equipment (tubing, pumps, bailers, etc.).
- 4. *Trip blanks* are prepared by the laboratory, carried in the field, and then submitted to the laboratory to identify contamination in the transport and handling of volatile organics samples.
- 5. *Filter blanks* are prepared by field crew or lab technicians performing the sample filtration. Blank water is filtered in the same manner and at the same time as other environmental samples. Filter blanks are used to identify contamination from the filter or filtering process.

If no contamination is present, all blanks should be reported as "not detected" or "nondetect" (e.g., constituent concentrations should not be detected above the reporting limit). Blanks reporting detected concentrations ("hits") should be noted in the written QA/QC data summary prepared by the data reviewer. In the case that the laboratory reports hits on method blanks, a detailed review of raw laboratory data and procedures should be requested from the laboratory to identify any data reporting errors or contamination sources. When other types of blanks are reported above the reporting limit, a similar review should be requested along with a complete review of field procedures and sample handling. Often times it will also be necessary to refer to historical equipment blank results, corresponding method blank results, and field notes to identify contamination sources. This is a corrective and documentative step that should be done as soon as the hits are reported.

If the blank concentration exceeds the laboratory reporting limit, values reported for each associated environmental sample must be evaluated according to USEPA guidelines for data evaluations of organics and metals (USEPA, 1991; USEPA, 1995) as indicated in Table 13-1.

Step	Environmental Sample	Phthalates and other common contaminants	Other Organics	Metals
1.	Sample > 10X blank concentration	No action	No action	No action
2.	Sample < 10X blank concentration	Report associated environmental results as "non- detect" at the reported environmental concentration.	No action	Results considered an "upper limit" of the true concentration (note contamination in data quality evaluation narrative).
3.	Sample < 5X blank concentration	Report associated environmental results as "non- detect" at the reported environmental concentration.	Report associated environmental results as "non- detect" at the reported environmental concentration.	Report associated environmental results as "non- detect" at the reported environmental concentration.

 Table 13-1. USEPA Guidelines for Data Evaluation

Specifically, if the concentration in the environmental sample is less than five times the concentration in the associated blank, the environmental sample result is considered, for reporting purposes, "not-detected" *at the environmental sample result concentration* (phthalate and other common contaminant results are considered non-detect if the environmental sample result is less than ten times the blank concentration). The laboratory reports are not altered in any way. The qualifications resulting from the data evaluation are made to the evaluator's data set for reporting and analysis purposes to account for the apparent contamination problem. For example, if dissolved copper is reported by the laboratory at 4  $\mu$ g/L and an associated blank concentration for dissolved copper is reported at 1  $\mu$ g/L, data qualification would be necessary. In the data reporting field of the database (see *Section 14*), the dissolved copper result would be reported as 4  $\mu$ g/L), the numerical qualifier would be reported as "<", the reporting limit would be left as reported by the laboratory, and the value qualifier would be reported as "U" ("not detected above the reported environmental concentration").

When reported environmental concentrations are greater than five times (ten times for phthalates) the reported blank "hit" concentration, the environmental result is reported unqualified at the laboratory-reported concentration. For example, if dissolved copper is reported at 11  $\mu$ g/L and an associated blank concentration for dissolved copper is reported at 1  $\mu$ g/L, the dissolved copper result would still be reported as 11  $\mu$ g/L.

## Precision

Duplicate samples provide a measure of the data precision (reproducibility) attributable to sampling and analytical procedures. Precision can be calculated as the relative percent difference (RPD) in the following manner:

$$RPD_{i} = \frac{2^{*}|O_{i} - D_{i}|}{(O_{i} + D_{i})} *100\%$$

where:

 $RPD_i$  = Relative percent difference for compound i

 $O_i$  = Value of compound i in original sample

D<sub>i</sub> = Value of compound i in duplicate sample

The resultant RPDs should be compared to the criteria specified in the project's DQOs. The DQO criteria shown in Table 13-2 below are based on the analytical method specifications and laboratory-supplied values. Project-specific DQOs should be developed with consideration to the analytical laboratory, the analytical method specifications, and the project objective. Table 13-2 should be used as a reference point as the least stringent set of DQO criteria for Caltrans monitoring projects.

## Laboratory and Field Duplicates

Laboratory duplicates are samples that are split by the laboratory. Each half of the split sample is then analyzed and reported by the laboratory. A pair of field duplicates is two samples taken at the same time, in the same manner into two unique containers. Subsampling duplicates are two unique, ostensibly identical, samples taken from one composite bottle (see *Section 10*). Laboratory duplicate results provide information regarding the variability inherent in the analytical process, and the reproducibility of analytical results. Field duplicate analysis measures both field and laboratory precision, therefore, it is expected that field duplicates are used as a substitute for field duplicates in some situations and are also an indicator of the variability introduced by the splitting process.

The RPDs resulting from analysis of both laboratory and field duplicates should be reviewed during data evaluation. Deviations from the specified limits, and the effect on reported data, should be noted and commented upon by the data reviewer. Laboratories typically have their own set of maximum allowable RPDs for laboratory duplicates based on their analytical history. In most cases these values are more stringent than those listed in Table 13-2. Note that the laboratory will only apply these maximum allowable RPDs to laboratory duplicates. In most cases field duplicates are submitted "blind" (with pseudonyms) to the laboratory.

Environmental samples associated with laboratory duplicate results greater than the maximum allowable RPD (when the numerical difference is greater than the reporting limit) are qualified as "J" (estimated). When the numerical difference is less than the RL, no qualification is necessary. Field duplicate RPDs are compared against the maximum

allowable RPDs used for laboratory duplicates to identify any pattern of problems with reproducibility of results. Any significant pattern of RPD exceedances for field duplicates should be noted in the data report narrative.

Corrective action should be taken to address field or laboratory procedures that are introducing the imprecision of results. The data reviewer can apply "J" (estimated) qualifiers to any data points if there is clear evidence of a field or laboratory bias issue that is not related to contamination. (Qualification based on contamination is assessed with blank samples.)

Laboratories should provide justification for any laboratory duplicate samples with RPDs greater than the maximum allowable value. In some cases, the laboratory will track and document such exceedances, however; in most cases it is the job of the data reviewer to locate these out-of-range RPDs. When asked to justify excessive RPD values for field duplicates, laboratories most often will cite sample splitting problems in the field. Irregularities should be included in the data reviewer's summary, and the laboratory's response should be retained to document laboratory performance, and to track potential chronic problems with laboratory analysis and reporting.

## Accuracy

Accuracy is defined as the degree of agreement of a measurement to an accepted reference or true value. Accuracy is measured as the percent recovery (%R) of spike compound(s). Percent recovery of spikes is calculated in the following manner:

$$\%$$
R = 100% \* [(C<sub>s</sub> - C) / S]

where:

Accuracy (%R) criteria for spike recoveries should be compared with the limits specified in the project DQOs. A list of typical acceptable recoveries is shown in Table 13-2. As in the case of maximum allowable RPDs, laboratories develop acceptable criteria for an allowable range of recovery percentages that may differ from the values listed in Table 13-2.

Percent recoveries should be reviewed during data evaluation, and deviations from the specified limits should be noted in the data reviewer's summary. Justification for out of range recoveries should be provided by the laboratory along with the laboratory reports, or in response to the data reviewer's summary.

Laboratory Matrix Spike and Matrix Spike Duplicate Samples

Evaluation of analytical accuracy and precision in environmental sample matrices is obtained through the analysis of laboratory matrix spike (MS) and matrix spike duplicate

(MSD) samples. A matrix spike is an environmental sample that is spiked with a known amount of the constituent being analyzed. A percent recovery can be calculated from the results of the spike analysis. A MSD is a duplicate of this analysis that is performed as a check on matrix recovery precision. MS and MSD results are used together to calculate RPD as with the duplicate samples. When MS/MSD results (%R and RPD) are outside the project specifications, as listed in Table 13-2, the associated environmental samples are qualified as "estimates due to matrix interference". Surrogate standards are added to all environmental and QC samples tested by gas chromatograph (GC) or gas chromatography-mass spectrometer (GC-MS). Surrogates are non-target compounds that are analytically similar to the analytes of interest. The surrogate compounds are spiked into the sample prior to the extraction or analysis. Surrogate recoveries will be evaluated with respect to the laboratory acceptance criteria to provide information on the extraction efficiency of every sample.

## External Reference Standards

External reference standards (ERS) are artificial certified standards prepared by an external agency and added to a batch of samples. ERS's are not required for every batch of samples, and are often only run quarterly by laboratories. Some laboratories use ERS's in place of laboratory control spikes with every batch of samples. ERS results are assessed the same as laboratory control spikes for qualification purposes (see below). The external reference standards are evaluated in terms of accuracy, expressed as the percent recovery (comparison of the laboratory results with the certified concentrations). The laboratory should report all out-of-range values along with the environmental sample results. ERS values are qualified as biased high" when the ERS recovery exceeds the acceptable recovery range and "biased low" when the ERS recovery is smaller than the recovery range.


## Laboratory Control Samples

LCS analysis is another batch check of recovery of a known standard solution that is used to assess the accuracy of the entire recovery process. LCSs are much like ERS's except that a certified standard is not necessarily used with LCSs, and the sample is prepared internally by the laboratory so the cost associated with preparing a LCS sample is much lower than the cost of ERS preparation. LCSs are reviewed for percent recovery within control limits provided by the laboratory. LCS out-of-range values are treated in the same manner as ERS out-of-range values. Because LCS and ERS analysis both check the entire recovery process, any irregularity in these results supersedes other accuracyrelated qualification. Data are rejected due to low LCS recoveries when the associated environmental result is below the reporting limit.

A flow chart of the data evaluation process, presented on the following page as Figures 13-1 (lab-initiated QA/QC samples) and 13-2 (field initiated QA/QC), can be used as a general guideline for data evaluation. Boxes shaded black in Figures 13-1 and 13-2 designate final results of the QA/QC evaluation.


Analyte	EPA Method Number or Standard Method	Maximum Allowable RPD	Recovery Upper Limit	Recovery Lower Limit
Conventionals	-	-	-	-
BOD	405.1; SM 5210B	20%	80%	120%
COD	410.1; 410.4; SM 5220C; SM 5220D	20%	80%	120%
Hardness	130.2; 130.1; SM 2340B	20%	80%	120%
рН	150.1	20%	NA	NA
TOC/DOC	415.1	15%	85%	115%
TDS	160.1	20%	80%	120%
TSS	160.2	20%	80%	120%
Turbidity	180.1	20%	NA	NA
Nutrients			1	1
NH3-N	350.2; 350.3	20%	80%	120%
NO3-N	300.0	20%	80%	120%
NO2-N	300.0	20%	80%	120%
NO3/NO2-N	353.2	20%	80%	120%
Р	365.2	20%	80%	120%
Ortho-P	365.2;365.3	20%	80%	120%
TKN	351.3	20%	80%	120%
Metals				
Ag	272.2;200.8	20%	75%	125%
Al	200.9; 200.8	20%	75%	125%
Cd	213.2;200.8	20%	75%	125%
Cr	218.2;200.8	20%	75%	125%
Cu	220.2;200.8	20%	75%	125%
Ni	249.2;200.8	20%	75%	125%
Pb	239.2;200.8	20%	75%	125%
Zn	289.2;200.8	20%	75%	125%
As	206.3;200.8	20%	75%	125%
Fe	200.9; SM 3500-Fe B	20%	75%	125%
Se	200.9; 270.3; 200.8	20%	75%	125%
Hg	1631	21%	79%	121%
<b>Total Petroleum Hy</b>	drocarbons			
TPH (gasoline)		21%	45%	129%
TPH (diesel)	8015b	21%	45%	129%
TPH (motor oil)		21%	45%	129%
Oil & Grease	1664	18%	79%	114%
Pesticides and Her	bicides			
Glyphosate	547	30%	70%	130%
<b>OP</b> Pesticides				
(esp. diazinon	8141; ELISA	25%		
and chlorpyrifos)			see method for constituent specific	
OC Pesticides	8081	25%		
Chlorinated Herbicides	8150; 8151	25%		
Carbamate	8321	25%		
Pesticides				
Miscellaneous Org	anicConstituents	000/ t- 500/	1	
Base/Neutrals	625; 8270	30% to 50%	see method for constituent specific	
and Acids PAHs	0210	(analyte		
PARS	8310 624; 8260	dependent) 20%		
Purgeables				
Halocarbons	601	30%	see method, Table 2	
Purgeable			see method for constituent	
Aromatics	602	20%	specific	
	stituents	2001	75	405
Cyanide	335.2	20%	75	125
Bacteriological	01400045	1	1	1
Fecal Coliform	SM 9221E	-	-	-
Total Coliform	SM 9221B	-	-	-

## Table 13-2. Typical Control Limits for Precision and Accuracy for Analytical Constituents

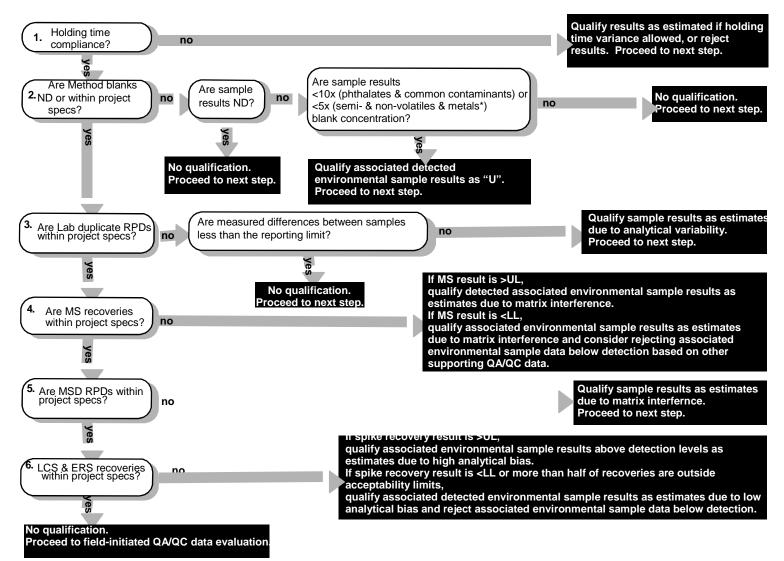

\*Environmental results between 5x and 10x the blank concentration are qualified as "an upper limit on the true concentration" and the data user should be cautioned.

## Figure 13-1. Technical Data Evaluation for Lab-Initiated QA/QC Samples

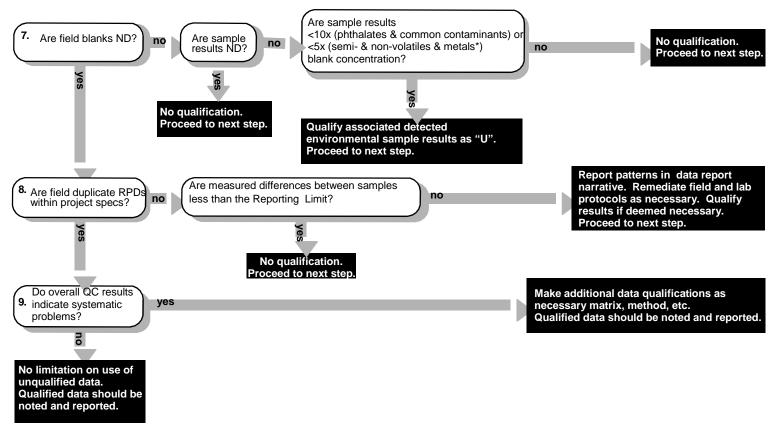

\*Environmental results between 5x and 10x the blank concentration are qualified as "an upper limit on the true concentration" and the data user should be cautioned.

## Figure 13-2. Technical Data Evaluation for Field-Initiated QA/QC Samples

## Attachment F

# Background Information for Santa Monica Bay Debris TMDL TMRP and PMRP Justification

City of El Segundo



City of El Segundo

# **Public Works Department** Stephanie Katsouleas, Director

June 25, 2014

To: Renee Purdy Los Angeles Regional Water Quality Control Board 320 West Fourth Street, Suite 200 Los Angeles, California 90013

#### El Segundo Trash Monitoring and Reporting Plan (TMRP) Submittal

Attached are the City of El Segundo's Trash Monitoring and Reporting Plan and its attachments.

Should you have any questions, please contact me at (310)524-2356 or vial email to skatsouleas@elsegundo.org, or Lifan Xu, of my staff, at (310)524-2368 or via email to lxu@elsegundo.org.

Sincerely

halen

Stephanie Katsouleas Director of Public Works

Cc:

Lifan Xu, Principal Civil Engineer

**Elected Officials:** 

Suzanne Fuentes, Mayor Carl Jacobson, Mayor Pro Tem Dave Atkinson. Council Member Marie Fellhauer, Council Member Michael Dugan, Council Member Tracy Weaver, City Clerk Crista Binder. City Treasurer

#### **Appointed Officials:**

Greg Carpenter, City Manager Mark D. Henslev. City Attorney

**Department Directors:** 

Deborah Cullen, Finance Kevin Smith, Fire Chief Martha Dijkstra, Human Resources Debra Brighton, Library Services Sam Lee, Planning and **Building Safety** Mitch Tavera. Police Chief Stephanie Katsouleas, Public Works Meredith Petit, **Recreation & Parks** 

www.elsegundo.org

Prepared for:

**The City of El Segundo** 350 Main Street El Segundo, CA 90245



# **City of El Segundo**

# **Trash Monitoring and Reporting Plan**

Santa Monica Bay Nearshore and Offshore Debris TMDL

Prepared by:



engineers | scientists | innovators

2100 Main Street, Suite 150 Huntington Beach, CA 92648 Telephone: (714) 969-0800 Fax (714) 969-0820 www.geosyntec.com

Project Number: HSW1404

February 2014



## **TABLE OF CONTENTS**

## Page

1.	INTRODUCTION	. 1
2.	APPROACH FOR ATTAINING TMDL OBJECTIVES	. 1
3.	EXISTING CONTROLS	. 2
4.	IMPLEMENTATION SCHEDULE	. 2
	<ul><li>4.1.1 Trash Baseline Waste Load Allocation</li><li>4.1.2 Proper Operation and Maintenance</li><li>4.1.3 Records and Reporting</li></ul>	. 4
5.	CONCLUSION	

## LIST OF ATTACHMENTS

- Attachment A: Catch Basins & Storm Drains Map
- Attachment B: Zoning Map
- Attachment C: Street Cleaning Routes
- Attachment D: Receptacle Installation Plan



## 1. INTRODUCTION

Santa Monica Bay (SMB) nearshore and offshore areas are on the California 303(d) list as being impaired for debris, DDT and PCBs, sediment toxicity, and fish consumption advisory. Santa Monica Bay beaches are 303(d)-listed as impaired for indicator bacteria. Total Maximum Daily Loads (TMDLs) have been adopted to address each of these impairments. On November 4, 2010 the Los Angeles Regional Water Quality Control Board adopted Resolution R10-010 amending the Water Quality Control Plan for the Los Angeles Region to incorporate a TMDL for Debris for Nearshore and Offshore Santa Monica Bay. Attachment A to R10-010 is the Santa Monica Bay Nearshore and Offshore Debris TMDL. The Nearshore and Offshore Debris TMDL is also addressed by the Municipal Separate Storm Sewer System (MS4) National Pollutant Discharge Elimination System Permit (Permit) for Los Angeles County municipalities (Permittees) (Order No. R4-2012-0175, NPDES No. CAS004001).

The TMDL and Permit assign a Waste Load Allocation (WLA) to the City of El Segundo (City) for trash discharged to Santa Monica Bay through storm drains (i.e., point sources associated with operation of the municipal separate storm sewer system). Table B in Attachment E Part XIX of the Permit describes the Reporting Requirements for Santa Monica Bay WMA TMDLs and provides the implementation schedule for trash from point sources. The first deadline in the implementation schedule is the submission of a Trash Monitoring and Reporting Plan (TMRP) due by the time of submittal of the City's CIMP. This plan is submitted to meet the TMRP requirement as well as to fulfill the requirement for prioritization of full capture system installation.

#### 2. APPROACH FOR ATTAINING TMDL OBJECTIVES

As detailed in Section VI.E.5.b of the Permit, compliance with point source waste load allocations for trash can be demonstrated using four general approaches:

- 1. Full Capture Systems
- 2. Partial Capture Devices and Institutional Controls
- 3. Combined Compliance Approaches
- 4. Minimum Frequency of Assessment and Collection Approach

The City of El Segundo plans to attain the WLAs through installation of full capture systems in accordance with Approach 1 above. The deadline for installation of the first 20% of full capture systems or other measures to attain the WLA is March 20, 2016 [see Attachment M Part B.3 of the Permit]. Each subsequent year, an additional 20% of full capture systems or other measures must be implemented until 100% reduction of trash is achieved eight years from the effective date, or by March 20, 2020 [see Attachment M Part B.3 of the Permit].



## **3. EXISTING CONTROLS**

The City of El Segundo is an area of successful businesses and industry. El Segundo encompasses 5.5 square miles and is located directly south of Los Angeles International Airport. According to the 2010 United States Census, approximately 16,654 people reside in El Segundo. As a coastal city with beach-oriented recreational activities, maintaining high water quality is very important to its residents and City officials.

The City lies within both the Santa Monica Bay and Dominguez Channel Watersheds, as can be seen in the Catch Basins & Storm Drains Map included as Attachment A. The 1,277 acre area within the SMB watershed includes a predominance of residential areas and some commercial and industrial areas. The downtown area is also located within the SMB watershed and is outlined in red on the Zoning Map included as Attachment B. The Chevron Oil Refinery comprises more than one quarter of the land in the City and has its own on-site drainage system which does not discharge to the City's MS4 and is thus excluded from this TMRP.

Although the City of El Segundo intends to rely on certified full capture devices to demonstrate compliance with the Santa Monica Bay Marine Debris TMDL, the City is also implementing institutional source control measures to reduce the generation of trash at the source. The City does not intend to conduct a baseline trash generation study to revise the default Baseline Waste Load Allocation; however the City believes that measures taken to date have reduced the City's trash generation rate below the default baseline.

The City of El Segundo has a rigorous street sweeping program that helps to keep the roads free of trash and debris. The streets are swept once a week in both residential and commercial areas and the downtown area is swept every weekday. All residential areas include signage prohibiting parking on street sweeping days. A map of the weekly street sweeping schedule for areas outside the downtown area is included as Attachment C. Regular street sweeping controls debris at the source and decreases clogging and maintenance needs of catch basins.

The City is currently installing dual trash can and recycling can receptacles along Main Street in the downtown area. In 2013, the City installed and began maintaining 12 new receptacles in the downtown area and plans to install 8 more in the near future. A map of the receptacle installation plan can be seen as Attachment D.

## 4. IMPLEMENTATION SCHEDULE

The City's plan for implementation of full capture systems is to demonstrate compliance with the interim effluent limitations as described in Section VI.E.5.b.i.(1).(c).(ii).1 of the Permit "By demonstrating that full capture systems treat the percentage of drainage areas in the watershed that corresponds to the required trash



abatement." To do this, the City will divide its Santa Monica Bay drainage area into five equal areas and install certified full capture devices in all of the catch basins located within one of those areas each year. Following this plan, 20% of the SMB drainage area will be retrofit by March 20 every year beginning in 2016. Based on this implementation schedule, 100% of the SMB drainage area within the City of El Segundo will be retrofit by March 20, 2020 consistent with the implementation schedule in Attachment M Part B.3 of the Permit.

There are a total of 199 City-owned catch basins and 140 catch basins owned by the Los Angeles County Flood Control District (LACFCD) within the Santa Monica Bay Watershed in the City of El Segundo. It is assumed that full capture system retrofits will be accomplished via individual catch basin retrofits; however the City may revisit this assumption if it determines that installation of end-of-pipe full capture systems such as CDS units represent a more cost-effective option from an operation and maintenance standpoint. An implementation schedule is provided in the following table.

Table 1. City of El Segundo Implementation Schedule for Trash Full Capture Devices Santa Monica Bay Watershed							
Implementation Schedule	Percentage of drainage area with full capture devices	Total acreage with full- capture devices					
March 20, 2016	20%	260					
March 20, 2017	40%	520					
March 20, 2018	60%	770					
March 20, 2019	80%	1,030					
March 20, 2020	100%	1,277					



The TMRP is to include a plan for defining the trash baseline waste load allocation, "proper operation and maintenance" and a proposed definition of a "major rain event."<sup>1</sup>

## **4.1.1** Trash Baseline Waste Load Allocation

Since the City plans to establish compliance with the zero trash WLA through the installation of full capture systems, no direct monitoring of trash accumulation or reduction is required so long as the installation of full capture devices proceeds according to the Implementation Schedule in Attachment M Part B.3 of the Permit. Therefore, the choice of baseline waste load allocation does not have significant bearing on compliance determination. Rather than expending scarce fiscal resources to measure the baseline trash generation rate, the City of El Segundo will elect the default baseline WLA of 2,732 gallons per year for the portion of the City in the Santa Monica Bay Watershed as defined in Attachment M Part B.3 of the Permit.

### **4.1.2** Proper Operation and Maintenance

As stated in Section VI.E.5.b.i.(1).(c) of the Permit, "attainment of the effluent limitations shall be conclusively presumed for any drainage area [...] where certified full capture systems treat all drainage from the area, provided that the full capture systems are adequately sized and maintained, and that maintenance records are up-to-date and available for inspection by the Regional Water Board."

Currently the City of El Segundo cleans all catch basins one to three times per year, depending on priority consistent with Section VI.D.9.h of the Permit. The City plans on maintaining the full-capture devices using the A, B and C priority system specified in the Permit and plans to continue the street sweeping schedule to remove trash and prevent accumulation in the catch basin between rain events. Once catch basins are retrofit with full capture devices, an inspection and maintenance program for these devices will be established. The City will inspect the devices on a regular schedule and also following a major rain event. A major rain event will be defined in accordance with Los Angeles County Flood Control District maintenance standards for full capture devices which at the time of this report was a storm event with an intensity of 1 inch or more of rainfall per 12 hours. Should a full capture device more frequent maintenance.

<sup>&</sup>lt;sup>1</sup> Table 7-34.1 of Attachment A to Los Angeles Regional Water Quality Control Board Resolution No. R10-010, page 14.



## **4.1.3** Records and Reporting


The City will keep up-to-date records evidencing proper maintenance of the full capture systems that will be available for inspection by the Regional Water Board.

The City will submit a TMDL Compliance Report as part of its MS4 Permit Annual Report detailing compliance with the applicable interim and/or final effluent limitations. Included in the report will be information on the number and location of full capture installations, the sizing of each full capture installation, the drainage areas addressed by these instillations, and compliance with the applicable interim or final effluent limitation.


## 5. CONCLUSION

The City will demonstrate compliance with interim and final effluent limitations for MS4 trash discharges to SMB by installing adequately sized and maintained full capture systems certified by the Regional Board Executive Officer. The 1,277 acre City drainage area within the SMB Watershed will be retrofit with full capture systems following the schedule outlined in Table 1, with 100% of the drainage area being retrofit by March 20, 2020. Since the City has chosen to pursue the full capture compliance approach and has submitted a plan to retrofit with full capture devices, the City need not submit the results of trash monitoring and has accepted the default trash generation rate. The City will submit an annual TMDL Compliance Report with the MS4 Permit Annual Report detailing compliance with the SMB Nearshore and Offshore Debris TMDL effluent limitation for trash.

Attachment A: Catch Basins & Storm Drains Map

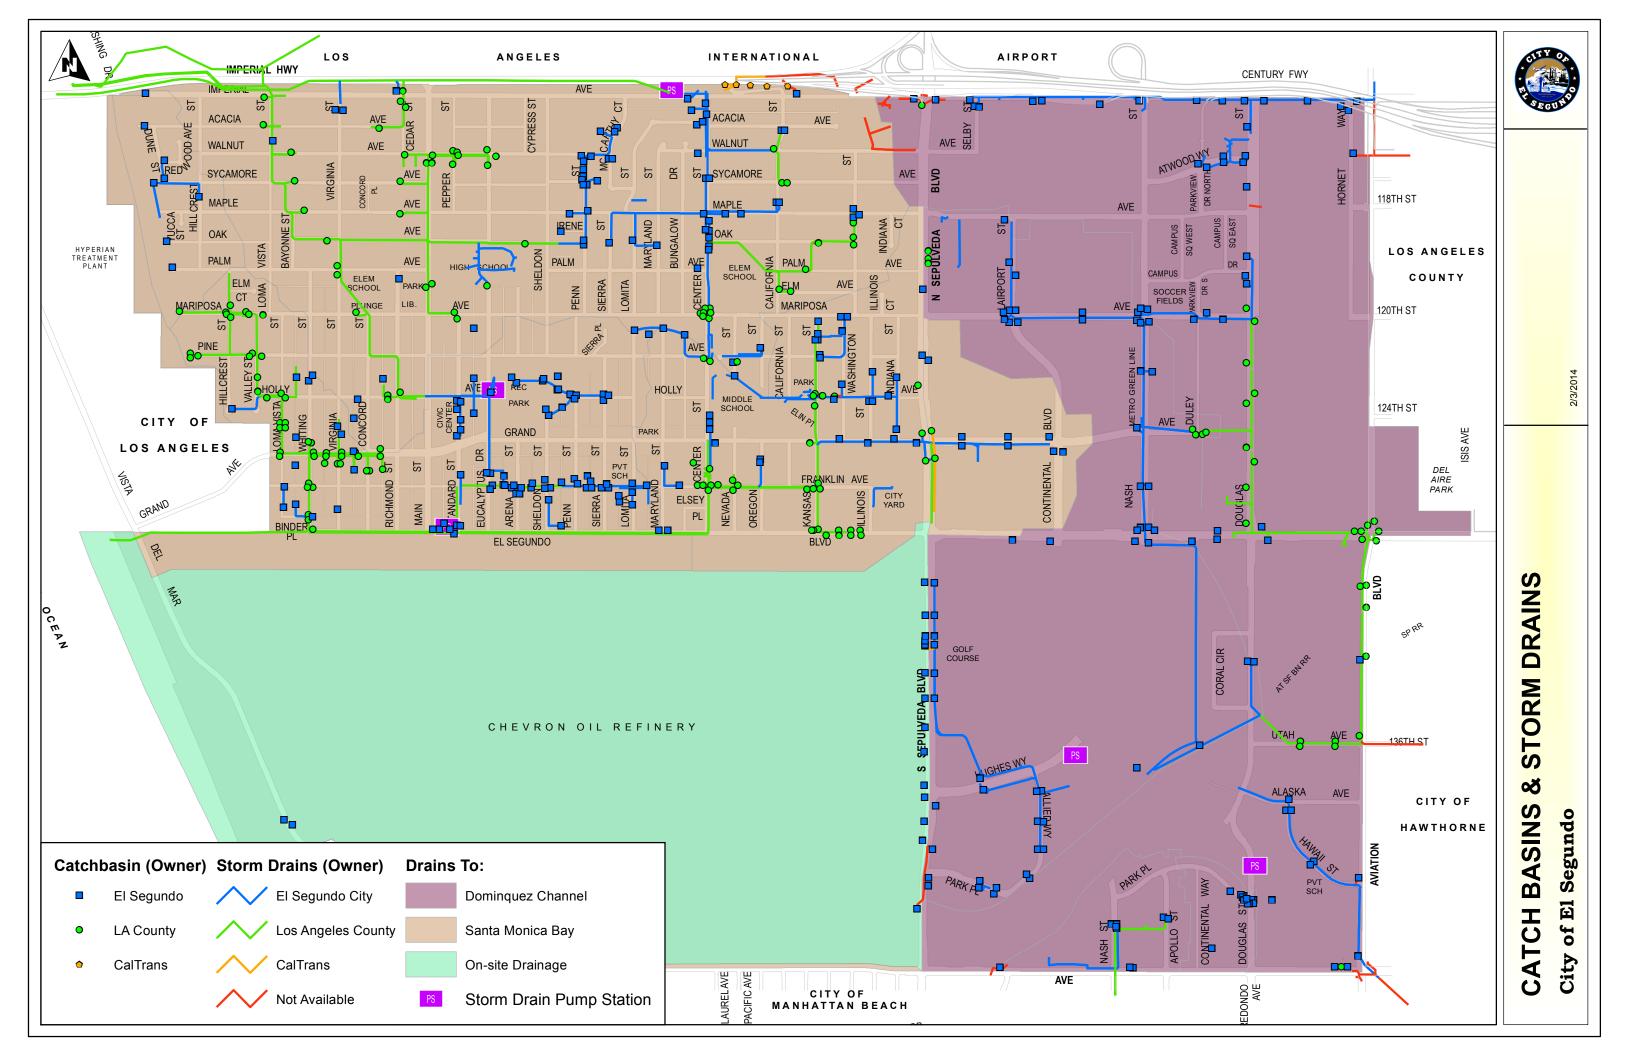


Attachment B: Zoning Map

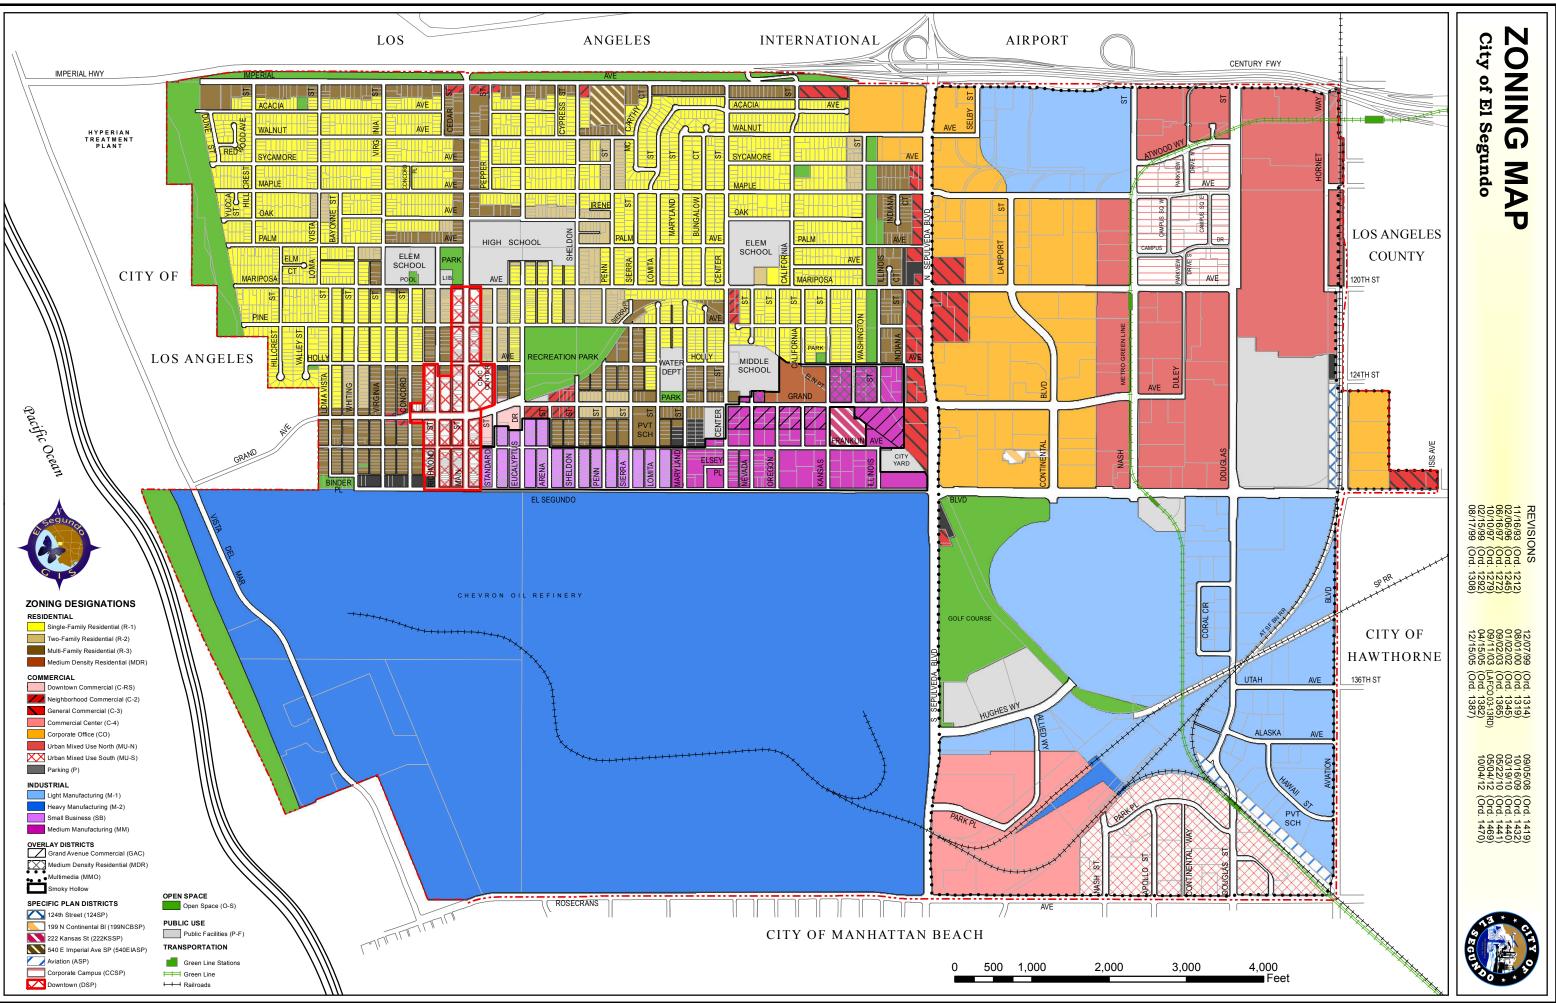

zoning 11x17 Date: 10/4/2012

Attachment C: Street Cleaning Routes

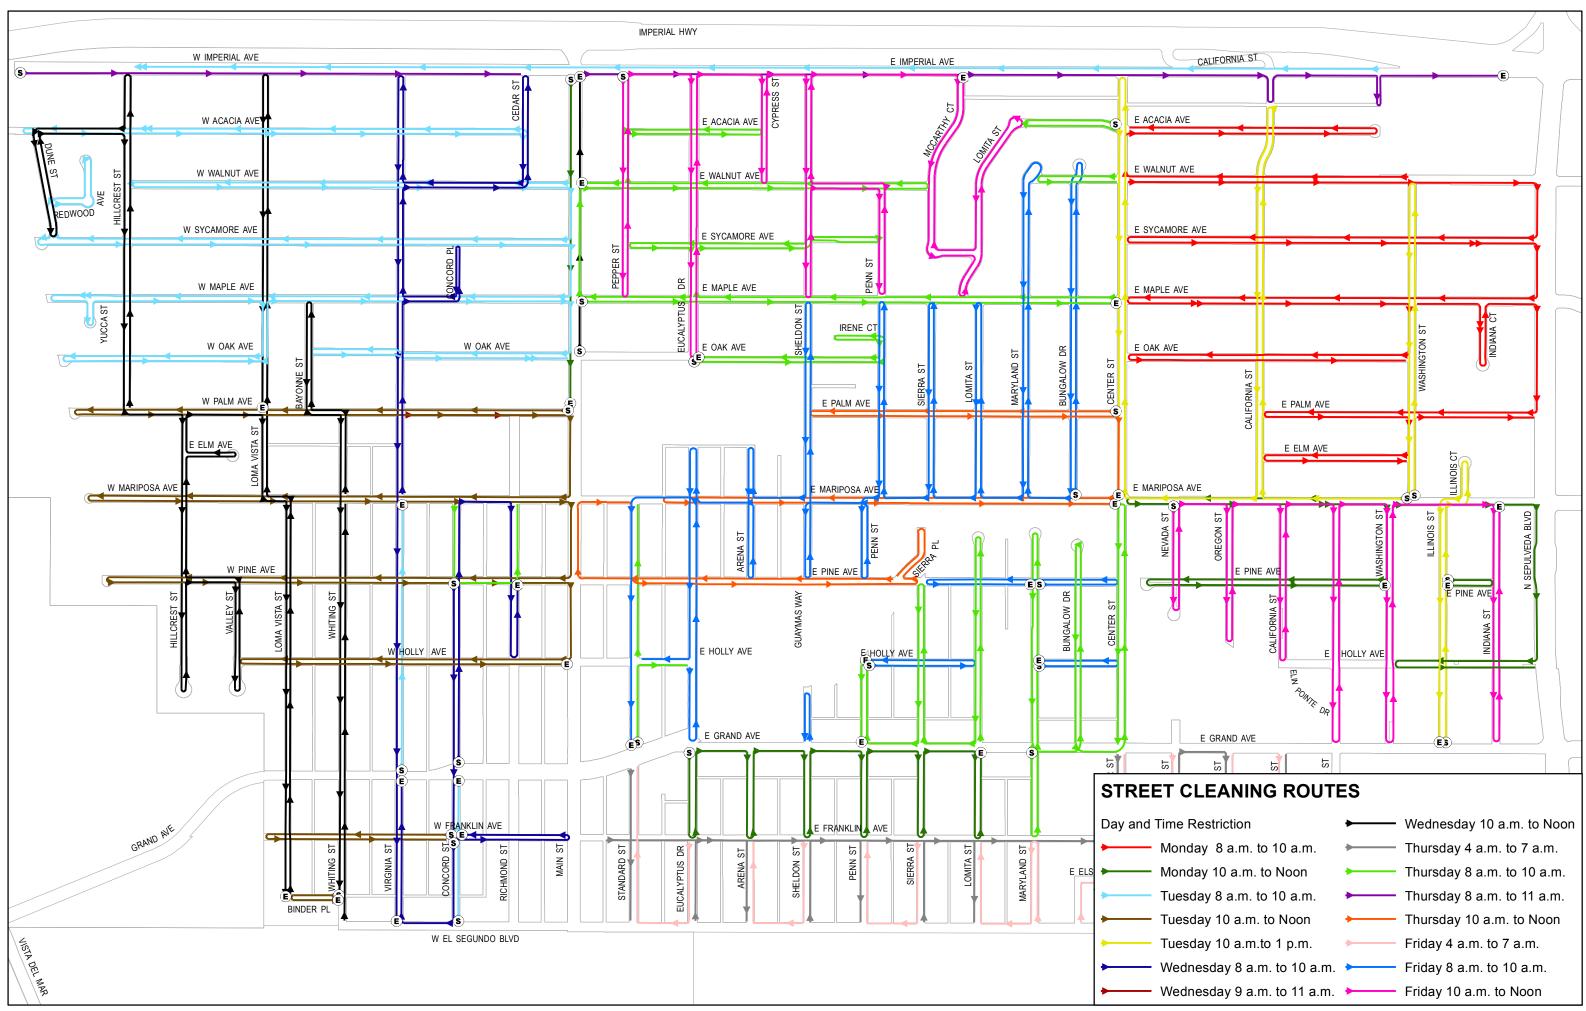

Attachment D: Receptacle Installation Plan





City of El Segundo

# Public Works Department Stephanie Katsouleas, Director

April 29, 2015

#### **Elected Officials:**

Suzanne Fuentes, Mayor Carl Jacobson, Mayor Pro Tem Dave Atkinson, Council Member Marie Fellhauer, Council Member Michael Dugan, Council Member Tracy Weaver, City Clerk Crista Binder, City Treasurer

#### **Appointed Officials:**

Greg Carpenter, City Manager Mark D. Hensley, City Attorney

#### **Department Directors:**

Deborah Cullen, Finance Kevin Smith, Fire Chief Martha Dijkstra, Human Resources Debra Brighton, Library Services Sam Lee, Planning and Building Safety Mitch Tavera, Police Chief Stephanie Katsouleas, Public Works Meredith Petit, Recreation & Parks

www.elsegundo.org

Hamid Tadayon City of Los Angeles Department of Public Works, Bureau of Sanitation Watershed Protection Division 1149 South Broadway, 10th Floor, Los Angeles, CA 90015

#### SUBJECT: Plastic Pellets in City of El Segundo Santa Monica Bay Watershed Area

Mr. Hamid Tadayon:

The City of El Segundo staff has completed its investigation in regards to plastic pellets, and concluded no plastic pellets are currently used, stored, handled or transported in City of El Segundo Santa Monica Bay Watershed Area. Staff looked through the Sic-code sorted database from the City's Business License and Code section, found that only two companies in the Santa Monica Bay Watershed Area with sic codes that could potentially be involved in plastic pellets. One of the companies, Henry Company at 999 N Sepulveda Blvd. Suite 800, El Segundo, CA 90245, is strictly a corporate office. Staff visited and inspected the remaining company, International Plastic Cards, Inc. (IPC) at 1475 E. El Segundo Blvd, El Segundo, CA 90245 and found that there is no manufacturing, storing, handling or transporting of plastic pellets on site. The plastic cards are pre-manufactured and pre-packaged from off-site facility of other companies outside the City, and IPC is only involved in the personalization of the cards such as printing name and card number on the card. See attached inspection form. Therefore, the Plastic Pellet Monitoring and Reporting Plan (PMRP) is not required in City of El Segundo Santa Monica Bay Watershed Area as ascribed under the Santa Monica Bay Nearshore and Offshore Debris TMDL. The only possibility of plastic pellet will come from accidental spills of transportation vehicles passing through the City, and Staff will update the City's Emergency Spill Response Plan to include plastic pellet spill response.

Please include the above finding in the EWMP and let me know if there is any question.

Thank you, mgn

Lifan Xu, P.E. Principal Civil Engineer City of El Segundo 350 Main St. El Segundo, CA 90245-3813

> 350 Main Street, El Segundo, California 90245-3813 Phone (310)524-2300 Fax (310) 640-0489





Public Works Department Stephanie Katsouleas, Director

On Site Plastic Pellets Usage Survey

Name (DBA): NTT DALATICALLE DI ALTIC CARDO LINE	Telephone	
Address / Location:	310-322	-4472
		ED
	PRINT TI	TI E
City EL SEGUNDO Zip 90245 PRINT NAME		4/16/2015
Signature		Date
Contact Name: John Rosso Phone: 310-322-4472 Inspector: Lotan	Xn	
Instructions: Please complete a separate survey form (if necessary, make additional copies are used for production of plastic goods. Check if there is plastic pellets are used, or transfer date, and return this survey form to Public Works, 350 Main St., El Segundo, CA 90245.		
Are plastic pellets used, stored, or transported to or from this facility?	YES 🗌	NO X
If answer "yes" to the above question, please answer the following questions.		
Usage/Operation:		
Amount of plastic pellets used per month / year		Qty.
Is there any waste stream generated that contains plastic pellets	YES	NO 🗌
Storage:		
Is the storage area properly contained	YES 🗌	NO 🗌
Is the facility have proper equipment in work area to clean up incidental spills of plastic pellets	YES 🗌	NO 🗌
Transportation:		
Are plastic pellets kept double bagged and sealed during transportation?	YES 🗌	NO 🗌
	YES 🗌	NO 🗌
General		
Are there any drains near operation, storage or shipping area that is directly leading to the storm drain system?	YES 🗌	NO 🗌
Describe the location of nearest catch basin downstream of the facility		
· · · · · · · · · · · · · · · · · · ·		
Any other Remarks		
All Plastic cards are manufactured offsite by oth	er companie	s. No
manufacturing takes place on-site.		



City of El Segundo

Public Works Department Stephanie Katsouleas, Director

July 30, 2015

#### **Elected Officials:**

Suzanne Fuentes, Mayor Carl Jacobson, Mayor Pro Tem Dave Atkinson, Council Member Marie Fellhauer, Council Member Michael Dugan, Council Member Tracy Weaver, City Clerk Crista Binder, City Treasurer

#### **Appointed Officials:**

Greg Carpenter, City Manager Mark D. Hensley, City Attorney

#### Department Directors:

Misty Cheng, (Interim) Finance Kevin Smith, Fire Chief Martha Dijkstra, Human Resources Debra Brighton, Library Services Sam Lee, Planning and Building Safety Mitch Tavera, Police Chief Stephanie Katsouleas, Public Works Meredith Petit, Recreation & Parks

www.elsegundo.org

Hamid Tadayon City of Los Angeles Department of Public Works, Bureau of Sanitation Watershed Protection Division 1149 South Broadway, 10th Floor, Los Angeles, CA 90015

#### SUBJECT: Response to Santa Monica Bay J2 &3 CIMP comments by Regional Board In Regards to Plastic Pellets in City of El Segundo Santa Monica Bay Watershed Area

Mr. Hamid Tadayon:

As requested by the Los Angeles Regional Water Quality Control Board's July 10, 2015 CIMP conditional approval comment letter, attached are the list of companies in City of El Segundo with SIC codes matching potential plastic pellets facilities, and the City of El Segundo's Emergency Spill Response Plan for Plastic Pellets. As mentioned by previous CIMP submittal letter, no plastic pellets are currently used, stored, handled or transported in City of El Segundo Santa Monica Bay Watershed Area.

Please include this information as part of the Santa Monica Bay J2 &3 Watershed Group's overall response and let me know if there is any question.

Thank you,

- An

Lifan Xu, P.E. Principal Civil Engineer City of El Segundo 350 Main St. El Segundo, CA 90245-3813

> 350 Main Street, El Segundo, California 90245-3813 Phone (310)524-2300 Fax (310) 640-0489

# City of El Segundo, List of Companies with SIC Codes Matching Potential Plastic Pellets Facilities

Name	Address	SIC Code	SIC Code description	Investigation results
Henry Company	999 N. Sepulveda Blvd. Suite 800, El Segundo, CA 90245- 2716	326199	All other plastics product manufacturing.	Office only. No manufacturing, transporting, storing or handling of plastic pellets.
International Plastic Cards, INC.	1475 E. El Segundo Blvd. El Segundo, CA 90245- 4304	326199	All other plastics product manufacturing.	The business involves personalization of cards by using only pre-manufactured plastic cards from offsite. No manufacturing, transporting, storing or handling of plastic pellets.

# CITY OF EL SEGUNDO PLASTIC PELLET SPILL RESPONSE PLAN

July 2015

Prepared for:



City of El Segundo, Department of Public Works 350 Main Street El Segundo, California 90245

Prepared by:



One City Boulevard West, Suite 1800 Orange, California 92868 EEC Project No: W-2677

# INTRODUCTION

# PURPOSE

The City, as a part of the National Pollutant Discharge Elimination System (NPDES) permit for municipal separate storm sewer systems (MS4) discharges, is required to meet certain receiving water quality standards mandated by the state and federal government. One of these standards pertains to numeric targets for trash and other debris being discharged to Santa Monica Bay.

The most recent version of the MS4 permit approved by the Los Angeles Regional Water Quality Board has set very stringent limits on trash and debris in storm water that may be discharged to the Bay, and has established significant fines and other enforcement mechanisms for municipalities that exceed the established numeric discharge limits.

One of the focuses for trash and debris control is plastic pellets. A plastic pellet is the preproduction or raw material that is used to manufacture plastics. Plastic pellets are usually less than 5mm in diameter. The purpose of this procedure is to establish protocols for responding to a spill of plastic pellets within the City.

# NUMERIC TARGET FOR PLASTICS

The numeric target for plastic pellets in the Santa Monica Bay debris Total Maximum Daily Load (TMDL) is zero plastic pellets in Santa Monica Bay. For point source dischargers of plastic pellets, zero plastic pellets is defined as no plastic pellets discharged from the premises of industrial facilities that import, manufacture, process, transport, store, recycle or otherwise handle plastic pellets. Similar to trash, this numeric target supports the designated beneficial water uses.

# EXEMPTIONS

The City of El Segundo does not currently have industrial facilities within their City service area that imports, manufacturers, processes, transports, stores, recycles or otherwise handles plastic pellets or could potentially discharge plastic pellets to the MS4. For this reason, the City is exempt from the monitoring requirements established in the Los Angeles Regional Water Quality Control Board TMDL.

However, there is a possibility of a plastic pellets spill from vehicles passing through the City. For this purpose the City is implementing this emergency response procedure.

# AUTHORITY

- Porter-Cologne Water Quality Control Act Chapter 5.2, Section 13367
- Los Angeles Regional Water Quality Control Board Total Maximum Daily Loads (TMDL)
- State Water Resources Control Board Order No. 2015-0075
- Fish and Game Code (Division 6, Part 1, Chapter 2, Article 1)

# PROCEDURES

When responding to a spill of plastic pellets, the following general procedures should be followed.

- 1st: NOTIFICATION/MOBILIZE TO SITE
- 2nd: CONTAIN THE SPILL
- 3rd: CLEAN UP THE SPILL
- 4th: NOTIFICATION/FOLLOW-UP

# NOTIFICATION/MOBILIZE TO SITE

A plastic pellet spill may be detected by residents, City employees, or by others. The City Wastewater Supervisor is responsible for receiving phone calls from the public of possible pellet spills. The call receiver shall obtain all relevant information available regarding the spill including:

- Time and date call was received;
- Specific location and description of facility;
- Description of problem;
- Time the spill was noticed by the caller;
- Callers name and phone number;
- Observations by the caller (e.g. amount);
- Other relevant information that will enable the responding investigator and crews, if required.

If the wastewater supervisor cannot be reached, dispatch will contact the designated primary on-call employee via phone or pager, who shall immediately respond and evaluate the scene, contact the Wastewater Supervisor and inform him of the pellet spill event. The primary on-call employee shall then call the rest of the on-call crew as needed and they shall report directly to the City Yard. They shall retrieve a City truck with appropriate pellet spill response equipment, and mobilize to the spill location.

The intent is to reduce the response time required to move the necessary equipment and manpower to the spill location and to minimize the spread of the plastic pellets. The Wastewater Supervisor will also respond to the spill site to evaluate the effectiveness of the clean-up and initiate enforcement actions. The table below indicates the staff available to respond to plastic pellet spills.

Title	Phone No.
Wastewater Supervisor	(310) 524-2754
	Cell (310) 877-0676

Wastewater Lead Worker	(310) 877-0675
Wastewater Maintenance Worker II	(310) 343-2605
Wastewater Maintenance Worker II	(310) 877-0731
Wastewater Maintenance Worker I	(310) 524-2801
Wastewater Maintenance Worker I	(323) 714-6447
Sewer Crew Pager	(310) 523-7648

# CONTAIN THE SPILL

Upon arriving at the spill location, the on-call duty wastewater employee shall call the Wastewater Supervisor a second time and report the spill status. He shall then;

- Take immediate action to contain the spill to prevent plastic pellets from entering storm drains, channels or other critical infrastructure.
- Establish perimeters and control zones with cones, barricades, vehicles or terrain. Maintain a "KEEP OUT ZONE" at all times.
- Identify the responsible facility/person responsible for the spill and ensure they are taking proper actions to stop the spill.
- Collect representative photos of the spill location and quantity.

# CLEAN UP THE SPILL

Once the spill of plastic pellets is contained and the spill has stopped, the plastic pellets can be cleaned up. Plastic pellets can be very small in diameter and difficult to identify on concrete or in channels. Extra care should be taken to ensure all areas of the spill location are cleaned thoroughly. Equipment used in cleaning plastic pellet spills includes but are not limited to;

- Brooms/Push brooms
- Dust pans
- Shop vacuums
- Garbage bags

In the event the spill reaches the storm drain system or channel, all reasonable efforts should be made to remove the plastic pellets from the storm drain system. If needed, plug and isolate the affected areas of the storm drain system, and use water to flush out the system. All water used in the cleaning of plastic pellets should be captured are disposed of properly.

# NOTIFICATION / FOLLOW-UP

In the event of a plastic pellet spill, the Regional Board shall be notified by a City representative within 24 hours of the City becoming aware of the spill. Action items to clean-up the spill, sources of the spill, and required follow-up/action items should be reported to the Regional Board at the time of the call.

Depending on the nature of the spill, follow-up actions should be conducted as applicable. Within one month of the spill a follow-up inspection of the facility responsible for the spill or location of the spill should be conducted. If the plastic pellets are not being managed properly during the follow-up inspection, enforcement actions may need to be elevated to include an enforcement letter or financial penalty.

**City of Los Angeles** 

# Santa Monica Bay Near shore and offshore Debris TMDL

# **Plastic pellet**

# **Background**

- Water Code Section 13367 requires RB to implement a program to control point and nonpoint source discharges of preproduction plastic.
- The program must, at a minimum, require plastic manufacturing, handling, and transportation facilities to implement BMP including; appropriate containment systems, sealed containers durable against rupture during transfer and storage; use of capture devices during loading/unloading and transfer; availability of a vacuum system to clean up loose pellets.
- Plastic pellets are harmful to aquatic life, as they easily transported through waterways into the environment. Birds, fishes, and mammals consume these pellets mistakenly as food.
- The regional Board developed and adopted the Santa Monica bay Nearshore and off shore Debris TMDL on November 4, 2010. This TMDL provides the detailed analysis supporting the problem, numerical target for waste load allocation, monitoring and reporting requirements, and the responsible agencies for compliance with this TMDL. The TMDL consists of two parts for trash and plastic pellets discharge into the Santa Monica Bay. This report focuses on the outlines pertaining to plastic pellet discharge control.
- The method of compliance with the plastic pellet waste load allocation assigned to industrial permittees include implementation of BMP such as appropriate containment systems, sealed containers, vacuum system, frequent inspection and cleaning at operation area.

# TMDL - REQUIREMENTS

- Numerical target, Zero plastic pellet in Santa Monica Bay
- Principal source of plastic pellets is point source discharge through storm drains from industries that import, manufacture, process, transports, stores, recycles, or handles plastic pellets. Accidental spill during transfer and transportation also a contributing source.
- Discharge of plastic pellets from storm drains and open channels occurs during or shortly after a main rain event.

- WLA for plastic pellets assigned to permittees of industrial storm water general permit.
- SIC codes associated with industrial operation involving plastic pellets include: 282X, 305X, 308X, 39XX, 25XX, 3261, 3357, 373X, and 2893.
- Zero WLA must be implemented by industries with operation involving plastic pellets.
- Jurisdictional agencies responsible MS4 discharge must either prepare a Plastic Pellet Monitoring and Reporting Plan (PMRP), or demonstrate that a PMRP is not required under the following conditions:
  - Agencies with PP industrial facilities shall prepare a PMRP to i) monitor the amount of PP discharge from the MS4, ii) establish triggers for increased inspection and enforcement of SWPPP requirements ; and iii) address potential PP spill
  - Agencies with no PP industries not required to monitor at MS4, but required to include response plan in PMRP.
  - Agencies with only residential areas and limited commercial or industrial transportation corridors (rail and roadway) may submit in lieu of PMRP submit documentation demonstrating lack of PP sources.
  - The PMRP must include protocols for 24 hour notification of RB by the responsible agency in the event of PP spill and a comprehensive containment plan.

# Monitoring and reporting Plan

- Industries responsible for discharge of PP must enroll with the California State Resources Control Board or apply for a general permit or an individual industrial stormwater permit from RB.
- Industrial Permittees must prepare and keep onsite a SWPPP
- All responsible permittees as defined under Waste Load Allocation are required to prepare and submit annual monitoring reports with monitoring designed to ensure compliance with WLA.
- MS4 permittees must either prepare a PMRP or demonstrate that PMRP is not required under certain conditons as follows:

- Responsible agencies have industrial facilities involved in PP manufacturing, transportation within their jurisdiction must prepare PMRP to: i) monitor the amount of PP discharged from MS4 at critical locations and time at a minimum of once during each dry and wet season; ii) establish triggers for increased industrial facilities inspection and enforcement of SWPPP
- Responsible agencies that have no PP industries may not require to monitoring at MS4, but must require to include a response plan in PMRP.
- A MS4 permittee may in lieu of PMRP demonstrate to RB that it has only residential areas within its jurisdiction with limited commercial or industrial transportation corridors (rail and roadway) such that it is not consider a potential source of PP to SMB.

## **Implementation Schedule**


- Submit within 18 months from the effective date of TMDL (September 2013), a PMRP for:
  - Monitoring plastic pellet discharges from the MS4
  - increased industrial facility inspections and enforcement
  - response to possible plastic pellet spills OR
  - Demonstrate that PMRP is not required
- Implement PMRP 4 years from Effective Date of TMDL (March 2016)
- Submit Results of implementing PMRP Twenty (20) months from receipt of letter of approval from RB
- Within 5 years of effectiveness date of TMDL (March 2017), permittees of industrial storm water NPDES permit (IUs subject to with SIC codes associated with PP), must achieve compliance with Industrial VPDES permit requirements to achieve the plastic pellets WLA

# <u>PMRP</u>

## a) Santa Monica Bay J2/J3

In a preliminary investigation of industries with SIC codes associated with manufacturing or use of plastic pellets within the City of LA, it was found that none is located in the subwatersheds draining into the Santa Monica Bay except for Ballona Creek subwatershed as shown here.

Furthermore, with the exception of Ballona Creek, the land use of all other City's sub-watersheds draining into the Santa Monica Bay from Castle Rock to Dockweiler are residential with limited commercial facilities. Additionally, there is no railways within these subwatersheds, and the only roadway for transportation in the PCH which falls under the Caltrans jurisdiction. As a result, for these sub-watersheds, submittal of residential documents to illustrate the land use in lieu of PMRP and its' requires components will be sufficient. That is, Santa Monica Bay J2/J3 exemption from monitoring.Thus, the focus of PMRP will be on the Ballona Creek subwatershed.

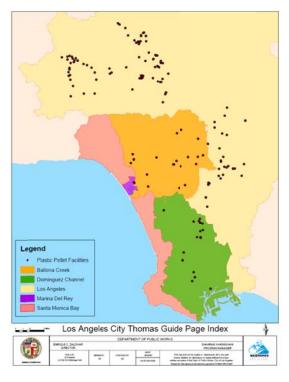

## Facilities Involved in Handling PP

To identify facilities potentially involved in operation, transportation, use, generate or handling plastic pellets The following steps were taken:


- Request was made from Industrial Waste Management Division of the City for a list of all industrial users/permittees that have been assigned at least one of the SIC codes described in the TMDL as follows; 282X, 305X, 308X, 39XX, 25XX, 3261, 3357, 373X, and 2893.
- 2) A list of over 2,200 was provided that included; permit number, name, address, type of facility, and brief description of their operation
- 3) Through a process of elimination the list was narrowed down in a few steps by random calling to those industries that did not seem to be the candidate PP facilities (such as furniture fixture, drapery hardware, burial casket etc.)
- 4) The final list included facilities unit operation such as Plastic Foam product, Laminating Plastic plates, Plastic manufacturing of Synthetic Resins, Children Toy vehicle, and doll manufacturer, etc.

- 5) A final list of approximately 172 was then geocoded on a GIS map that included all City watershed shapfiles.
- 6) 21 were located within the Ballona Creek subwatershed, and 2 in Marina Del Ray.
- 7) A special survey form was prepared and provided to inspection to be completed during site visits of the 23 facilities. Included in the questionnaire was if the facility involved in manufacturing, use, transport, storage or handling of PP. See attachment
- 8) One facility was found to use PP. Teksun Inc. located at 11368 Olympic Blvd, 90064 within the Ballona Creek Watershed. The remaining questionnaire from this facility showed that they use approximately 500 lb/month of PP. The facility has adequate storage area with no drains leading to storm drain, and having proper equipment in work area for cleaning up and sweeping any potential spill. Facility does not ship out PP. Only receives pp in plastic bags for their operation.
- 9) Subsequent to the survey review, a second site visit of Teksun Inc. was conducted by WPD staff to; a) evaluate facility's operation and housekeeping practice; b) to assess the possibility of PP release into the storm drain system in case of accidental spill and to locate the nearest catch basin and point of monitoring. Also visited for potential use of PP was a second facility, Solter plastic located at 12016 Pico Blvd. However, this facility was found to use plastic sheets and not PP. A GIS map showing these facilities orientation with respect to the nearest catch basin as well as the runoff flow direction is attached.
- 10) Teksun Inc. was observed to have a clean operation. The facility's manager and operators were aware of the PP issues of concern. The operational area seemed to be well contained. No PP was observed in the trash bins. The inspection concluded little chance for PP spill. Photos of the facility location, and nearest catch basin is included in the attachment.

# Summary:

- Santa Monica Bay J2/J3 watershed: There is no PP facility on this water shed with little or none chance of transportation of PP through the watershed roadways, thus, exempt from monitoring (PMRP). The City's emergency/spill response plan for hazardous material, however, should include PP.
- Ballona Creek: The required elements of PMRP can be considered for this watershed, including but not limited to increase inspection of Teksun Inc., ensure Teksun is registered with the State, designate a monitoring location during storm events (the catch basin on Purdue May qualify for observation/and or monitoring)

# Attachments

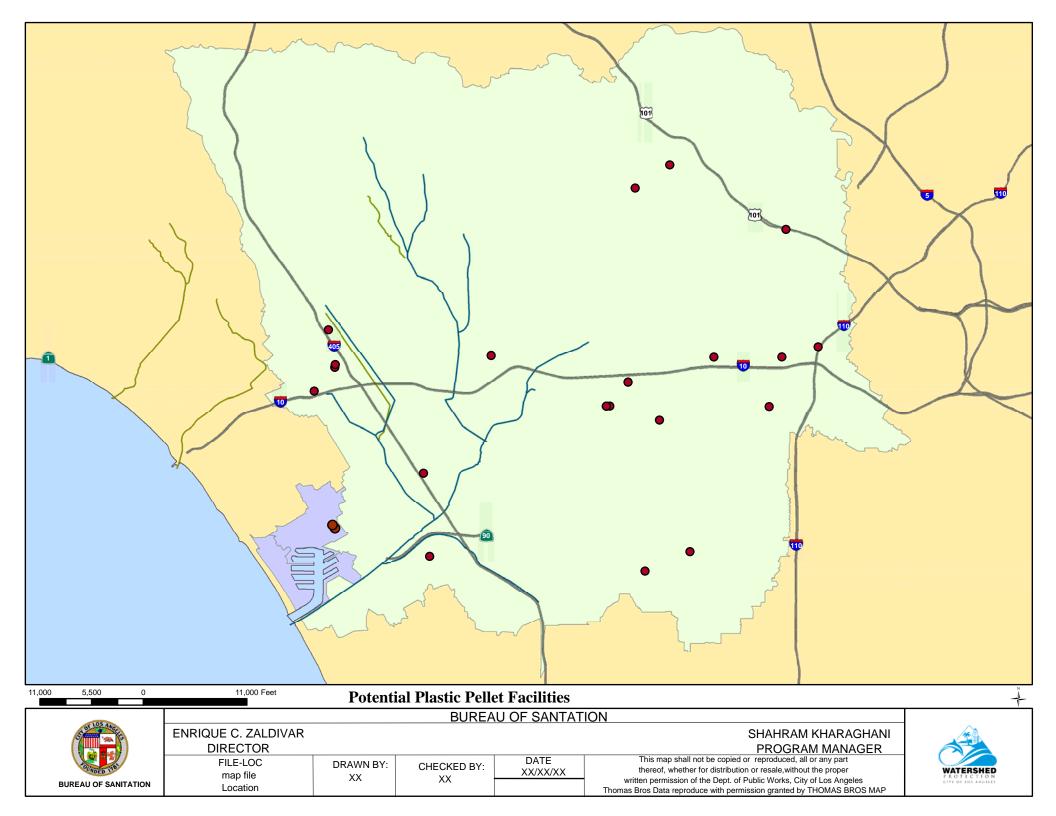

CITY OF LOS ANGELES



# **Watershed Protection**

Division 1149 South Broadway LOS ANGELES, CA 90015 OFFICE: (213) 485-0000 FAX: (213) 485-3939

# ON SITE PLASTIC PELLETS USEGE SURVEY

ina	me (DBA):		reiepnon	e No.:				
Ad	dress / Location:	Authorized Represent	tative / Title:					
Str	eet							
City Zip								
On	y 2ip							
Со	Contact Name: Phone:							
		Inspector:						
are	atructions: Please complete a separate survey form (if necess e used for production of plastic goods. If there is plastic pellets urn this survey form to the Watershed Protection Division.							
	Are plastic pellets used, stored, or transported to or from this f	acility?	YES	NO				
Us	age/Operation:							
	Amount of plastic pellets used per month / year			Qty.				
	Is there any waste stream generated that contains plastic pelle	ets	YES	NO				
Sto	prage:							
	Is the storage area properly contained		YES	NO				
	Is the facility have proper equipment in work area to clean up i plastic pellets	incidental spills of	YES	NO				
Tra	ansportation:							
	Are plastic pellets kept double bagged and sealed during trans	sportation?	YES	NO				
			YES	NO				
Ge	neral							
	Are there any drains near operation, storage or shipping area that is directly leading YES NO to the storm drain system?							
	Describe the location of nearest catch basin downstream of the facility							
Ar	ny other Remarks							

						· · · · · · · · · · · · · · · · · · ·	
Legend		$\lambda$			<b>`</b>		
Facilities wi	ith DD			11		5191361111002 51913461111004	
			11 1/2		χ.		\\~ \\
• Nearest CB	downstream of PP facil		11				
		N	Nº 4			~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~	
1K			× 11			1,	
11		N Z			$\sim$	11	
N 2		1				1	
1 N N	シング						/
()	1 N					Y	
					1×		
	1				J.	X	
N N					X		G - 71
/					$\langle \chi \rangle$	/ _	-71
V	11	~~~					
		/	L		-15		
1,	\	v 1		1			
-	-	-	4	17			
		-		JK.	~	· / N	
		-11 -		=, ٢ >			
	-15	- 11	-	j j		$\rightarrow$ 1	
	- , -	-			1		
	- 75		N		~\{	N / / X	ZE
	!!		11		F		4
11	16 54			=\	$\langle \rangle$	/	
×4		•		~\{			
×	$\langle$	Y	1				
NI.		61111117	1				
$\rightarrow$	Solter Plastic	6461111120	~ ~ ~ ``			-	
480 240 0	480 Feet	Potent	ial Plastic Pelle	Facilities		,	<u> </u>
		I Otent		J OF SANTATIO	N		 
ST COLORADO	ENRIQUE C. ZALDIVAR			· · · ·		SHAHRAM KHARAGH	
	DIRECTOR FILE-LOC	DRAWN BY:	CHECKED BY:	DATE		PROGRAM MANAG ot be copied or reproduced, all or any part	
BUREAU OF SANITATION	map file Location	XX	XX -	XX/XX/XX	written permission of	for distribution or resale, without the proper the Dept. of Public Works, City of Los Angeles	WATERSHED PROTECTION CITY OF 105 ANGLES
	Location				I homas Bros Data reprodu	ice with permission granted by THOMAS BROS	МАР


# **Teksun Facility**



Facility's front door on Olympic

- No Possible discharge/release of PP through the front Door
- Operation area towards the back door

• In the event of incidental spill (minute chance), the run off would have to travel down the alley, turn south into Purdue Street travel over a block to enter the nearest catch basin The catch basin configuration would not accommodate for installation of filters.

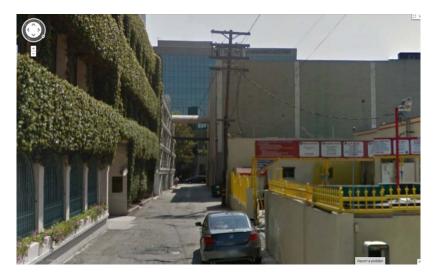

Facility's back door on the alley behind Olympic



Nearest Catch basin on Purdue St. One and half block away

#### CITY OF LOS ANGELES PLASTIC PELLETS FACILITIES

Control         Control <t< th=""><th></th><th></th><th></th><th></th><th></th><th></th><th></th></t<>							
Automatical         Direction         Database         Database         Direction         Direction <thdirection< th=""> <thdirection< th=""> <thd< td=""><td></td><td></td><td>-</td><td></td><td></td><td></td><td></td></thd<></thdirection<></thdirection<>			-				
James Program         PRO 1         Display         Display         Display         Display         PRO 1         PRO 1<					,		, , , , , , , , , , , , , , , , , , ,
Name         Name <th< td=""><td></td><td></td><td></td><td></td><td>,</td><td></td><td></td></th<>					,		
Construct         Biol (M. 2000)         Construct         Disc (M. 2000)         Disc (M. 2000) <thdisc (m.="" 2000)<="" th=""> <thdisc (m.="" 2000)<="" th=""></thdisc></thdisc>	Western States Packaging Inc	21341 Lassen Street	Chatsworth	91311	WPIMS Facility	2673	Plastics, Foil, and Coated Paper Bags
Company Control         Display Bandy         Structure		,			,		
Main Construction         Design Construction         Design Construction         Design Construction         Design Construction           Main Construction         Design Construction         Design Construction         Design Construction         Design Construction           Design Construction         Design Construction         Design Construction         Design Construction         Design Construction           Design Construction         Design Construction         Design Construction         Design Construction         Design Construction           Design Construction         Design Construction         Design Construction         Design Construction         Design Construction           Construction         Design Construction         Design Construction         Design Construction         Design Construction           Construction         Design Construction         Design Construction         Design Construction         Design Construction           Construction         Design Construction         Design Construction         Design Construction         Design Construction           Construction         Design Construction         Design Construction         Design Construction         Design Construction           Construction         Design Construction         Design Construction         Design Construction         Design Construction           Construction	Compotite Corp	355 Glendale Boulevard	Los Angeles	90026	WPIMS Facility	3081	Unsupported Plastics Film & Sheet
Same Data Links         Same Data			, in the second s				
Part Department         Part Depar	Foamed Plastics Unlimited	10611 Burbank Boulevard	North Hollywood	91601	WPIMS Facility	3086	Plastics Foam Products
B, J.C., Martin, M. J., Mart			·		· · · · · · · · · · · · · · · · · · ·		
SD 155 (1)         OTH         Description         DOID         Particle Rest           SD 155 (1)         OTH         Description         DOID         Particle Rest           SD 155 (1)         OTH         Description         DOID         Particle Rest           OPEN PERFORMENT         OTH         Description         DOID         Particle Rest           OPEN PERFORMENT         DESCRIPTION         DESCRIPTION         DESCRIPTION         DESCRIPTION           OPEN PERFORMENT         DESCRIPTION         DESCRIPION         DESCRIPION         D	Life Like Products	2340 E 52nd Street	Los Angeles	90058	WPIMS Facility	3086	Plastics Foam Products
Core and second 201         Core and second 201 <thcore 201<="" and="" second="" th="">         Core and second 201</thcore>							
Example Lisence Lisence         Solar Monte Server         So	Cardservice International	21243 Ventura Boulevard # 201	Woodland Hills	91364	WPIMS Facility	3081	Unsupported Plastics Film & Sheet
Description         Description <thdescription< th=""> <thdescription< th=""></thdescription<></thdescription<>			•		· · ·		
No. Registering         Mol. Land. Acta.         Mol. Applies         Biol. Diff. Science         Diff. Diff. Diff. Science         Diff. Diff. Diff. Diff. Science         Diff. Dif	Wholesale Plastic Enterprises	1955 Blake Avenue # H	Los Angeles	90039	WPIMS Facility	3089	Plastics Products, N.E.C.
Variely consistent party         10 A 10 boot libed         U. A Jogen         Variely consistent of the second of the s			-		,		
Sonk Land         Sonk Land         Conduct         Sonk Land	Mony's International Imports	315 N Hoover Street	Los Angeles	90004	WPIMS Facility	3089	Plastics Products, N.E.C.
Date France         Bill W Allers Rescal         Date State         With Frank State         Person         Person Park Rescal         Person Park Rescal <t< td=""><td></td><td></td><td>, in the second s</td><td></td><td></td><td></td><td></td></t<>			, in the second s				
Singel Antion         Die Verstein Bussen	Quality Plasticraft	4568 W Adams Boulevard	Los Angeles	90016	WPIMS Facility	3089	Plastics Products, N.E.C.
Black Zend DD         CH 11         Black Zend DD         Col 7         Black Zend DD			, in the second s				
Distriction         Use [proved beach         Data / Marcel         Disc.         Distriction         Distriction         Distriction           Distriction         Size [proved beach         Size [proved beach         Distriction         Distriction         Distriction         Distriction           Distriction         Distriction         Distriction         Distriction         Distriction         Distriction         Distriction           Distriction <tddistriction< td="">         Distriction         District</tddistriction<>	Nathan Kimmel Co	1213 S Santa Fe Avenue	Los Angeles	90021	WPIMS Facility	3089	Plastics Products, N.E.C.
Ball Angeler         Ball Angeler         Die Angeler <thdie angeler<="" th=""> <thdie angeler<="" th=""></thdie></thdie>			U U				
Barnase Result         Phill Y Bac France. Neurope         Dot State Stream         Phile Fundy         Phile Fundy <t< td=""><td>Dial Safety Ladder</td><td>3616 Noakes Street</td><td>Los Angeles</td><td>90023</td><td>WPIMS Facility</td><td>3089</td><td>Plastics Products, N.E.C.</td></t<>	Dial Safety Ladder	3616 Noakes Street	Los Angeles	90023	WPIMS Facility	3089	Plastics Products, N.E.C.
Car AD, Wayn         1051         Description         Nume         1050         Phile Frequency Control         1050         Phile Structure Contro         1050         Phile Str			, in the second s				,
II B Egradors (C         1980         1980         Paster Probability (C         1980 <td>Cal Am Mfg Inc</td> <td>13581 Desmond Street</td> <td>Pacoima</td> <td>91331</td> <td>WPIMS Facility</td> <td>3089</td> <td>Plastics Products, N.E.C.</td>	Cal Am Mfg Inc	13581 Desmond Street	Pacoima	91331	WPIMS Facility	3089	Plastics Products, N.E.C.
Numb         Particip         Particip <th< td=""><td></td><td></td><td></td><td></td><td></td><td></td><td></td></th<>							
Tartes Seem         Hill B. Soreeu Aroug         Part Partial         PARS         PARS        PARS	Phillips Plywood Co Inc	13599 Desmond Street	Pacoima	91331	WPIMS Facility	3089	Plastics Products, N.E.C.
L & Secon         1978         Pool & Model         Port         PDIA         PDIA <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td>,</td>							,
Finder Meinie Meine         Umark Parking         Um	C & G Mercury Plastics	12729 Foothill Boulevard	Sylmar	91342	WPIMS Facility	3089	Plastics Products, N.E.C.
Path Funda         Digits         Digits <thdigits< th=""> <thdigits< th=""> <thdigits< td=""><td></td><td></td><td></td><td></td><td></td><td></td><td>,</td></thdigits<></thdigits<></thdigits<>							,
Name, Matri         TOD/T         Tarking Servert         Data Tarking         Particle         Particle </td <td>Pacific Plastics Design Inc</td> <td>15570 Roxford Street</td> <td></td> <td>91342</td> <td>WPIMS Facility</td> <td>3089</td> <td>Plastics Products, N.E.C.</td>	Pacific Plastics Design Inc	15570 Roxford Street		91342	WPIMS Facility	3089	Plastics Products, N.E.C.
Clink F. Neues Statu         Statu         PHSS         PHRSS         PHRSS <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td>							
Finance         Tools         Sear Frances Notal         Sear Value         P1020         VPR08 Frainly         State         Personal Processing Notal           Link Log         1000         Personal Processing Notal         Personal Processing Notal         Personal Processing Notal           Link Log         1000         Personal Processing Notal         Personal Processing Notal         Personal Processing Notal           Link Log         Sear Value         Sear Value         Personal Processing Notal         Personal Processing Notal           Link Log         Sear Value         Sear Value         Personal Processing Notal         Personal Processing Notal           Link Log         Sear Value         Sear Value         Personal Processing Notal         Personal Processing Notal         Personal Processing Notal           Link Log         Sear Value         Personal Processing Notal         Personal Processing Notal         Personal Processing Notal         Personal Processing Notal         Personal Processing Notal Processing Not	Circle K Plastics	11345 Penrose Street	Sun Valley	91352	WPIMS Facility	3089	Plastics Products, N.E.C.
Inter Comp         1107         Status Barbon         Status         PRR05         Name         PRR05         Name         PRR05	0				· · · · · · · · · · · · · · · · · · ·		
Date Taxing         BOD Tuping Annual         Sim Vatery         FITTEZ         PRIVATE         Private Products, N.E.C.           Min & Seergin Annuals         FTTEZ         Sim Vatery         FTTEZ         Private Products, N.E.C.           Reparation         PTTEZ         Sim Vatery         PTTEZ         PTTEZ         PTTEZ           Reparation         PTTEZ         PTT	Eltec Corp	11871 Sheldon Street			WPIMS Facility		
Mith By Allowyne, Berner, Britton, Stander, Brunder, M. C.         PRIND			,				
Biguins         OPD         Genome         Biguins         Derivation         Derivation <thderivation< th=""> <thderivation< th=""> <t< td=""><td>Mdi Mfg &amp; Design Inc</td><td></td><td>Sun Valley</td><td></td><td></td><td>3089</td><td>,</td></t<></thderivation<></thderivation<>	Mdi Mfg & Design Inc		Sun Valley			3089	,
Bibles         Bible         Generals Boulement         Sim Valley         19182         Winds Tauto         Diffe         Particle					· · ·		
Mate Paties Pranting         (126. District Stretch         Year Ny A         9100         PMRS Faulty         B00         Paties Products, N.E.C.           Constructioner         Editat Antonico, N.J.         Add Paties Constructions         Add Paties Products, N.E.C.           Add Paties Design         10999. Revolution Data of 100         North Holywood         9100.         PMRS Faulty, N.S.         Add Paties Products, N.E.C.           Add Paties Design         700.         Faults Antonico, N.E.C.         Add Paties Products, N.E.C.           Add Paties Design         700.         Faults Antonico, N.E.C.         Add Paties Products, N.E.C.           Add Paties Design         700.         Faults Antonico, N.E.C.         Add Paties Products, N.E.C.           Add Paties Products         700.         Faults Antonico, N.E.C.         Add Paties Products, N.E.C.           Chard Spaties         Transies         North Holywood         9000.         Paties Products, N.E.C.           Chard Spaties         Transies         North Holywood         9000.         Paties Products, N.E.C.           Paties Products         Transies         North Holywood         9000.         Paties Products, N.E.C.           Paties Products         Transies         North Holywood         9000.         Paties Products, N.E.C.           Paties Products, N.E.C.	Rubser						,
LEADS Energines (IDC)         SSR         Restart Answers         Partoria City.         914028         Philes Parton         SSR         Restart Answers         Restart Parton           Astrates Discolution         7000         Number Answers					,		
Ask Präser Designs         10688         Neusing Encorring         3069         Phesics Products, N.E.C.           Askan Encorring         20160         VPMAS Facily         3069         Phesics Products, N.E.C.           Califier Packat         1245         Version Packat         3069         Phesics Products, N.E.C.           Califier Packat         1245         Version Packat         3069         Phesics Products, N.E.C.           Califier Packat         1245         Version Packat         3069         Phesics Products, N.E.C.           Califier Packat         1245         Version Packat         3069         Phesics Products, N.E.C.           Califier Packat         1245         Version Packat         3069         Phesics Products, N.E.C.           Fination Packat         1666         Facratis Association Packat         3060         Phesics Products, N.E.C.           Fination Packat         1666         Facratis Association Packat         3060         Phesics Products, N.E.C.           Standard         175         Version Packat         40600         19605         19605         Phesics Packat, N.E.C.           Standard         175         Version Packat, N.E.C.         3060         Phesics Packat, N.E.C.           Standard         175         Version Packat, N.E.C. <td< td=""><td></td><td></td><td>,</td><td></td><td></td><td></td><td></td></td<>			,				
Access Theorem         TSD         Nail Answire # 12         Note NetWork         Periods         Departs         Depar							
Coldian Peaka         1946         Janosen Stream         North Holyacud         91605         PMINS Facility         2009         Peaka Products, N.R. C.           Clan Speaka         12430         Myandmin Streat         North Holyacud         91055         70005         70005         70005         70005         70007					,		
California Planton         T246         Ability Marcels Stream         North Holywood         91803         IVMMS Facility         3089         Plants: Products, N.E.C.           Collins Products         13112         Sellony Stream         North Holywood         91803         IVMMS Facility         3089         Plants: Products, N.E.C.           Sellons Products         13112         Sellony Stream         North Holywood         91803         IVMMS Facility         3089         Plants: Products, N.E.C.           Sellons Products         13112         Sellony Stream         North Holywood         91803         IVMMS Facility         3089         Plants: Products, N.E.C.           Streptister         T155         Weintern Monte         North Holywood         91803         IVMMS Facility         3089         Plants: Products, N.E.C.           Streptister         Torrano         99101         IVMMS Facility         3089         Plants: Products, N.E.C.           Streptister         Torrano         99101         IVMMS Facility         3089         Plants: Products, N.E.C.           Planton         Streptister         Torrano         99101         IVMMS Facility         3089         Plants: Products, N.E.C.           Planton         Streptister         Torrano         991011         IVMMS Facility							
Colins Products         1912         Staticy Stream         Number of Mark Holywood         91050         Personal Practics         E.C.           Plank Ending         761         Find Accine 34         North Holywood         91050         Plank Scaling         3030         Planks Products, N.E.C.           Plank Form Inc.         6265         Find Accine 34         North Holywood         91050         Planks Products, N.E.C.           Strephan         7105         Viralina Accine 34         North Holywood         91050         Planks Products, N.E.C.           Strephan         7155         Viralina Accine 34         North Holywood         91050         Wiralina Scalina         9200         Planks Products, N.E.C.           Strephan         7155         Viralina Accine 34         90011         Wiralina Scalina         92001         92001         Wiralina Scalina         92001         Wiralina         92001         Wiralina         9200         Planks Products, N.E.C.							
Flax Maxing         731         Ethic Jonus         9416         Provider, Microward         9416         Provider, Microward         State         Communication         9416         Provider, Microward         Provider, M					,		,
Drames tribunational Plastics         11125         Vancown Siteet         North Hollywood         91605         WPMB Facility         3089         Plastics Products. N.E.C.           Superjest         7155         Verlain A Verluia         North Hollywood         91605         WPMB Facility         3089         Plastics Products. N.E.C.           Superjest         2010         WPMB Facility         3089         Plastics Products. N.E.C.           Superjest         2014         Presiden Products         2012         WPMB Facility         3089         Plastics Products. N.E.C.           Superjest         2014         Presiden Avenue         Harbor City         20071         WPMB Facility         3089         Plastics Products. N.E.C.           One World Audi Suppers         2281         Broad Avenue         Withingt Facility         3089         Plastics Products. N.E.C.           One World Audi Suppers         2281         Broad Avenue         Withingt Facility         3089         Plastics Products. N.E.C.           One World Markers in         2281         Broad Avenue         Withingt Facility         3089         Plastics Products. N.E.C.           One Plastics Products         2281         Broad Avenue         Withingt Facility         3089         Plastics Products. N.E.C.           One Plastics Product			·				,
Storplast         1020E         Saltony Siteel         North Holywood         91805         Physics         Physics <td></td> <td></td> <td>·</td> <td></td> <td></td> <td></td> <td></td>			·				
Mailab Plastics         1766 Outs Street         Torrance         9001         WHMS Facility         3089         Plastics Products, N.E.C.           Pinates Specially Products         24118         Trampton Avenue         Hattor City         90110         WHMS Facility         3089         Plastics Products, N.E.C.           Plasticorp         24105         France Mark Avenue         Hattor City         90110         WHMS Facility         3089         Plastics Products, N.E.C.           V Bartic Products         231         6014         Stream         100         Plastics Products, N.E.C.           V Bartick Plastics Funders         233         6014         Stream         100         Plastics Products, N.E.C.           V Bartick Plastics Funders         235         6014 Stream         100         Stream			·			3089	
Pramine Speciality Products         2281         Works Fractiny         3080         Plastice Products, N.E.C.           Plasticop         24105         Frangton Avenue         Habber City         90710         WPIMS Facility         3080         Plastice Products, N.E.C.           Star Plastic Endurises         25914         President Avenue         Habber City         90710         WPIMS Facility         3080         Plastice Products, N.E.C.           Mon Plastic Endurises Inc         738         60010         Start Plastics         Plastice Products, N.E.C.           Constraint Mandatic Endurises Inc         738         60010         Start Plastics         Plastice Products, N.E.C.           Constraint Mandational Inc         738         60010         Start Plastics         Plastice Products, N.E.C.           Constraint Mandational Inc         7205         Plastics Products, N.E.C.         Constraint Mandational Inc         70000         Plastice         Plastice         Plastice         Plastice         70000         Plastice         Plastice         Plastice         700000         Plastice         Pla			·				
Star Plastic Designs         2014 Heusident Avenue         Handborn City         90710         WIPINS Facility         9089         Plastics Products, N.E.C.           Also Plastic Enducters func         739         Excl Avenue         WIPINS Facility         9089         Plastics Products, N.E.C.           Also Plastic Enducters func         739         Excl Plastics Products, N.E.C.         Plastics Products, N.E.C.           VIP Reintol Plastics Forducts, N.E.C.         Common Manufacturing functions         9084         Plastics Products, N.E.C.           VIP Reintol Plastics Forducts, N.E.C.         Displastics Forducts, N.E.C.         Plastics Products, N.E.C.           Consent Manufacturing functions         90204         WPINIS Facility         20089         Plastics Products, N.E.C.           Consent Manufacturing functions         92005         WPINIS Facility         20089         Plastics Products, N.E.C.           D a Plastics         12020 S Figuence Street         Los Angeles         90006         WPINIS Facility         20089         Plastics Products, N.E.C.           Cardens and Manufacturing functions         15700 S Figuence Street         Cardena         90244         WPINIS Facility         20089         Plastics Products, N.E.C.           Cardens and Manufacturing functions         17200 S Figuence Street         Cardena         90244         WPINIS Facilit				90501		3089	
One World Auto Shippers         229 Broad Avenue         Withington         90744         WPINK Facility         3089         Phasics Products, N.E.C.           LV R ternhold Plastics Inc         973 62rd Street         Los Angeles         90000         WPINK Facility         3089         Phasics Products, N.E.C.           Conserrant Manufacturing Inc         9733 Crocker Street         Los Angeles         90004         WPINK Facility         3088         Phasics Products, N.E.C.           Conserrant Manufacturing Inc         6280         Brybunt Avenue         Los Angeles         90004         WPINK Facility         3088         Phasics Products, N.E.C.           Conserrant Manufacturing Inc         6420         Peant Scoleword         30004         WPINK Facility         3089         Phasics Phasics           Dia D Phasics         13820         Figures Street         Los Angeles         90001         WPINK Facility         3089         Phasics Phasics A Tech Inc         17730         S Figures Street         Cardena         90244         WPINK Facility         3089         Phasics Phasics A Tech Inc         Cardena         90244         WPINK Facility         3089         Phasics Phasics A Tech Inc         Cardena         90244         WPINK Facility         3089         Phasics Phasics A Tech Inc         Cardena         90244         WPINK Facili							
U.W. Reinhold Plastics Inc.         8762         Crocker Street         Los Angeles         99003         WPINS Facility         3089         Plastics Products, N.E.C.           Consoma Marulatizities Inc.         2225         Southwest Drive         Los Angeles         90003         WPINS Facility         3089         Plastics Products, N.E.C.           Canden Industries Inc.         2250         F4816 Breet         Los Angeles         90058         WPINS Facility         3089         Plastics Products, N.E.C.           Conden Industries Inc.         4560         Plastic         Products, N.E.C.         Construct         20014         WPINS Facility         3089         Plastics Products, N.E.C.           Compass Plastics And Street         Los Angeles         90051         WPINS Facility         3089         Plastics Products, N.E.C.           Compass Plastics And Street         Gardena         90264         WPINS Facility         3089         Plastics Products, N.E.C.           Compass Plastics Products, N.E.C.         Gardena         90246         WPINS Facility         3089         Plastics Products, N.E.C.           Compass Plastics Products, N.E.C.         Gardena         90246         WPINS Facility         3089         Plastics Products, N.E.C.           Compass Plastics Products, N.E.C.         Gardena         90244	One World Auto Shippers	229 Broad Avenue		90744	WPIMS Facility	3089	Plastics Products, N.E.C.
Crossman Manufacturing Inc         B8200         Byntics Products, N.E.C.           Linde Crafts         2225         Southwest Drive         Los Angeles         90045         WPINS Facility         3089         Plastics Products, N.E.C.           Canden Industries Inc         2205         E44th Street         Los Angeles         90058         WPINS Facility         3089         Plastics Products, N.E.C.           Canden Industries Inc         13020         Figureroa Street         Los Angeles         90058         WPINS Facility         3089         Plastics Products, N.E.C.           Campass Plastics         13020         Figureroa Street         Garderna         90244         WPINS Facility         3089         Plastics Products, N.E.C.           Compass Plastics & Tech Inc         17308         Figureroa Street         Garderna         90244         WPINS Facility         3089         Plastics Products, N.E.C.           Plastics Products, N.E.C.         Garderna         90244         WPINS Facility         3089         Plastics Products, N.E.C.           Plastics Products, N.E.C.         Garderna         90244         WPINS Facility         3089         Plastics Products, N.E.C.           Plastics Products, N.E.C.         Garderna         90244         WPINS Facility         3089         Plastics Products, N.E.C.			, in the second s		,		,
Canden Industries Inc         2005         4 Win Stread         Los Angeles         90058         WPIMS Facility         3089         Plastics Products, N.E.C.           D & D Plastics         13820 S Figueroa Streat         Los Angeles         90051         WPIMS Facility         3089         Plastics Products, N.E.C.           Campas Plastics & Toch Inc         15730 S Figueroa Streat         Gardena         90248         WPIMS Facility         3089         Plastics Products, N.E.C.           Campas Plastics & Toch Inc         15730 S Figueroa Streat         Gardena         90248         WPIMS Facility         3089         Plastics Products, N.E.C.           Dea Hyun Usa         Inco         17038 S Figueroa Streat         Gardena         90248         WPIMS Facility         3089         Plastics Products, N.E.C.           Plastics         171708 S Figueroa Streat         Gardena         90248         WPIMS Facility         3089         Plastics Products, N.E.C.           A T Plastics         1171 W 156th Street         Gardena         90248         WPIMS Facility         3089         Plastics Products, N.E.C.           Advanced Products         1120 Hindry Avenue         Los Angeles         90044         WPIMS Facility         3089         Plastics Products, N.E.C.           Advanced Products         1120 Hindry Avenue		6820 Brynhurst Avenue	•	90043	WPIMS Facility	3089	Plastics Products, N.E.C.
Erits Plastic         4500         Pacific Bouleward         Los Angeles         90058         WPMS Facility         3089         Plastics Products, N.E.C.           Galaxy Plastic         545 W 130th Street         Los Angeles         90061         WPMS Facility         3089         Plastics Products, N.E.C.           Compass Plastics & Toch Inc         17203         Figueroa Street         Gardena         90248         WPMS Facility         3089         Plastics Products, N.E.C.           Dae Hyun Usa Inc         17203         Figueroa Street         Gardena         90248         WPMS Facility         3089         Plastics Products, N.E.C.           Rotonics Manufacturing Inc         17332         Sfigueroa Street         Gardena         90248         WPMS Facility         3089         Plastics Products, N.E.C.           T A T Plastics         173 W 1550 Street         Gardena         90248         WPMS Facility         3089         Plastics Products, N.E.C.           Advanced Products         11201 Hundry Avenue         Los Angeles         90044         WPMS Facility         3089         Plastics Products, N.E.C.           Advanced Products         12016 Vindry Avenue         Los Angeles         90064         WPMS Facility         3089         Plastics Products, N.E.C.           Los Products         12016 Vindry A			, in the second s				
Galaxy Phasisc         545         W 130th Street         Los Angeles         9000t         WPIMS Facility         3089         Plastes Products, N.E.C.           Dae Hyun Usa Inc         17208         S Figueros Street         Gardena         90248         WPIMS Facility         3089         Plastes Products, N.E.C.           Dae Hyun Usa Inc         17328         S Figueros Street         Gardena         90248         WPIMS Facility         3089         Plastes Products, N.E.C.           Rotonics Manufacturing Inc         17038         S Figueros Street         Gardena         90248         WPIMS Facility         3089         Plastes Products, N.E.C.           Advanced Products         1170         Histiss         Floates         90044         WPIMS Facility         3089         Plastes Products, N.E.C.           Advanced Products         11201         Hindry Avenue         Los Angeles         90064         WPIMS Facility         3089         Plastes Products, N.E.C.           Solter Plastics         12016         WPIco Boulevard         Los Angeles         90064         WPIMS Facility         3089         Plastes Products, N.E.C.           Jaseph Gadvan Studic         F4020         Septiveda Boulevard         Los Angeles         90064         WPIMS Facility         3089         Plastes Products, N.E.C.     <	Edris Plastic	4560 Pacific Boulevard	Los Angeles	90058	WPIMS Facility	3089	Plastics Products, N.E.C.
Compass Plastics & Tech Inc         15730         S Figueroa Street         Gardena         9024         WPIMS Facility         3089         Plastics Products, N.E.C.           Dea Hyun Usa Inc         17208         S Figueroa Street         Gardena         90248         WPIMS Facility         3089         Plastics Products, N.E.C.           Rotnicis Manufacturing Inc         17038         S Figueroa Street         Gardena         90248         WPIMS Facility         3089         Plastics Products, N.E.C.           Pro Plastic         1701         W155th Street         Gardena         90248         WPIMS Facility         3089         Plastics Products, N.E.C.           Advanced Products         12101         Hindry Avenue         Los Angeles         90044         WPIMS Facility         3089         Plastics Products, N.E.C.           Sotter Plastics         12016         W100 Soleuvard         Los Angeles         90064         WPIMS Facility         3089         Plastics Products, N.E.C.           Sotter Plastics         12016         W100 Soleuvard         Los Angeles         90064         WPIMS Facility         3089         Plastics Products, N.E.C.           Sotter Plastics         12016         W1002 Soleuvard         Los Angeles         90064         WPIMS Facility         3089         Plastics Products, N.E.C.							
Plastics Products, N.E.C.         Standard         90248         WPIMS Facility         2089         Plastics Products, N.E.C.           T& T Plastics         117 W 15th Street         Gardena         90248         WPIMS Facility         3089         Plastics Products, N.E.C.           T& T Plastics         117 W 15th Street         Gardena         90248         WPIMS Facility         3089         Plastics Products, N.E.C.           Advanced Products         11201         Hindry Avenue         Los Angeles         90034         WPIMS Facility         3089         Plastics Products, N.E.C.           Metro Mold Inc         2234         Log Angeles         90064         WPIMS Facility         3089         Plastics Products, N.E.C.           Obster Plastics         12016         W Pice Boulevard         Los Angeles         90064         WPIMS Facility         3089         Plastics Products, N.E.C.           Testsun Inc         11388         W Olympic Boulevard         Los Angeles         90064         WPIMS Facility         3089         Plastics Products, N.E.C.           Joseph Galvan Studio         6740         Scentriela Avenue         Cluwer City         90230         WPIMS Facility         3089         Plastics Products, N.E.C.           Strattord Molded Plastics Inc         1237         Eton Avenue	Compass Plastics & Tech Inc	15730 S Figueroa Street	Gardena	90248	WPIMS Facility	3089	Plastics Products, N.E.C.
Ratonica Manufacturing Inc         17038         S Figuetore Street         Gardena         90248         WPIMS Facility         3089         Plastics Products, N.E.C.           Pix P Tassics         117 W 155h Street         Gardena         90248         WPIMS Facility         3089         Plastics Products, N.E.C.           Advanced Produts         11201         Hindy Avenue         Los Angeles         90044         WPIMS Facility         3089         Plastics Products, N.E.C.           Metro Mold Inc         2234         Purdue Avenue         Los Angeles         90064         WPIMS Facility         3089         Plastics Products, N.E.C.           Solter Plastics         12016         WPIco Stacility         3089         Plastics Products, N.E.C.         C.           Teksun Inc         11368         W Olympic Boulevard         Los Angeles         90064         WPIMS Facility         3089         Plastics Products, N.E.C.           Joseph Gathon         64106         Gentrale Avenue         Culver City         90230         WPIMS Facility         3089         Plastics Products, N.E.C.           Joseph Gathon         64106         Gencoa Avenue         Canoga Park         91303         WPIMS Facility         3089         Plastics Products, N.E.C.           Joseph Gathon         Battors Products, N.E.C.		· · · · · · · · · · · · · · · · · · ·			· · · · · · · · · · · · · · · · · · ·		,
Pro Plasic Inc.         2368         S Robertson Boulevard         Los Angeles         90034         WPIMS Facility         3089         Plastics Products, N.E.C.           Metro Mold Inc.         2234         Purdue Avenue         Los Angeles         90064         WPIMS Facility         3089         Plastics Products, N.E.C.           Solter Plastics         11368         WOlympic Boulevard         Los Angeles         90064         WPIMS Facility         3089         Plastics Products, N.E.C.           Acrylic Specialities         4203         Sepulveda Boulevard         Culver City         90230         WPIMS Facility         3089         Plastics Products, N.E.C.           Joseph Galvan Studio         G Cantinela Avenue         Culver City         90230         WPIMS Facility         3089         Plastics Products, N.E.C.           Tardford Molded Plastics In         7237         Econ Avenue         Canoga Park         91304         WPIMS Facility         3089         Plastics Products, N.E.C.           Blackburn Engineering         8100         Remma Avenue # 7         Canoga Park         91304         WPIMS Facility         3089         Plastics Products, N.E.C.           Maree         8447         Canoga Park         91304         WPIMS Facility         3089         Plastics Products, N.E.C.	Rotonics Manufacturing Inc	17038 S Figueroa Street	Gardena	90248	WPIMS Facility	3089	Plastics Products, N.E.C.
Advanced Products         11201         Hindry Avenue         Los Angeles         90045         WPIMS Facility         3089         Plastics Products, N.E. C.           Solter Plastics         12016         W Pico Boulevard         Los Angeles         90064         WPIMS Facility         3089         Plastics Products, N.E. C.           Carylic Specialites         4203         Sepuiveds Boulevard         Los Angeles         90064         WPIMS Facility         3089         Plastics Products, N.E.C.           Arcylic Specialites         4203         Sepuiveds Boulevard         Los Angeles         90064         WPIMS Facility         3089         Plastics Products, N.E.C.           Joseph Galvan Studio         6740         S Centinela Avenue         Culver City         90230         WPIMS Facility         3089         Plastics Products, N.E.C.           Stratford Molded Plastics Inc         7237         Eton Avenue         Canoga Park         91303         WPIMS Facility         3089         Plastics Products, N.E.C.           Blackburn Engineering         8106         Remmet Avenue # 7         Canoga Park         91304         WPIMS Facility         3089         Plastics Products, N.E.C.           Blackburn Engineering         8106         Canoga Park         91304         WPIMS Facility         3089         Plastics Products							
Solter Plastics         12016         W Pico Boulevard         Los Angeles         90064         WPIMS Facility         3089         Plastics Products, N.E.C.           Acrylic Specialities         4203         Sepulveda Boulevard         Culver City         90230         WPIMS Facility         3089         Plastics Products, N.E.C.           Joseph Galvan Studio         6740         S Centinela Avenue         Culver City         90230         WPIMS Facility         3089         Plastics Products, N.E.C.           Techmar Corp         4150         Glence Avenue A         Marina Del Rey         90230         WPIMS Facility         3089         Plastics Products, N.E.C.           Backburn Engineering         8100         Remmet Avenue         Canoga Park         91303         WPIMS Facility         3089         Plastics Products, N.E.C.           Inage Molding         8565         Canoga Avenue         Canoga Park         91304         WPIMS Facility         3089         Plastics Products, N.E.C.           Plastics Products         7721         Deering Avenue         Canoga Park         91304         WPIMS Facility         3089         Plastics Products, N.E.C.           Robert Davis Mold         7630         Alabama Avenue # 3         Canoga Park         91304         WPIMS Facility         3089         Plastics Prod	Advanced Products	11201 Hindry Avenue	Los Angeles	90045	WPIMS Facility	3089	Plastics Products, N.E.C.
Teksun Inc         11368         WOympic Boulevard         Los Angeles         90064         WPIMS Facility         3089         Plastics Products, N.E.C.           Acrylic Specialites         4203         Sepulveda Boulevard         Culver City         90230         WPIMS Facility         3089         Plastics Products, N.E.C.           Joseph Galvan Studio         6740         S Centinela Avenue         Culver City         90230         WPIMS Facility         3089         Plastics Products, N.E.C.           Stratford Molded Plastics Information         7237         Eton Avenue         Canoga Park         91304         WPIMS Facility         3089         Plastics Products, N.E.C.           Blackburn Engineering         8100         Remmet Avenue # 7         Canoga Park         91304         WPIMS Facility         3089         Plastics Products, N.E.C.           Mariec         8447         Canoga Avenue         Canoga Park         91304         WPIMS Facility         3089         Plastics Products, N.E.C.           Pastics Products         8772         Deering Avenue         Canoga Park         91304         WPIMS Facility         3089         Plastics Products, N.E.C.           Pope         8551         Canoga Avenue         Canoga Park         91304         WPIMS Facility         3089         Plastics Products, N.			•		· · ·		
Joseph Galvan Studio6740 S Centinela AvenueCulver City90230WPIMS Facility3089Plastics Products, N.E.C.Techmar Corp4150Glencoe Avenue AMarina Del Rey90232WPIMS Facility3089Plastics Products, N.E.C.Blackburn Engineering8100Remmet Avenue # 7Canoga Park91303WPIMS Facility3089Plastics Products, N.E.C.Image Molding8555Canoga AvenueCanoga Park91304WPIMS Facility3089Plastics Products, N.E.C.Marec8447Canoga AvenueCanoga Park91304WPIMS Facility3089Plastics Products, N.E.C.Plascap Corp Plastic Closures7721Deering AvenueCanoga Park91304WPIMS Facility3089Plastics Products, N.E.C.Pope8551Canoga AvenueCanoga Park91304WPIMS Facility3089Plastics Products, N.E.C.Dekker Design Plastics21701Plummer StreetCanoga Park91304WPIMS Facility3089Plastics Products, N.E.C.Bokker Design Plastics21701Plummer StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Complast20371Prairie Street # 7Chatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Marchester Plastics Ro20401Prairie StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Marchester Plastics Ro2041Independence AvenueChatsworth91311WPI	Teksun Inc	11368 W Olympic Boulevard	Los Angeles	90064	WPIMS Facility	3089	Plastics Products, N.E.C.
Techmar Corp4150Glencoe Avenue AMarina Del Rey90292WPIMS Facility3089Plastics Products, N.E.C.Stratford Molded Plastics Inc7237Eton AvenueCanoga Park91303WPIMS Facility3089Plastics Products, N.E.C.Image Molding8565Canoga AvenueCanoga Park91304WPIMS Facility3089Plastics Products, N.E.C.Image Molding8565Canoga AvenueCanoga Park91304WPIMS Facility3089Plastics Products, N.E.C.Plascap Corp Plastic Closures7721Deering AvenueCanoga Park91304WPIMS Facility3089Plastics Products, N.E.C.Pope8551Canoga AvenueCanoga Park91304WPIMS Facility3089Plastics Products, N.E.C.Pope8551Canoga AvenueCanoga Park91304WPIMS Facility3089Plastics Products, N.E.C.Conoga Park91304WPIMS Facility3089Plastics Products, N.E.C.Dekker Design Plastics21701Plummer StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.G M Plastic & Mold9625Cozycroft Avenue # EChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.G M Plastic & Mold9625Cozycroft Avenue # Chatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Marchester Plastics Co20401Printi StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C. </td <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td>							
Blackburn EngineeringB100Remmet Avenue # 7Canoga Park91304WPIMS Facility3089Plastics Products, N.E.C.Image Molding8565Canoga AvenueCanoga Park91304WPIMS Facility3089Plastics Products, N.E.C.Martec8447Canoga AvenueCanoga Park91304WPIMS Facility3089Plastics Products, N.E.C.Plascap Corp Plastic Closures7721Deering AvenueCanoga Park91304WPIMS Facility3089Plastics Products, N.E.C.Pope8551Canoga AvenueCanoga Park91304WPIMS Facility3089Plastics Products, N.E.C.Robert Davis Mold7630Alabama Avenue # 3Canoga Park91304WPIMS Facility3089Plastics Products, N.E.C.Dekker Design Plastics21701Plummer StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Conoplast20311Prairie Street # 7Chatsworth91311WPIMS Facility3089Plastics Products, N.E.C.G M Plastic & Mold9625Cozycroft Avenue # EChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Ken Ke Nab Co9801Independence AvenueChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Orbit Industry9811Owensmouth Avenue # 12Chatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Orbit Industries Inc20401Prairie StreetChatsworth91311WPI	Techmar Corp	4150 Glencoe Avenue A	Marina Del Rey	90292	WPIMS Facility	3089	Plastics Products, N.E.C.
Image Molding8665Canoga AvenueCanoga Park91304WPIMS Facility3089Plastics Products, N.E.C.Martec8447Canoga AvenueCanoga Park91304WPIMS Facility3089Plastics Products, N.E.C.Plascap Corp Plastic Closures7721Deering AvenueCanoga Park91304WPIMS Facility3089Plastics Products, N.E.C.Pope8551Canoga AvenueCanoga Park91304WPIMS Facility3089Plastics Products, N.E.C.Robert Davis Mold7630Alabama Avenue # 3Canoga Park91304WPIMS Facility3089Plastics Products, N.E.C.Dekker Design Plastics21701Plummer StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Econoplast20371Prairie Street # 7Chatsworth91311WPIMS Facility3089Plastics Products, N.E.C.G M Plastic & Mold9625Cozycroft Avenue # EChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Manchester Plastics Co20401Prairie StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Micro Plastics Inc20821Dearborn StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Micro Plastics Inc20421Dearborn StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Micro Plastics Inc20421Dearborn StreetChatsworth91311WPIMS					· · ·		
Plascap Corp Plastic Closures7721Deering AvenueCanoga Park91304WPIMS Facility3089Plastics Products, N.E.C.Pope8551Canoga AvenueCanoga Park91304WPIMS Facility3089Plastics Products, N.E.C.Robert Davis Mold7630Alabama Avenue # 3Canoga Park91304WPIMS Facility3089Plastics Products, N.E.C.Dekker Design Plastics21701Plummer StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Complast20371Prairie Street # 7Chatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Ken Mc Nabb Co9801Independence AvenueChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Marchester Plastics Co20401Prairie StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Orbit Industry9811Ovensmouth Avenue # 12Chatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Orbit Industry9811Ovensmouth Avenue # 12Chatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Precision Molds & Molding Co21200Nordhoff StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Precision Molds & Bolding Co20916Itasca StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Rem Industries Inc20731Prairie StreetCha	Image Molding	8565 Canoga Avenue	Canoga Park	91304	WPIMS Facility	3089	Plastics Products, N.E.C.
Pope8551Canoga AvenueCanoga Park91304WPIMS Facility3089Plastics Products, N.E.C.Robert Davis Mold7630Alabama Avenue # 3Canoga Park91304WPIMS Facility3089Plastics Products, N.E.C.Dekker Design Plastics21701Plummer StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Conoglast20371Prairie Street # 7Chatsworth91311WPIMS Facility3089Plastics Products, N.E.C.G M Plastic & Mold9625Cozycroft Avenue # EChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Ken Mc Nabb Co9801Independence AvenueChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Manchester Plastics Co20401Prairie StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Micro Plastics Inc20821Dearborn StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Orbit Industry9811Owensmouth Avenue # 12Chatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Plastofilm Industries Inc22416Needles StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Rem Industries Inc20131Prairie StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Toye Corp20916Itasca StreetChatsworth91311			, i i i i i i i i i i i i i i i i i i i				
Dekker Design Plastics21701Plummer StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Econoplast20371Prairie Street # 7Chatsworth91311WPIMS Facility3089Plastics Products, N.E.C.G M Plastic & Mold9625Cozycroft Avenue # EChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Ken Mc Nabb Co9801Independence AvenueChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Manchester Plastics Co20401Prairie StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Micro Plastics Inc20821Dearborn StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Orbit Industry9811Owensmouth Avenue # 12Chatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Plastofilm Industries Inc22416Needles StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Rem Industries Inc20731Prairie StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Toye Corp20916Itasca StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Toye Corp20916Itasca StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Hord Corp20916Itasca StreetChatsworth91311WPIMS F	Роре	8551 Canoga Avenue	Canoga Park	91304	WPIMS Facility	3089	Plastics Products, N.E.C.
Econoplast20371Prairie Street # 7Chatsworth91311WPIMS Facility3089Plastics Products, N.E.C.G M Plastic & Mold9625Cozycroft Avenue # EChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Ken Mc Nabb Co9801Independence AvenueChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Manchester Plastics Co20401Prairie StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Micro Plastics Inc20821Dearborn StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Orbit Industry9811Owensmouth Avenue # 12Chatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Plastics Inc22416Needles StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Precision Molds & Molding Co21200Nordhoff StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Toye Corp20916Itasca StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Home Grown Creation18836Malden StreetNorthridge91324WPIMS Facility3089Plastics Products, N.E.C.Perfect Mold19356Business Center DriveNorthridge91324WPIMS Facility3089Plastics Products, N.E.C.Unitech-Deco Inc19731Bahama StreetNorthridge91324 <td></td> <td></td> <td>0</td> <td></td> <td></td> <td></td> <td></td>			0				
Ken Mc Nabb Co9801Independence AvenueChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Manchester Plastics Co20401Prairie StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Micro Plastics Inc20821Dearborn StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Orbit Industry9811Owensmouth Avenue #12Chatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Plastofilm Industries Inc22416Needles StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Rem Industries Inc20731Prairie StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Toye Corp20916Itasca StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Home Grown Creation18836Malden StreetNorthridge91324WPIMS Facility3089Plastics Products, N.E.C.Perfect Mold19356Business Center DriveNorthridge91324WPIMS Facility3089Plastics Products, N.E.C.Unitech-Deco Inc19731Bahama StreetNorthridge91324WPIMS Facility3089Plastics Products, N.E.C.Overflo Drain Systems18536Burbank BoulevardTarzana91356WPIMS Facility3089Plastics Products, N.E.C.Overflo Drain Systems18536Burbank BoulevardTarzana913	Dekker Design Plastics	21701 Plummer Street		91311	WPIMS Facility	3089	Plastics Products, N.E.C.
Manchester Plastics Co20401Prairie StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Micro Plastics Inc20821Dearborn StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Orbit Industry9811Owensmouth Avenue # 12Chatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Plastofilm Industries Inc22416Needles StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Precision Molds & Molding Co21200Nordhoff StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Rem Industries Inc20731Prairie StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Toye Corp20916Itasca StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Home Grown Creation18836Malden StreetNorthridge91324WPIMS Facility3089Plastics Products, N.E.C.Unitech-Deco Inc19731Bahama StreetNorthridge91324WPIMS Facility3089Plastics Products, N.E.C.Morris Enterprises Inc16799Schoenborn StreetSepulveda91343WPIMS Facility3089Plastics Products, N.E.C.Overflo Drain Systems18536Burbank BoulevardTarzana91356WPIMS Facility3089Plastics Products, N.E.C.	Econoplast	20371 Prairie Street # 7			WPIMS Facility	3089	Plastics Products, N.E.C.
Orbit Industry9811Owensmouth Avenue # 12Chatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Plastofilm Industries Inc22416Needles StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Precision Molds & Molding Co21200Nordhoff StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Rem Industries Inc20731Prairie StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Toye Corp20916Itasca StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Home Grown Creation18836Malden StreetNorthridge91324WPIMS Facility3089Plastics Products, N.E.C.Perfect Mold19356Business Center DriveNorthridge91324WPIMS Facility3089Plastics Products, N.E.C.Unitech-Deco Inc19731Bahama StreetNorthridge91324WPIMS Facility3089Plastics Products, N.E.C.Morris Enterprises Inc16799Schoenborn StreetSepulveda91343WPIMS Facility3089Plastics Products, N.E.C.Overflo Drain Systems18536Burbank BoulevardTarzana91356WPIMS Facility3089Plastics Products, N.E.C.	Econoplast G M Plastic & Mold	20371 Prairie Street # 7 9625 Cozycroft Avenue # E	Chatsworth		WPIMS Facility	3089	Plastics Products, N.E.C.
Plastofilm Industries Inc22416Needles StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Precision Molds & Molding Co21200Nordhoff StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Rem Industries Inc20731Prairie StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Toye Corp20916Itasca StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Home Grown Creation18836Malden StreetNorthridge91324WPIMS Facility3089Plastics Products, N.E.C.Perfect Mold19356Business Center DriveNorthridge91324WPIMS Facility3089Plastics Products, N.E.C.Unitech-Deco Inc19731Bahama StreetNorthridge91324WPIMS Facility3089Plastics Products, N.E.C.Morris Enterprises Inc16799Schoenborn StreetSepulveda91343WPIMS Facility3089Plastics Products, N.E.C.Overflo Drain Systems18536Burbank BoulevardTarzana91356WPIMS Facility3089Plastics Products, N.E.C.	Econoplast G M Plastic & Mold Ken Mc Nabb Co Manchester Plastics Co	20371       Prairie Street # 7         9625       Cozycroft Avenue # E         9801       Independence Avenue         20401       Prairie Street	Chatsworth Chatsworth Chatsworth	91311 91311	WPIMS Facility	3089	Plastics Products, N.E.C.
Rem Industries Inc20731Prairie StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Toye Corp20916Itasca StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Home Grown Creation18836Malden StreetNorthridge91324WPIMS Facility3089Plastics Products, N.E.C.Perfect Mold19356Business Center DriveNorthridge91324WPIMS Facility3089Plastics Products, N.E.C.Unitech-Deco Inc19731Bahama StreetNorthridge91324WPIMS Facility3089Plastics Products, N.E.C.Morris Enterprises Inc16799Schoenborn StreetSepulveda91343WPIMS Facility3089Plastics Products, N.E.C.Overflo Drain Systems18536Burbank BoulevardTarzana91356WPIMS Facility3089Plastics Products, N.E.C.	Econoplast G M Plastic & Mold Ken Mc Nabb Co Manchester Plastics Co Micro Plastics Inc	20371       Prairie Street # 7         9625       Cozycroft Avenue # E         9801       Independence Avenue         20401       Prairie Street         20821       Dearborn Street	Chatsworth Chatsworth Chatsworth Chatsworth	91311 91311 91311	WPIMS Facility WPIMS Facility	3089 3089	Plastics Products, N.E.C. Plastics Products, N.E.C.
Toye Corp20916Itasca StreetChatsworth91311WPIMS Facility3089Plastics Products, N.E.C.Home Grown Creation18836Malden StreetNorthridge91324WPIMS Facility3089Plastics Products, N.E.C.Perfect Mold19356Business Center DriveNorthridge91324WPIMS Facility3089Plastics Products, N.E.C.Unitech-Deco Inc19731Bahama StreetNorthridge91324WPIMS Facility3089Plastics Products, N.E.C.Morris Enterprises Inc16799Schoenborn StreetSepulveda91343WPIMS Facility3089Plastics Products, N.E.C.Overflo Drain Systems18536Burbank BoulevardTarzana91356WPIMS Facility3089Plastics Products, N.E.C.	Econoplast G M Plastic & Mold Ken Mc Nabb Co Manchester Plastics Co Micro Plastics Inc Orbit Industry Plastofilm Industries Inc	20371       Prairie Street # 7         9625       Cozycroft Avenue # E         9801       Independence Avenue         20401       Prairie Street         20821       Dearborn Street         9811       Owensmouth Avenue # 12         22416       Needles Street	Chatsworth Chatsworth Chatsworth Chatsworth Chatsworth Chatsworth	91311 91311 91311 91311 91311 91311	WPIMS Facility WPIMS Facility WPIMS Facility WPIMS Facility	3089 3089 3089 3089 3089	Plastics Products, N.E.C. Plastics Products, N.E.C. Plastics Products, N.E.C. Plastics Products, N.E.C.
Perfect Mold19356Business Center DriveNorthridge91324WPIMS Facility3089Plastics Products, N.E.C.Unitech-Deco Inc19731Bahama StreetNorthridge91324WPIMS Facility3089Plastics Products, N.E.C.Morris Enterprises Inc16799Schoenborn StreetSepulveda91343WPIMS Facility3089Plastics Products, N.E.C.Overflo Drain Systems18536Burbank BoulevardTarzana91356WPIMS Facility3089Plastics Products, N.E.C.	Econoplast G M Plastic & Mold Ken Mc Nabb Co Manchester Plastics Co Micro Plastics Inc Orbit Industry Plastofilm Industries Inc Precision Molds & Molding Co	20371       Prairie Street # 7         9625       Cozycroft Avenue # E         9801       Independence Avenue         20401       Prairie Street         20821       Dearborn Street         9811       Owensmouth Avenue # 12         22416       Needles Street         21200       Nordhoff Street	Chatsworth Chatsworth Chatsworth Chatsworth Chatsworth Chatsworth Chatsworth	91311 91311 91311 91311 91311 91311 91311	WPIMS Facility WPIMS Facility WPIMS Facility WPIMS Facility WPIMS Facility	3089 3089 3089 3089 3089 3089	Plastics Products, N.E.C. Plastics Products, N.E.C. Plastics Products, N.E.C. Plastics Products, N.E.C. Plastics Products, N.E.C.
Unitech-Deco Inc         19731         Bahama Street         Northridge         91324         WPIMS Facility         3089         Plastics Products, N.E.C.           Morris Enterprises Inc         16799         Schoenborn Street         Sepulveda         91343         WPIMS Facility         3089         Plastics Products, N.E.C.           Overflo Drain Systems         18536         Burbank Boulevard         Tarzana         91356         WPIMS Facility         3089         Plastics Products, N.E.C.	Econoplast G M Plastic & Mold Ken Mc Nabb Co Manchester Plastics Co Micro Plastics Inc Orbit Industry Plastofilm Industries Inc Precision Molds & Molding Co Rem Industries Inc Toye Corp	20371       Prairie Street # 7         9625       Cozycroft Avenue # E         9801       Independence Avenue         20401       Prairie Street         20821       Dearborn Street         9811       Owensmouth Avenue # 12         22416       Needles Street         21200       Nordhoff Street         20731       Prairie Street         20916       Itasca Street	Chatsworth Chatsworth Chatsworth Chatsworth Chatsworth Chatsworth Chatsworth Chatsworth Chatsworth	91311 91311 91311 91311 91311 91311 91311 91311 91311	WPIMS Facility WPIMS Facility WPIMS Facility WPIMS Facility WPIMS Facility WPIMS Facility WPIMS Facility	3089 3089 3089 3089 3089 3089 3089 3089	Plastics Products, N.E.C. Plastics Products, N.E.C. Plastics Products, N.E.C. Plastics Products, N.E.C. Plastics Products, N.E.C. Plastics Products, N.E.C. Plastics Products, N.E.C.
Overflo Drain Systems 18536 Burbank Boulevard Tarzana 91356 WPIMS Facility 3089 Plastics Products, N.E.C.	Econoplast G M Plastic & Mold Ken Mc Nabb Co Manchester Plastics Co Micro Plastics Inc Orbit Industry Plastofilm Industries Inc Precision Molds & Molding Co Rem Industries Inc Toye Corp Home Grown Creation	20371       Prairie Street # 7         9625       Cozycroft Avenue # E         9801       Independence Avenue         20401       Prairie Street         20821       Dearborn Street         9811       Owensmouth Avenue # 12         22416       Needles Street         21200       Nordhoff Street         20731       Prairie Street         20916       Itasca Street         18836       Malden Street	Chatsworth Chatsworth Chatsworth Chatsworth Chatsworth Chatsworth Chatsworth Chatsworth Chatsworth Northridge	91311 91311 91311 91311 91311 91311 91311 91311 91311 91324	WPIMS Facility WPIMS Facility WPIMS Facility WPIMS Facility WPIMS Facility WPIMS Facility WPIMS Facility WPIMS Facility	3089 3089 3089 3089 3089 3089 3089 3089	Plastics Products, N.E.C. Plastics Products, N.E.C.
	Econoplast G M Plastic & Mold Ken Mc Nabb Co Manchester Plastics Co Micro Plastics Inc Orbit Industry Plastofilm Industries Inc Precision Molds & Molding Co Rem Industries Inc Toye Corp Home Grown Creation Perfect Mold Unitech-Deco Inc	20371       Prairie Street # 7         9625       Cozycroft Avenue # E         9801       Independence Avenue         20401       Prairie Street         20821       Dearborn Street         9811       Owensmouth Avenue # 12         22416       Needles Street         21200       Nordhoff Street         20731       Prairie Street         20916       Itasca Street         18836       Malden Street         19356       Business Center Drive         19731       Bahama Street	Chatsworth Chatsworth Chatsworth Chatsworth Chatsworth Chatsworth Chatsworth Chatsworth Chatsworth Northridge Northridge	91311 91311 91311 91311 91311 91311 91311 91311 91324 91324 91324	WPIMS Facility WPIMS Facility WPIMS Facility WPIMS Facility WPIMS Facility WPIMS Facility WPIMS Facility WPIMS Facility WPIMS Facility WPIMS Facility	3089 3089 3089 3089 3089 3089 3089 3089	Plastics Products, N.E.C. Plastics Products, N.E.C.
	Econoplast G M Plastic & Mold Ken Mc Nabb Co Manchester Plastics Co Micro Plastics Inc Orbit Industry Plastofilm Industries Inc Precision Molds & Molding Co Rem Industries Inc Toye Corp Home Grown Creation Perfect Mold Unitech-Deco Inc Morris Enterprises Inc	20371       Prairie Street # 7         9625       Cozycroft Avenue # E         9801       Independence Avenue         20401       Prairie Street         20821       Dearborn Street         9811       Owensmouth Avenue # 12         22416       Needles Street         21200       Nordhoff Street         20731       Prairie Street         20916       Itasca Street         18836       Malden Street         19356       Business Center Drive         193731       Bahama Street         16799       Schoenborn Street	Chatsworth Chatsworth Chatsworth Chatsworth Chatsworth Chatsworth Chatsworth Chatsworth Chatsworth Northridge Northridge Sepulveda	91311 91311 91311 91311 91311 91311 91311 91311 91324 91324 91324 91324	WPIMS Facility WPIMS Facility	3089 3089 3089 3089 3089 3089 3089 3089	Plastics Products, N.E.C. Plastics Products, N.E.C.

#### CITY OF LOS ANGELES PLASTIC PELLETS FACILITIES

Num         Basics         Products         Display         Display <thdisplay< th=""> <thdisplay< th=""> <thdispl< th=""><th>FACILITY NAME</th><th>ADDRESS</th><th>CITY</th><th>ZIP</th><th>BUSINESS DESCRIPTION</th><th>SIC CODE</th><th>SIC DESCRIPTION</th></thdispl<></thdisplay<></thdisplay<>	FACILITY NAME	ADDRESS	CITY	ZIP	BUSINESS DESCRIPTION	SIC CODE	SIC DESCRIPTION
Num         Basics         Products         Display         Display <thdisplay< th=""> <thdisplay< th=""> <thdispl< td=""><td>Valley Plastics</td><td></td><td></td><td>91367</td><td></td><td></td><td></td></thdispl<></thdisplay<></thdisplay<>	Valley Plastics			91367			
Task International         19523         Ammina Street         Van Nujo         91406         WPMMS Faaliny         2089         Plantics Products, N.E.C.           Marcian Plastic Products, Inc.         0243         Glenosk Soulevard         91331         WPMMS Faaliny         3089         Plastics Products, N.E.C.           Marcian Plastic Products, Inc.         0393         Texts Plastics Products, N.E.C.         Plastics Products, N.E.C.           Marcian Plastic Products, Inc.         0393         Plastics Products, N.E.C.         Plastics Products, N.E.C.           AMERICAN CASTER CORP         0414         Alvantican         0394         Plastics Products, N.E.C.           SATE CONPERTER INC.         1538         SEPERANZA Street         US3 ANGELES         00023         Plastics Plastics Plastican Contact Action Plastics Plastican         Plastics Plastican Contact Action Plastics Plastican           SATE NOLVERTIES INC.         1538         SEPERANZA Street         US3 ANGELES         00023         Plastics Plastican Plastican Contact Action Plastican Plastican Contact Action Plastican           SATE NOLVERTIES INC.         1528         2021         PLASTIC MOLER NO         3089         Plastics Plastican Plastican         Plastican Plastican Plastican Plastican         Plastican Plastican Plastican Plastican Plastican Plastican         Plastican Plastican Plastican Plastican Plastican Plastican Plastican Plastican Plastican Plasti		,	Van Nuvs	91406	,		,
Nametcan Plastic Products, Inc.         9243         Genoles Soutient         Sun Valley         91352         WFMS Faulty         2089         Plastics Products, N.E.C.           WARLE PETFER         11308         USA Wareaue         PACOIMA         91331         PLASTIC PLANEN, S.E.C.           WARLE PETFER         11308         SUTTER Avenue         PACOIMA         PLASTIC CARP         906         AVLA Strett         LOS ANGELES         90121         Ar Cond. A Fedfic, Egy, S. S.         Stretch Products, N.E.C.           MARRIAR DASTIC CORP         104         WARNO AVENUE         24         COS ANGELES         90021         Ar Cond. A Fedfic, Egy, S.S.         Stretter, N.E.C.           MARRIAR DASTIC CORP         104         WARNO AVENUE         24         COS ANGELES         90021         Stretter, N.E.         Stretter, N.E.C.           MARRIAR DASTICS INCC.         2051         Stretter, N.E.         COS ANGELES         90023         Larks K Multer DASTICS         Stretter, N.E.C.         The Stretter, N.E.C. <td< td=""><td></td><td></td><td></td><td>91406</td><td></td><td></td><td>'</td></td<>				91406			'
Object Nationan         1128         Jies Jies Avenue         Pacima         9131         PMINE Facility         3089         Plastics Products, N.E.C.           PRICE PRISTER         11080         SUTTER Avenue         DS ANGELES         60012         Air Card, & Reing, Equip, & S 40069         Plastics Products, N.E.C.           ARRICAN CASTER CORP         608         AVULA Street         LOS ANGELES         60013         MANUFACTURINKO FIXE         Bastics Products, N.E.C.           CONST CONVERTERS NC.         1601         PERRISE AVOIDS, N.E.C.         Plastics Froducts, N.E.C.           CONST CONVERTERS NC.         1601         PERRISE AVOIDS, N.E.C.         Plastics Froducts, N.E.C.           WIRE DLIGHT NOUSTRIES         2043         CENTRA TAMENDARE         6073         Plastics Products, N.E.C.           WIRE DLIGHT NOUSTRIES         2043         CENTRA TAMENDARE         6073         Plastics Products, N.E.C.           WIRE DLIGHT NOUSTRIES         2053         CENTRA TAMENDARE         2073         Plastics Products, N.E.C.           WIRE DLIGHT NOUSTRIES         2054         2053         MANUFACTURER OF ELES         20031         MANUFACTURER OF ELES         2004         Plastics Products, N.E.C.           VLAST TERSAULTIES         NOTE TARSAULTIES         20425         20425         Plastics Products, N.E.C.	American Plastic Products, Inc.						'
PRCE PriSTER         11080 SUTTER Avenue         PACOMA         9131         PLATER POLVING 3089         Plates Products, N.E.C.           DMRRALPLASTER CORP         141         WAVENUE 34         LOS ANGELES         90031         MANLTACTURING PLATE 3089         Plates Products, N.E.C.           DALI NOUSTRIES INC.         1558         ESPERANZA STREET         LOS ANGELES         90032         PLATE 700445         3041         And Context Page 3041           DALI NOUSTRIES INC.         1558         ESPERANZA STREET         LOS ANGELES         90023         PLATE 700445         3068         Plates Foodurts, N.E.C.           DALI NOUSTRIES INC.         1558         ESPERANZA STREET         LOS ANGELES         90023         PLATE 700445         3068         Plates Foodurts, N.E.C.           UNR DEIGHT NOUSTRIES INC.         1262 ID EARGON Street         CARA STREET         9003         MANLTACURER COPLAST         90045         Plates Foodurts, N.E.C.           LAST IERSONALTIES, INC.         1262 ID EARGON Street         CARA STREET         90015         PLATE TO MANLTACURER AVENUES         90016         Plates Foodurts, N.E.C.           LAST IERSONALTIES, INC.         1262 MERE MARCON STREET         90016         PLATE TO MANLTACURER AVENUES         90016         PLATE TO MANLTACURER AVENUES         PLATE TO MANLTACURER AVENUES         PLATE TO MANLTACURER AVEN	,				,		,
DNIMEA, PLASTIC CORP         908 AVILA Street         LOS ANGELES         90012         Air Cond. & Raring, Equip. 6.8 \$4089         Plastics Products, N.E.C.           DAIR TOCONVERTERS INC.         1161         Y EVENUE 34         LOS ANGELES         90023         Printing, Class-Matel-Plastic, 273         Plastics, Fold, and Coated Page Bags           JOLINDUSTRIES, INC.         1538         ESPERAZA Siteset         LOS ANGELES         90023         Printing, Class-Matel-Plastic, 274         Plastics Fondurts, N.E.C.           VIEW REINCLO TASTICS INC.         1538         ESPERAZA Siteset         LOS ANGELES         90023         Plastics, Fondurts, N.E.C.           VIEW REINCLO TASTICS INC.         2083         FLASTICS MAURALITES, INC.         1258         VIEX Sites         90024         10024         Plastics, Fondurts, N.E.C.           VIEX REINCLO TASTICS INC.         2084         FLASTICS MAURALITES, INC.         1258         VIEX Sites         90019         FLASTICS MAURALITES, INC.         1258         VIEX Sites         901019         VIEX Sites <td>PRICE PFISTER</td> <td>11080 SUTTER Avenue</td> <td></td> <td></td> <td></td> <td></td> <td></td>	PRICE PFISTER	11080 SUTTER Avenue					
MARRICAN CASTER CORP         11.1         WAVENUE 34         LOS ANGELES         90031         MANUPACTURING PLASTIC 3089         Plastics Products, N.E.C.           ODAST CONVERTERS INC.         1531         ESPERANZA Street         LOS ANGELES         90023         Printing Glass Matel-Plastic 270         Pastics, Products         Plastics, Products           OWARD ELGITH INDUSTRIES, NC.         1538         ESPERANZA Street         LOS ANGELES         90023         LAIR X MUHACTURER OF PLASTI 3089         Plastics, Products         Plastics, Products           WIRCP DLASTICS, NC.         20821         DEAR MONTH         LOS ANGELES         90031         MANUPACTURER OF PLASTI 3089         Plastics Products, N.E.C.           PLASTI FERSONALTIES, INC.         1285         CROCKER Street         CHARBORT         Street         PLASTI FERSONALTIES, N.E.         EC.           PLASTI FERSONALTIES, INC.         1285         Street         PLARED         Street         PLASTI FERSONALTIES, N.E.         EC.           PLASTI FERSONALTIES, N.C.         1285         Street         PLARED         Street         PLASTI FERSONALTIES, PLASTI STREET         Street         PLASTI FERSONALTIES, PLASTI STREET         PLASTI FERSONALTIES, N.E.C.           PLASTI FERSONALTIES, N.C.         1285         Street         PLARED         PLASTI FERSONALTIES, PLASTI STREET         Stre	ADMIRAL PLASTIC CORP						'
Dial, INDUSTRIES, INC.         1538         ESPERANZA Sireet         LOS ANGELES         90022         PLASTIC MANUFACTURER         2086         Plastics From Products         N.C.           UW, REINHOLD PLASTICS INC.         873         CROCKER Street         LOS ANGELES         90032         Latex & Rubber Products         3086         Plastics Products, N.E. C.           UW, REINHOLD PLASTICS INC.         20821         DEARDORN Street         CHATSWORTH         90730         Plastics Products, N.E. C.           PLASTI ERRSONALITIES, INC.         1255         2023 Street         HARBOR CITV         90710         Plastics Products, N.E. C.           PLASTI ERRSONALITIES, INC.         1255         2062 EGDT Street         LOS ANGELES         90001         Plastics Products, N.E. C.           MICRODOT CONNECTORS         306 EGDT Street         LOS ANGELES         90001         Plastics Products, N.E. C.           MICRODOT CONNECTORS         306 EGDT Street         LOS ANGELES         90001         ADULT NOVELT MAULTACA3089         Plastics Products, N.E. C.           STUTEOB SLOES         4713         WJEFRERSON Boulevard         LOS ANGELES         90001         ADULT NOVELT MAULTACA3089         Plastics Products, N.E. C.           STUTEOB SLOES         4713         WJEFRERSON Boulevard         LOS ANGELES         90014         ADULT NOVELT <ma< td=""><td>AMERICAN CASTER CORP</td><td>141 W AVENUE 34</td><td>LOS ANGELES</td><td>90031</td><td></td><td></td><td>Plastics Products, N.E.C.</td></ma<>	AMERICAN CASTER CORP	141 W AVENUE 34	LOS ANGELES	90031			Plastics Products, N.E.C.
HOWARD LEIGHT INDUSTRIES         4011         Genes Construction         1086         Plastics Forducts         Plastics Forducts           W.R. REIN-OLD PLASTICS INC.         20821         DEARBORN Street         LOS ANGELES         90003         MANUFACTURER OF PLASTIC         3088         Plastics Products, N.E. C.           VASTI PERSONALITIES, INC.         1252         W225 Street         HARBOR CITY         90101         E.P.S. FOM MOLDER         3088         Plastics Forducts, N.E. C.           VASTI PERSONALITIES, INC.         1252         W225 Street         LOS ANGELES         90001         Plastics Poducts, N.E. C.           VESTERN OCLO THERMOPLASTICS         840         FORSTONE CONSCI Street         SVMPA         91030         Plastics Forducts, N.E. C.           UNRED SALES         90011         PLASTIC RECYCLING         3089         Plastics Poducts, N.E. C.           UNRED SALES         4713         WEFFERSONALINE, N.E.C.         20011         PLASTIC RECYCLING         3089         Plastics Poducts, N.E. C.           UNRED SALES         4713         WEFFERSONALINA         GRADULT NOVELTY MANUFACI 2089         Plastics Poducts, N.E. C.           UNRED SALES         4713         WEFFERSONALINA         GRADULT NOVELTY MANUFACI 2089         Plastics Poducts, N.E. C.           NETUFORM SOUTHWEST         M0109         <	COAST CONVERTERS INC.	1601 PERRINO Place	LOS ANGELES	90023	Printing: Glass-Matel-Plastic	2673	Plastics, Foil, and Coated Paper Bags
W.R. ERINFOLD PLASTICS INC.         8763         CROCKER Street         LOS ANGELES         90001         MANUFACTURER OF PLASTIG989         Plastics Products, N.E.C.           PLASTI DERSONALITIES, INC.         1228         V228 V322 Street         HARBOR CITY         90710         2F.P.S. FOAM MOLDER         3088         Plastics Foadurits, N.E.C.           PLASTI DERSONALITIES, INC.         1228         V328 V328 Street         HARBOR CITY         90712         Plastic Photocity, N.E.C.           PLASTI DERSONALITIES, INC.         1268 / 6046 Street         Symar         91332         Plastic Photocity, N.E.C.           WESTERN GOLD THERMOPLASTICS         840 E 607H Street         LOS ANGELES         90001         Plastics Products, N.E.C.           WICRODOT CONDECTORS         306 PLASADENA Avenue         SOUTH PASADENA         90016         ADULTACTURER PET         3089         Plastics Products, N.E.C.           NITED SALTS CORPORATION         840 E 607H Street         LOS ANGELES         90016         ADULT NVELTY MANACCIUS         9037         Clastics Products, N.E.C.           SAT CORTRACTING INC.         VAN GOGH         GRANADA HILLS         91335         PIPELINE REHABILITATION         3097         Custom Compounding of Purchased Plastics Resins           SNITUPORM SOUTHWEST         MH 109 - 147 FOX Street         MISSION HILLS         91340 <td< td=""><td>DIAL INDUSTRIES, INC.</td><td>1538 ESPERANZA Street</td><td>LOS ANGELES</td><td>90023</td><td>PLASTIC MANUFACTURER</td><td>3089</td><td>Plastics Products, N.E.C.</td></td<>	DIAL INDUSTRIES, INC.	1538 ESPERANZA Street	LOS ANGELES	90023	PLASTIC MANUFACTURER	3089	Plastics Products, N.E.C.
MICRO PLASTICS, INC.         2021         DEARBORN Street         CHATSWORTH         9131         PLASTIC MOLINIG         3038         Plastics Products, N.E.C.           PLASTI PERSONALITES, INC.         1225         V322 Street         HARBOR CTTV         90710         EP.S. FOAM MOLDER         3089         Plastics Products, N.E.C.           Spears Manufacturing Co.         1583         Olden Street         LOS ANGELES         3090         Plastics Products, N.E.C.           WERTERN GOLD THERMOPLASH         S04         FOAM STACK         3089         Plastics Products, N.E.C.           CONTRACTORS         306         PASADENA Avenue         SOUTH PASADENA         91030         MANUFACTURER OF CIRCU 3089         Plastics Products, N.E.C.           CONTRACTORS         VIA STEPERSON Boulevard         LOS ANGELES         90010         PLASTIC REVYT WANUFAC 3089         Plastics Products, N.E.C.           CAT CONTRACTORS INC./UTLY         VIA STEPERSON BOULEvard         GRANDA HILLS         9134         CARED IN PLACE SEVER PL 3087         Custom Compounding of Purchased Plastics Resins           NSTUFORM SOUTHWEST         MH 112 - 105 KNOB HILL Drive         SHERMAN OAKS         91342         PIPELINE REHABILITATION         3087         Custom Compounding of Purchased Plastics Resins           NSTUFORM SOUTHWEST         MH 1109 - 107 KY Streed         MSISION HILLS	HOWARD LEIGHT INDUSTRIES	4061 GLENCOE Avenue	MARINA DEL REY	90292		3086	Plastics Foam Products
MICRO PLASTICS, INC.         2021         DEARBORN Street         CHATSWORTH         9131         PLASTIC MOLINIG         3038         Plastics Products, N.E.C.           PLASTI PERSONALITES, INC.         1225         V322 Street         HARBOR CTTV         90710         EP.S. FOAM MOLDER         3089         Plastics Products, N.E.C.           Spears Manufacturing Co.         1583         Olden Street         LOS ANGELES         3090         Plastics Products, N.E.C.           WERTERN GOLD THERMOPLASH         S04         FOAM STACK         3089         Plastics Products, N.E.C.           CONTRACTORS         306         PASADENA Avenue         SOUTH PASADENA         91030         MANUFACTURER OF CIRCU 3089         Plastics Products, N.E.C.           CONTRACTORS         VIA STEPERSON Boulevard         LOS ANGELES         90010         PLASTIC REVYT WANUFAC 3089         Plastics Products, N.E.C.           CAT CONTRACTORS INC./UTLY         VIA STEPERSON BOULEvard         GRANDA HILLS         9134         CARED IN PLACE SEVER PL 3087         Custom Compounding of Purchased Plastics Resins           NSTUFORM SOUTHWEST         MH 112 - 105 KNOB HILL Drive         SHERMAN OAKS         91342         PIPELINE REHABILITATION         3087         Custom Compounding of Purchased Plastics Resins           NSTUFORM SOUTHWEST         MH 1109 - 107 KY Streed         MSISION HILLS	L.W. REINHOLD PLASTICS INC.			90003			
PLAST DFRSONALTIES, NC.         1225         W 252 Street         HARBOR CITY         9070         E.P.S. FOAM MOLDER         3086         Plastics Foam Products, N.E.C.           MESTERN GOLD THERMOPLASTICS         840 E 60TH Street         LOS ANGELES         90001         Plastics         Plastics </td <td>MICRO PLASTICS, INC.</td> <td>20821 DEARBORN Street</td> <td>CHATSWORTH</td> <td>91311</td> <td></td> <td></td> <td></td>	MICRO PLASTICS, INC.	20821 DEARBORN Street	CHATSWORTH	91311			
Spans Manufacturing Co.         15853         Olden Street         Symar         Plastic Pipe Filtings & Valve M3089         Plastics Products, N.E.C.           WESTERN GOLD THERMOPLASTICS         B40 E 6DTH Street         LOS ANGELES         90011         Plastics         90012         Plastics         Plastics         Plastics         Plastics         Products, N.E.C.           VESTERN GOLD THERMOPLASTICS         B40 E 6DTH Street         LOS ANGELES         90011         Plastics         Plastics         Products, N.E.C.           VESTERN GOLD THERMOPLASTICS         B40 E 6DTH Street         LOS ANGELES         90011         Plastics         Plastics         Products, N.E.C.           VESTERN GOLD THERMOPLASTICS         VAI ENGOLE         00011         PLASTIC REVCAUELTY MANUECS         91335         Plastics Products, N.E.C.         Valve Manufacturing Ca.	PLASTI PERSONALITIES, INC.	1225 W 252 Street		90710			
WESTERN GOLD THERMOPLASTICS         840 E 60TH Street         LOS ANGELES         9001         Plastics         3089         Plastics Products, N.E.C.           URCRODT CONNECTORS         306 F ASADENA Avenue         SOUTH PASADENA         9103         MAUVACTURER FOC FCIRCU309         Plastics Products, N.E.C.           EXOPLAST CORPORATION         840 E 60TH Street         LOS ANGELES         9001         PLASTIC RECYCLING         3089         Plastics Products, N.E.C.           INTED SALES         4713 W JEFFERSON Boulevard         LOS ANGELES         9001         PLASTIC RECYCLING         Plastics Products, N.E.C.           STUFORM SOUTHWEST         8000 F RESEDA Boulevard         LOS ANGELES         9133         PleTLINE REHABILITATION         0007         Custom Compounding of Purchased Plastics Resins           NSTUFORM SOUTHWEST         MH 09- 147 FOX Street         SYLMAR         91420         PleTLINE REHABILITATION 3007         Custom Compounding of Purchased Plastics Resins           NSTUFORM SOUTHWEST         MH 09- 147 FOX Street         MISSION HILLS         91340         PleTLINE REHABILITATION 3007         Custom Compounding of Purchased Plastics Resins           NSTUFORM SOUTHWEST         MH 09- 147 FOX Street         MISSION HILLS         91340         PleTLINE REHABILITATION 3067         Custom Compounding of Purchased Plastics Resins           NSTUFORM SOUTHWEST         MH 09	,						
MICRODOT CONNECTORS         306         PASADEN Avenue         SOUTH PASADENA         91030         MANUFACTURER OF CIRCUI 3089         Plastics Products. N.E.C.           COPLAST CORPORATION         840 E 60TH Street         LOS ANGELES         9001         PLASTIC RECYCLING         3089         Plastics Products. N.E.C.           CAT CONTRACTING INC.         VAN GOGH         LOS ANGELES         9001         PLASTIC RECYCLING         3087         Custom Compounding of Purchased Plastics Resins           AST CONTRACTING INC. U112         14700         HUBBARD Street         SYLMAR         91422         CABED IN FLACE SEVER P180367         Custom Compounding of Purchased Plastics Resins           NSTUFORM SOUTHWEST         MH 112 - 105 KNOB HILL Drive         SHERMAN OAKS         91422         CABED IN FLACE SEVER P180367         Custom Compounding of Purchased Plastics Resins           NSTUFORM SOUTHWEST         MH 039 - 147 FOX Street         MISSION HILLS         91340         PIPELINE REHABILTATION 3067         Custom Compounding of Purchased Plastics Resins           NSTUFORM SOUTHWEST         MH 039 - 035 INDAIN HILLS Street         MISSION HILLS         91340         PIPELINE REHABILTATION 3067         Custom Compounding of Purchased Plastics Resins           NSTUFORM SOUTHWEST         MH 039 - 035 INDAIN HILLS Street         NSTUFORM SOUTHWEST         MH 039 - 035 INDAIN HILLS         91340         PIPELINE REHABIL		840 E 60TH Street	LOS ANGELES	90001			
ECOPLAST CORPORATION         940 E 607H Street         LOS ANGELES         90001         PLASTIC RECYCLING         3089         Plastics Products, N.E.C.           CAT CONTRACTING INC.         VAN GOGH         GRANADA HILLS         90164         ADULT NOVELTY MANUFACI 3089         Plastics Products, N.E.C.           CAT CONTRACTING INC.         VAN GOGH         GRANADA HILLS         91344         CUPEED IN PLACE PIPE         3087         Custom Compounding of Purchased Plastics Resins           NSTUFORM SOUTHWEST         MH 102 - 105 KNOB HILL Drive         SHERMAN OAKS         91423         PIPELINE REHABILITATION         3087         Custom Compounding of Purchased Plastics Resins           NSTUFORM SOUTHWEST         MH 039 - 033 INDIAN HILLS         SHERMAN OAKS         91423         PIPELINE REHABILITATION         3087         Custom Compounding of Purchased Plastics Resins           NSTUFORM SOUTHWEST         MH 039 - 033 INDIAN HILLS         SHEMAN OAKS         91424         PIPELINE REHABILITATION         3087         Custom Compounding of Purchased Plastics Resins           NSTUFORM SOUTHWEST         MH 039 - 033 INDIAN HILLS         SHEMAN OAKS         91404         PIPELINE REHABILITATION         3087         Custom Compounding of Purchased Plastics Resins           NSTUFORM SOUTHWEST         HYD PARK BUZAN NESSAV.         LOS ANGELES         90004         PIPELINE REHABILITATION         3087 </td <td>MICRODOT CONNECTORS</td> <td>306 PASADENA Avenue</td> <td></td> <td>91030</td> <td>MANUFACTURER OF CIRCU</td> <td>3089</td> <td></td>	MICRODOT CONNECTORS	306 PASADENA Avenue		91030	MANUFACTURER OF CIRCU	3089	
CAT CONTRACTING INC.         VAN GOGH         GRANADA HILLS         91344         CURED IN PLACE PIPE         3087         Custom Compounding of Purchased Plastics Resins           NGTUFORM SOUTHWEST         14700         HUBBARD Street         SYLMAR         9132         CAREDIN PLACE SEVER Pl 3087         Custom Compounding of Purchased Plastics Resins           NSTUFORM SOUTHWEST         MH 109 - 147 FOX Street         MISSION HILLS         91424         PIPELINE REHABILITATION         3087         Custom Compounding of Purchased Plastics Resins           NSTUFORM SOUTHWEST         MH 039 - 147 FOX Street         MISSION HILLS         91440         PIPELINE REHABILITATION         3087         Custom Compounding of Purchased Plastics Resins           NSTUFORM SOUTHWEST         MH 039 - 035 INDIAH HILLS Street         MISSION HILLS         91340         PIPELINE REHABILITATION         3087         Custom Compounding of Purchased Plastics Resins           NSTUFORM SOUTHWEST         MH 039 - 035 INDIAH HILLS Street         MISSION PILLS         91340         PIPELINE REHABILITATION         3087         Custom Compounding of Purchased Plastics Resins           NSTUFORM SOUTHWEST         MH 039 - 035 INDIAH HILLS Street         LOS ANGELES         9007         PIPELINE REHABILITATION         3087         Custom Compounding of Purchased Plastics Resins           NSTUFORM SOUTHWARE         1685 Stroet         North Hollywood </td <td>ECOPLAST CORPORATION</td> <td></td> <td></td> <td>90001</td> <td></td> <td></td> <td></td>	ECOPLAST CORPORATION			90001			
CAT CONTRACTING INC.         VAN GOGH         GRANADA HILLS         91344         CURED IN PLACE PIPE         3087         Custom Compounding of Purchased Plastics Resins           NGTUFORM SOUTHWEST         14700         HUBBARD Street         SYLMAR         9132         CAREDIN PLACE SEVER Pl 3087         Custom Compounding of Purchased Plastics Resins           NSTUFORM SOUTHWEST         MH 109 - 147 FOX Street         MISSION HILLS         91424         PIPELINE REHABILITATION         3087         Custom Compounding of Purchased Plastics Resins           NSTUFORM SOUTHWEST         MH 039 - 147 FOX Street         MISSION HILLS         91440         PIPELINE REHABILITATION         3087         Custom Compounding of Purchased Plastics Resins           NSTUFORM SOUTHWEST         MH 039 - 035 INDIAH HILLS Street         MISSION HILLS         91340         PIPELINE REHABILITATION         3087         Custom Compounding of Purchased Plastics Resins           NSTUFORM SOUTHWEST         MH 039 - 035 INDIAH HILLS Street         MISSION PILLS         91340         PIPELINE REHABILITATION         3087         Custom Compounding of Purchased Plastics Resins           NSTUFORM SOUTHWEST         MH 039 - 035 INDIAH HILLS Street         LOS ANGELES         9007         PIPELINE REHABILITATION         3087         Custom Compounding of Purchased Plastics Resins           NSTUFORM SOUTHWARE         1685 Stroet         North Hollywood </td <td>UNITED SALES</td> <td>4713 W JEFFERSON Boulevard</td> <td>LOS ANGELES</td> <td>90016</td> <td>ADULT NOVELTY MANUFAC</td> <td>3089</td> <td>Plastics Products, N.E.C.</td>	UNITED SALES	4713 W JEFFERSON Boulevard	LOS ANGELES	90016	ADULT NOVELTY MANUFAC	3089	Plastics Products, N.E.C.
NSITUPORM SOUTHWEST         8000         RESEDA Boulevard         LOS ANGELES         9133         PIPELINE REHABILITATION         3087         Custom Compounding of Purchased Plastics Resins           CAT CONTRACTING INC./112         MT00         HUBBARD Street         SYLMAR         9142         CARED IN PLACE SEVER PEI 3087         Custom Compounding of Purchased Plastics Resins           NSITUPORM SOUTHWEST         MH 102 - 105 KNOB HILL Drive         SHERMAN OAKS         9142         PIPELINE REHABILITATION         3087         Custom Compounding of Purchased Plastics Resins           NSITUPORM SOUTHWEST         MH 039 - 147 FOX Street         MISSION HILLS         91340         PIPELINE REHABILITATION         3087         Custom Compounding of Purchased Plastics Resins           NSITUPORM SOUTHWEST         HYDE PARK BL/VAN NESSAV.         LOS ANGELES         91340         PIPELINE REHABILITATION         3087         Custom Compounding of Purchased Plastics Resins           ATC CONTRACTING INC         PROJECTS LISTED IN PERMIT         LOS ANGELES         91042         CURED IN PLACE SIPE/SEW 3087         Custom Compounding of Purchased Plastics Resins           ATT CONTRACATING INC         PROJECTS LISTEN DIVEST         NOT HOHIVEST         North HoliVaod         91605         PiPELINE REHABILITATION         3087         Custom Compounding of Purchased Plastics Resins           NSTUPORM         13246 <td< td=""><td>CAT CONTRACTING INC.</td><td></td><td></td><td>91344</td><td></td><td></td><td></td></td<>	CAT CONTRACTING INC.			91344			
NSITUFORM SOUTHWEST         MH 112 - 105 KNOB HILL Drive         SHERMAN OAKS         91423         PIPELINE REHABILITATION         3087         Custom Compounding of Purchased Plastics Resins           NSITUFORM SOUTHWEST         MH 039 - 033 INDIAN HILLS Street         MISSION HILLS         91340         PIPELINE REHABILITATION         3087         Custom Compounding of Purchased Plastics Resins           NSITUFORM SOUTHWEST         HYDE PARK BL/VAN NESSAV.         LOS ANGELES         90043         PIPELINE REHABILITATION         3087         Custom Compounding of Purchased Plastics Resins           NSITUFORM SOUTHWEST         HYDE PARK BL/VAN NESSAV.         LOS ANGELES         90043         PIPELINE REHABILITATION         3087         Custom Compounding of Purchased Plastics Resins           ACI CONTRACTING INC         PROJECTS LISTED IN PERMIN         LOS ANGELES         90047         PIPELINE CLEAN. DIV OF A1 3087         Custom Compounding of Purchased Plastics Resins           ASTRO PAK, FLOW-LINE SERVICES         1150         W ASHINGTON Boulevard         LOS ANGELES         90007         PIPELINE CLEAN. DIV OF A1 3087         Custom Compounding of Purchased Plastics Resins           NSITUFORM TECHNOLOGIES, INC.         6328         BARTEE Avenue         ARLETA         91331         MANUFACTURER OF DOC RCD 3089         Plastics Products, N.E.C.           NSITUFORM TECHNOLOGIES, INCRODOT COI 306         PAsterna         RE	INSITUFORM SOUTHWEST	8000 RESEDA Boulevard		91335			
NSITUFORM SOUTHWEST         MH 112 - 105 KNOB HILL Drive         SHERMAN OAKS         91423         PIPELINE REHABILITATION         3087         Custom Compounding of Purchased Plastics Resins           NSITUFORM SOUTHWEST         MH 039 - 033 INDIAN HILLS Street         MISSION HILLS         91340         PIPELINE REHABILITATION         3087         Custom Compounding of Purchased Plastics Resins           NSITUFORM SOUTHWEST         HYDE PARK BL/VAN NESSAV.         LOS ANGELES         90043         PIPELINE REHABILITATION         3087         Custom Compounding of Purchased Plastics Resins           NSITUFORM SOUTHWEST         HYDE PARK BL/VAN NESSAV.         LOS ANGELES         90043         PIPELINE REHABILITATION         3087         Custom Compounding of Purchased Plastics Resins           ACI CONTRACTING INC         PROJECTS LISTED IN PERMIN         LOS ANGELES         90047         PIPELINE CLEAN. DIV OF A1 3087         Custom Compounding of Purchased Plastics Resins           ASTRO PAK, FLOW-LINE SERVICES         1150         W ASHINGTON Boulevard         LOS ANGELES         90007         PIPELINE CLEAN. DIV OF A1 3087         Custom Compounding of Purchased Plastics Resins           NSITUFORM TECHNOLOGIES, INC.         6328         BARTEE Avenue         ARLETA         91331         MANUFACTURER OF DOC RCD 3089         Plastics Products, N.E.C.           NSITUFORM TECHNOLOGIES, INCRODOT COI 306         PAsterna         RE	CAT CONTRACTING INC./U112	14700 HUBBARD Street	SYLMAR	91342	CARED IN PLACE SEWER P	3087	Custom Compounding of Purchased Plastics Resins
NSITUFORM SOUTHWEST         MH 099 - 147 FOX Street         MISSION HILLS         91340         PIPELINE REHABILITATION         3087         Custom Compounding of Purchased Plastics Resins           NSITUFORM SOUTHWEST         MH 039 - 035 INDIAN HILLS         MISSION HILLS         91340         PIPELINE REHABILITATION         3087         Custom Compounding of Purchased Plastics Resins           NSITUFORM SOUTHWEST         HYDE PARK BLVAN NESSAV.         LOS ANGELES         90043         PIPELINE REHABILITATION         3087         Custom Compounding of Purchased Plastics Resins           Amorcast Products Company         13246         Satico Street         North Hollywood         91605         Manufacture of Underground         3087         Custom Compounding of Purchased Plastics Resins           TRUTH HARDWARE         1268         VAN NUYS Boulevard         LOS ANGELES         90007         PIPELINE REHABILITATION         3087         Custom Compounding of Purchased Plastics Resins           TRUTH HARDWARE         1268         VAN VIYS Boulevard         LOS ANGELES         90007         MAIUFACTURER OF COREI 3089         Plastics Products, N.E.C.           CALIFORNIA PLASTICARD, INC.         1380         WASHINGTON Boulevard         LOS ANGELES         90001         MAIUFACTURER OF COREI 3089         Plastics Products, N.E.C.           CALFORNIA PLASTICARD, INC.         1380         WASHINGTON BOULev	INSITUFORM SOUTHWEST		SHERMAN OAKS				
NSITUFORM SOUTHWEST         MH 039 - 035 INDIAN HILLS Street         MISSION HILLS         91340         PIPELINE REHABILITATION         3087         Custom Compounding of Purchased Plastics Resins           NSITUFORM SOUTHWEST         HYDE PARK BL/AN NESSAV,         LOS ANGELES         9003         PIPELINE REHABILITATION         3087         Custom Compounding of Purchased Plastics Resins           ACT CONTRACTING INC         PROJECTS LISTED IN PERMIT         LOS ANGELES         91324         CURED IN PLACE PIPE/SEW 3087         Custom Compounding of Purchased Plastics Resins           ASTRO PAK, FLOW-LINE SERVICES         1150         WJEFERSON Boulevard         LOS ANGELES         90007         MANUFACTURER OF DOOR         3089         Plastics Products, N.E.C.           NSITUFORM TECHNOLOGIES, INC         623         BARTE Avenue         ARLETA         91331         MANUFACTURER OF DOOR         3089         Plastics Products, N.E.C.           NSITUFORM TECHNOLOGIES, INC         623         BARTE Avenue         ARLETA         91331         TRENCHLESS PIPE REHABIL3087         Custom Compounding of Purchased Plastics Resins           NGTUGTOR MTECHNOLOGIES, INC         623         BARTE Avenue         ARLETA         91331         TRENCHLESS PIPE REHABIL3087         Custom Compounding of Purchased Plastics Resins           YLOS CLECTONICS, MICRODOT CO         306         Plastics, Products, N.E.C.         <							
CAT CONTRACTING INC         PROJECTS LISTED IN PERMIT         LOS ANGELES         91324         CURED IN PLACE PIPE/SEW 3087         Custom Compounding of Purchased Plastics Resins           Armorcast Products Company         13246         Saticoy Street         North Hollywood         91605         Manufacture of Underground L3089         Plastics Products, N.E.C.           ASTRO PAK, FLOW-LINE SERVICES         1150         WJEFFERSON Boulevard         LOS ANGELES         90007         PIPELINE CLEAN. DIV OF A 13087         Custom Compounding of Purchased Plastics Resins           RUTH HARDWARE         12685         VAN NUYS Boulevard         LOS ANGELES         90007         PIPELINE CLEAN. DIV OF A 13087         Custom Compounding of Purchased Plastics Resins           NITUFORM TECHNOLOGIES, INC.         1380         WASHINGTON Boulevard         LOS ANGELES         90001         PLASTIC INJECTION MOLDIN 3089         Plastics Products, N.E.C.           Rehrig Pacific Company         11949         Sherman Road         North Hollywood         91635         Wanutexits, N.E.C.         Custom Compounding of Purchased Plastics Resins           YCO ELECTRONICS, MICRODOT CO 306         PASADENA venue         SOUTH PASADENA         91030         CIRCUIT CONNECTORS         3089         Plastics Products, N.E.C.           Arrisi Auto Repair         10726         S Avalon Boulevard         Los Angeles         90061	INSITUFORM SOUTHWEST						
CAT CONTRACTING INC         PROJECTS LISTED IN PERMIT         LOS ANGELES         91324         CURED IN PLACE PIPE/SEW 3087         Custom Compounding of Purchased Plastics Resins           Armorcast Products Company         13246         Saticoy Street         North Hollywood         91605         Manufacture of Underground J 3089         Plastics Products, N.E.C.           ASTRO PAK, FLOW-LINE SERVICES         1150 W JEFERSON Boulevard         LOS ANGELES         90007         PIFELINE CLEAN. DIV OF A I 3087         Custom Compounding of Purchased Plastics Resins           TRUTH HARDWARE         12685 VAN NUYS Boulevard         PACOMA         91331         MANUFACTURER OF OCOR 3089         Plastics Products, N.E.C.           CALIFORNIA PLASTICARD, INC.         1380 W WASHINGTON Boulevard         LOS ANGELES         90001         PLASTIC INJECTION MOLDIN 3089         Plastics Products, N.E.C.           NSITUFORM TECHNOLOGIES, INC.         9623         BARTEE Avenue         ARLETA         91331         TRENCHLESS PIPE REHABIL 3087         Custom Compounding of Purchased Plastics Resins           PLASTOPAN         812 E 597H Street         LOS ANGELES         90001         PLASTIC INJECTION MOLDIN 3089         Plastics Products, N.E.C.           TYCO ELECTRONICS, MICRODOT CO         306 PASADENA venue         SOUTH PASADENA         91030         CIRCUIT CONNECTORS         3089         Plastics Products, N.E.C.      <	INSITUFORM SOUTHWEST	HYDE PARK BL/VAN NESSAV.	LOS ANGELES	90043	PIPELINE REHABILITATION	3087	Custom Compounding of Purchased Plastics Resins
Armoreast Products Company13246Saticoy StreetNorth Hollywood91605Manufacture of Underground [3089Plastics Products, N.E.C.ASTRO PAK, FLOW-LINE SERVICES1150W JEFFERSON BoulevardLOS ANGELES90007PIPELINE CLEAN. DIV OF A 13087Custom Compounding of Purchased Plastics ResinsRTUTH HARDWARE12885VAN NUYS BoulevardLOS ANGELES90007MANUFACTURER OF DORD 3089Plastics Products, N.E.C.CALIFORNIA PLASTICARD, INC.1380WWSHINGTON BoulevardLOS ANGELES90007MANUFACTURER OF CREDI 3089Plastics Products, N.E.C.NSITUFORM TECHNOLOGIES, INC.9623BARTEE AvenueARLETA91331TRENCHLESS PIPE REHABIL 3087Custom Compounding of Purchased Plastics ResinsPLASTICANN812E 59TH StreetLOS ANGELES90001PLASTIC INJECTION MOLDIN 3089Plastics Products, N.E.C.Rehrig Pacific Company11949Sherman RoadNorth Hollywood91605Warehousing, Storage, Assem 3089Plastics Products, N.E.C.TYCO ELECTRONICS, MICRODOT CO 306PASADENA AvenueSOUTH PASADENA91030CIRCUIT CONNECTORS3087Custom Compounding of Purchased Plastics ResinsArrisil Auto Repair10726S Avalon BoulevardLos Angeles90061Auto Repair3087Custom Compounding of Purchased Plastics ResinsThermo Fisher Scientific/Samco Sci. Corr1050Arrok ovenueSan Fernando91340Mfg Disposable Plastic Labwal 3089Plastics Products, N.E.C.Western States Packaging Inc13276Paxton StreetLos Ang	CAT CONTRACTING INC	PROJECTS LISTED IN PERMIT	LOS ANGELES	91324	CURED IN PLACE PIPE/SEW	3087	Custom Compounding of Purchased Plastics Resins
TRUTH HARDWARE12685VAN NUYS BoulevardPACOIMA91331MANUFACTURER OF DOOR3089Plastics Products, N.E.C.CALLFORNIA PLASTICARD, INC.1380 W WASHINGTON BoulevardLOS ANGELES90007MANUFACTURER OF CREDI3089Plastics Products, N.E.C.NSITUFORM TECHNOLOGIES, INC.9623BARTEE AvenueARLETA91331TRENCHLESS PIPE REHABIL70007Custom Compounding of Purchased Plastics ResinsPLASTOPAN812E 59TH StreetLOS ANGELES90001PLASTIC INJECTION MOLDIN3089Plastics Products, N.E.C.Rehrig Pacific Company11949Sherman RoadNorth Hollywood91605Warehousing, Storage, Assem 3089Plastics Products, N.E.C.YCCO ELECTRONICS, MICRODOT CO 306PASADENA AvenueSOUTH PASADENA91030CIRCUIT CONNECTORS3089Plastics Products, N.E.C.Arrsil Auto Repair10726S Avalon BoulevardLos Angeles90061Auto Repair3087Custom Compounding of Purchased Plastics ResinsArrsil Auto Repair10726S Avalon BoulevardLos Angeles90061Auto Repair3087Custom Compounding of Purchased Plastics ResinsMerin Steiner Scientific/Samoo Sci. Cori 1050Arroy o AvenueSan Fernando91340Mfg Disposable Plastic Labwai 3089Plastics Products, N.E.CW. REINHOLD PLASTICE XTRUDERS739E 62ND StreetLos Angeles90003Plastics Manufacturer3089Plastics Froducts, N.E.CW. REINHOLD PLASTICE XTRUDERS739E 62ND StreetLOS ANGELES90001	Armorcast Products Company	13246 Saticoy Street	North Hollywood	91605			
CALIFORNIA PLASTICARD, INC.1380WWASHINGTON BoulevardLOS ANGELES90007MANUFACTURER OF CREDI3089Plastics Products, N.E.C.NSITUFORM TECHNOLOGIES, INC.9623BARTEE AvenueARLETA9131TRENCHLESS PIPE REHABILOutputOutputCustom Compounding of Purchased Plastics ResinsPLASTOPAN812E39TH StreetLOS ANGELES90001PLASTIC INJECTION MOLDIN 3089Plastics Products, N.E.C.Rehrig Pacific Company11949Sherman RoadNorth Hollywood91605Warehousing, Storage, Assem 3089Plastics Products, N.E.C.Arrsil Auto Repair10726S Avalon BoulevardLos Angeles90061Auto Repair3087Custom Compounding of Purchased Plastics ResinsThermo Fisher Scientific/Samco Sci. Cor1050Arroyo AvenueSan Fernando91340Mfg Disposable Plastic Labwar 3089Plastics Products, N.E.C.Western States Packaging Inc13276Paxton StreetLos Angeles90001Mfg Disposable Plastic Labwar 3089Plastics Products, N.E.C.Vestern States Packaging Inc13276Paxton StreetLos Angeles90013Plastics Manufacturer3089Plastics Products, N.E.C.POLY PAK AMERICA INC2339E WASHINGTON BoulevardLOS ANGELES900013089Plastics Products, N.E.C.Vestern States Packaging Inc13276Paxton StreetLos Angeles9131E673Plastics Products, N.E.C.POLY PAK AMERICA INC2339E WASHINGTON BoulevardLOS ANGELES900233089Plastics Produc	ASTRO PAK, FLOW-LINE SERVICES	1150 W JEFFERSON Boulevard	LOS ANGELES	90007	PIPELINE CLEAN. DIV OF A	3087	Custom Compounding of Purchased Plastics Resins
NSITUFORM TECHNOLOGIES, INC.9623BARTEE AvenueARLETA91331TRENCHLESS PIPE REHABIL3087Custom Compounding of Purchased Plastics ResinsPLASTOPAN812E 59TH StreetLOS ANGELES90001PLASTIC INJECTION MOLDIN3089Plastics Products, N.E.C.Rehrig Pacific Company11949Sherman RoadNorth Hollywood91605Warehousing, Storage, Assem3089Plastics Products, N.E.C.YCO ELECTRONICS, MICRODOT COI 306PASADENA AvenueSOUTH PASADENA91030CIRCUIT CONNECTORS3089Plastics Products, N.E.C.Arrsil Auto Repair10726S Avalon BoulevardLos Angeles90061Auto Repair3087Custom Compounding of Purchased Plastics ResinsThermo Fisher Scientific/Samco Sci. Cori 1050Arroyo AvenueSan Fernando91340Mfg Disposable Plastic Labwa3089Plastics Products, N.E.C.W. REINHOLD PLASTICS, INC8763Crocker StreetLos Angeles90001Mfg Disposable Plastic Labwa3089Plastics Froducts, N.E.C.Western States Packaging Inc13276Paxton StreetLos Angeles913312673Plastics Froducts, N.E.C.POLY PAK AMERICA INC2939E WASHINGTON BoulevardLOS ANGELES900233089Plastics Products, N.E.C.PLASTIC SLIP4489BANDINI BoulevardLOS ANGELES900232673Plastics Products, N.E.C.PLY PAK AMERICA INC2939E WASHINGTON BoulevardLOS ANGELES900232673Plastics Products, N.E.C.PLASTICS941 <td>TRUTH HARDWARE</td> <td>12685 VAN NUYS Boulevard</td> <td>PACOIMA</td> <td>91331</td> <td>MANUFACTURER OF DOOR</td> <td>3089</td> <td>Plastics Products, N.E.C.</td>	TRUTH HARDWARE	12685 VAN NUYS Boulevard	PACOIMA	91331	MANUFACTURER OF DOOR	3089	Plastics Products, N.E.C.
PLASTOPAN812 E 59TH StreetLOS ANGELES90001PLASTIC INJECTION MOLDIN 3089Plastics Products, N.E.C.Rehrig Pacific Company11949Sherman RoadNorth Hollywood91605Warehousing, Storage, Assem 3089Plastics Products, N.E.C.TYCO ELECTRONICS, MICRODOT COI 306PASADENA AvenueSOUTH PASADENA91030CIRCUIT CONNECTORS3089Plastics Products, N.E.C.Arrsil Auto Repair10726S Avalon BoulevardLos Angeles90061Auto Repair3087Custom Compounding of Purchased Plastics ResinsArrsil Auto Repair10726S Avalon BoulevardLos Angeles90061Auto Repair3087Custom Compounding of Purchased Plastics ResinsThermo Fisher Scientific/Samco Sci. Cur 1050Arroy AvenueSan Fernando91340Mfg Disposable Plastic Labwar 3089Plastics Products, N.E.C W. REINHOLD PLASTICS, INC8763Crocker StreetLos Angeles90001Auto Repair3087Plastics Products, N.E.C.Western States Packaging Inc13276Paxon StreetLos Angeles9000110899Plastics Products, N.E.C.POLY PAK AMERICA INC2939E WASHINGTON BoulevardLOS ANGELES900233089Plastics Products, N.E.C.PLASTICS941W 140TH StreetLOS ANGELES900633089Plastics Products, N.E.C.LEX-ART, INC211W 140TH StreetLOS ANGELES900633089Plastics Products, N.E.C.JNITED SALES941N EASTERNLOS ANGELES900633089Plast	CALIFORNIA PLASTICARD, INC.	1380 W WASHINGTON Boulevard	LOS ANGELES	90007	MANUFACTURER OF CREDI	3089	Plastics Products, N.E.C.
PLASTOPAN812 E 59TH StreetLOS ANGELES90001PLASTIC INJECTION MOLDIN 3089Plastics Products, N.E.C.Rehrig Pacific Company11949Sherman RoadNorth Hollywood91605Warehousing, Storage, Assem 3089Plastics Products, N.E.C.TYCO ELECTRONICS, MICRODOT COI 306PASADENA AvenueSOUTH PASADENA91030CIRCUIT CONNECTORS3089Plastics Products, N.E.C.Arrsil Auto Repair10726S Avalon BoulevardLos Angeles90061Auto Repair3087Custom Compounding of Purchased Plastics ResinsArrsil Auto Repair10726S Avalon BoulevardLos Angeles90061Auto Repair3087Custom Compounding of Purchased Plastics ResinsThermo Fisher Scientific/Samco Sci. Cur 1050Arroy AvenueSan Fernando91340Mfg Disposable Plastic Labwai 3089Plastics Products, N.E.C W. REINHOLD PLASTICS, INC8763Crocker StreetLos Angeles90031Plastics Manufacturer3089Plastics Products, N.E.C.Western States Packaging Inc13276Paxon StreetLos Angeles90013089Plastics Products, N.E.C.POLY PAK AMERICA INC2939E WASHINGTON BoulevardLOS ANGELES900233089Plastics Products, N.E.C.PLASTICS941N 40TH StreetLOS ANGELES900633089Plastics Products, N.E.C.LEX-ART, INC211W 140TH StreetLOS ANGELES900633089Plastics Products, N.E.C.JNITED SALES941N Edferson BoulevardLOS ANGELES90063	INSITUFORM TECHNOLOGIES, INC.	9623 BARTEE Avenue	ARLETA	91331	TRENCHLESS PIPE REHABI	3087	Custom Compounding of Purchased Plastics Resins
TYCO ELECTRONICS, MICRODOT CO306PASADENA AvenueSOUTH PASADENA91030CIRCUIT CONNECTORS3089Plastics Products, N.E.C.Arrsil Auto Repair10726S Avalon BoulevardLos Angeles90061Auto Repair3087Custom Compounding of Purchased Plastics ResinsArrsil Auto Repair10726S Avalon BoulevardLos Angeles90061Auto Repair3087Custom Compounding of Purchased Plastics ResinsThermo Fisher Scientific/Samco Sci. Cor1050Arroyo AvenueSan Fernando91340Mfg Disposable Plastic Labwai3089Plastics Products, N.E.C.L. W. REINHOLD PLASTICS, INC8763Crocker StreetLos Angeles9100312673Plastics Froducts, N.E.C.Western States Packaging Inc13276Paxton StreetLos Angeles910312673Plastics Products, N.E.C.POLY PAK AMERICA INC2939E WASHINGTON BoulevardLOS ANGELES900233089Plastics Products, N.E.C.CORTIFIBER CORP4489BANDINI BoulevardLOS ANGELES900232673Plastics, Foil, and Coated Paper BagsPLEX-ART, INC211W 140TH StreetLOS ANGELES900613089Plastics Products, N.E.C.UNITED SALES4713W Jefferson BoulevardLos Angeles900613089Plastics Products, N.E.C.UNITED SALES4713W Jefferson BoulevardLos Angeles900613089Plastics Products, N.E.C.UNITED SALES4713W Jefferson BoulevardLos Angeles900613089Pla	PLASTOPAN	812 E 59TH Street	LOS ANGELES	90001			Plastics Products, N.E.C.
Arrsil Auto Repair10726 S Avalon BoulevardLos Angeles90061Auto Repair3087Custom Compounding of Purchased Plastics ResinsArrsil Auto Repair10726 S Avalon BoulevardLos Angeles90061Auto Repair3087Custom Compounding of Purchased Plastics ResinsThermo Fisher Scientific/Samco Sci. Cort 1050Arroyo AvenueSan Fernando91340Mfg Disposable Plastic Labwal 3089Plastics Products, N.E.C W. REINHOLD PLASTICS, INC8763Crocker StreetLos Angeles90031Plastics Manufacturer3089Plastics Products, N.E.C W. REINHOLD PLASTIC EXTRUDERS739 E 62ND StreetLos Angeles913312673Plastics, Foil, and Coated Paper BagsABCO PLASTIC EXTRUDERS739 E 62ND StreetLOS ANGELES900013089Plastics Products, N.E.C.POLY PAK AMERICA INC2939 E WASHINGTON BoulevardLOS ANGELES900233089Plastics, Foil, and Coated Paper BagsPLEX-ART, INC211 W 140TH StreetLOS ANGELES900613089Plastics Products, N.E.C.JUNITED SALES941 N EASTERNLOS ANGELES900633089Plastics Products, N.E.C.NUPLA CORPORATION11912 SHELDONSUN VALLEY913523087Custom Compounding of Purchased Plastics ResinsCALIFORNIA ART PRODUCTS, CAPCO11125 VANOWENNORTH HOLLYWOOD916053089Plastics Products, N.E.C.	Rehrig Pacific Company	11949 Sherman Road	North Hollywood	91605	Warehousing, Storage, Assem	3089	Plastics Products, N.E.C.
Arrsil Auto Repair10726 S Avalon BoulevardLos Angeles90061Auto Repair3087Custom Compounding of Purchased Plastics ResinsThermo Fisher Scientific/Samco Sci. Corr1050 Arroyo AvenueSan Fernando91340Mfg Disposable Plastic Labwai 3089Plastics Products, N.E.C.L. W. REINHOLD PLASTICS, INC8763 Crocker StreetLos Angeles90003Plastics Manufacturer3089Plastics Products, N.E.C.Western States Packaging Inc13276 Paxton StreetLos Angeles913312673Plastics, Foil, and Coated Paper BagsABCO PLASTIC EXTRUDERS739 E 62ND StreetLOS ANGELES900013089Plastics Products, N.E.C.POLY PAK AMERICA INC2939 E WASHINGTON BoulevardLOS ANGELES900233089Plastics Products, N.E.C.FORTIFIBER CORP4489 BANDINI BoulevardLOS ANGELES900232673Plastics Products, N.E.C.PLEX-ART, INC211 W 140TH StreetLOS ANGELES900613089Plastics Products, N.E.C.UNITED SALES941 N EASTERNLOS ANGELES900633089Plastics Products, N.E.C.UNITED SALES4713 W Jefferson BoulevardLos Angeles90016Novelty Wholesale/Manufactur3089Plastics Products, N.E.C.NUPLA CORPORATION11912 SHELDONSUN VALLEY913523087Custom Compounding of Purchased Plastics ResinsCALIFORNIA ART PRODUCTS, CAPCO11125 VANOWENNORTH HOLLYWOOD916053089Plastics Products, N.E.C.	TYCO ELECTRONICS, MICRODOT CO	306 PASADENA Avenue	SOUTH PASADENA	91030	CIRCUIT CONNECTORS	3089	
Arrsil Auto Repair10726 S Avalon BoulevardLos Angeles90061Auto Repair3087Custom Compounding of Purchased Plastics ResinsThermo Fisher Scientific/Samco Sci. Corr1050 Arroyo AvenueSan Fernando91340Mfg Disposable Plastic Labwai 3089Plastics Products, N.E.C.L. W. REINHOLD PLASTICS, INC8763 Crocker StreetLos Angeles90003Plastics Manufacturer3089Plastics Products, N.E.C.Western States Packaging Inc13276 Paxton StreetLos Angeles913312673Plastics, Foil, and Coated Paper BagsABCO PLASTIC EXTRUDERS739 E 62ND StreetLOS ANGELES900013089Plastics Products, N.E.C.POLY PAK AMERICA INC2939 E WASHINGTON BoulevardLOS ANGELES900233089Plastics Products, N.E.C.FORTIFIBER CORP4489 BANDINI BoulevardLOS ANGELES900232673Plastics Products, N.E.C.PLEX-ART, INC211 W 140TH StreetLOS ANGELES900613089Plastics Products, N.E.C.UNITED SALES941 N EASTERNLOS ANGELES900633089Plastics Products, N.E.C.UNITED SALES4713 W Jefferson BoulevardLos Angeles90016Novelty Wholesale/Manufactur3089Plastics Products, N.E.C.NUPLA CORPORATION11912 SHELDONSUN VALLEY913523087Custom Compounding of Purchased Plastics ResinsCALIFORNIA ART PRODUCTS, CAPCO11125 VANOWENNORTH HOLLYWOOD916053089Plastics Products, N.E.C.	Arrsil Auto Repair	10726 S Avalon Boulevard	Los Angeles	90061	Auto Repair	3087	Custom Compounding of Purchased Plastics Resins
L. W. REINHOLD PLASTICS, INC8763Crocker StreetLos Angeles90003Plastics Manufacturer3089Plastics Products, N.E.C.Western States Packaging Inc13276Paxton StreetLos Angeles913312673Plastics, Foil, and Coated Paper BagsABCO PLASTIC EXTRUDERS739E 62ND StreetLOS ANGELES900013089Plastics Products, N.E.C.POLY PAK AMERICA INC2939E WASHINGTON BoulevardLOS ANGELES900233089Plastics Products, N.E.C.FORTIFIBER CORP4489BANDINI BoulevardLOS ANGELES900232673Plastics, Foil, and Coated Paper BagsPLEX-ART, INC211W 140TH StreetLOS ANGELES900613089Plastics Products, N.E.C.JUNITED SALES941N EASTERNLOS ANGELES900633089Plastics Products, N.E.C.UNITED SALES4713W Jefferson BoulevardLos Angeles90016Novelty Wholesale/Manufactur3089Plastics Products, N.E.C.NUPLA CORPORATION11912SHELDONSUN VALLEY913523087Custom Compounding of Purchased Plastics ResinsCALIFORNIA ART PRODUCTS, CAPCO11125VANOWENNORTH HOLLYWOOD916053089Plastics Products, N.E.C.	Arrsil Auto Repair	10726 S Avalon Boulevard	Los Angeles	90061	Auto Repair	3087	
L. W. REINHOLD PLASTICS, INC8763Crocker StreetLos Angeles90003Plastics Manufacturer3089Plastics Products, N.E.C.Western States Packaging Inc13276Paxton StreetLos Angeles913312673Plastics, Foil, and Coated Paper BagsABCO PLASTIC EXTRUDERS739E 62ND StreetLOS ANGELES900013089Plastics Products, N.E.C.POLY PAK AMERICA INC2939E WASHINGTON BoulevardLOS ANGELES900233089Plastics Products, N.E.C.FORTIFIBER CORP4489BANDINI BoulevardLOS ANGELES900232673Plastics, Foil, and Coated Paper BagsPLEX-ART, INC211W 140TH StreetLOS ANGELES900613089Plastics Products, N.E.C.JUNITED SALES941N EASTERNLOS ANGELES900633089Plastics Products, N.E.C.UNITED SALES4713W Jefferson BoulevardLos Angeles90016Novelty Wholesale/Manufactur3089Plastics Products, N.E.C.NUPLA CORPORATION11912SHELDONSUN VALLEY913523087Custom Compounding of Purchased Plastics ResinsCALIFORNIA ART PRODUCTS, CAPCO11125VANOWENNORTH HOLLYWOOD916053089Plastics Products, N.E.C.	Thermo Fisher Scientific/Samco Sci. Cor	1050 Arroyo Avenue	San Fernando	91340	Mfg Disposable Plastic Labwa	13089	Plastics Products, N.E.C.
ABCO PLASTIC EXTRUDERS739 E 62ND StreetLOS AÑGELES900013089Plastics Products, N.E.C.POLY PAK AMERICA INC2939 E WASHINGTON BoulevardLOS ANGELES900233089Plastics Products, N.E.C.FORTIFIBER CORP4489BANDINI BoulevardLOS ANGELES900232673Plastics, Foil, and Coated Paper BagsPLEX-ART, INC211 W 140TH StreetLOS ANGELES900613089Plastics Products, N.E.C.JET PLASTICS941 N EASTERNLOS ANGELES900633089Plastics Products, N.E.C.JUNITED SALES4713 W Jefferson BoulevardLOS ANGELES900639089Plastics Products, N.E.C.NUPLA CORPORATION11912SHELDONSUN VALLEY913523087Custom Compounding of Purchased Plastics ResinsCALIFORNIA ART PRODUCTS, CAPCO11125VANOWENNORTH HOLLYWOOD916053089Plastics Products, N.E.C.	L. W. REINHOLD PLASTICS, INC	8763 Crocker Street	Los Angeles	90003	Plastics Manufacturer	3089	
POLY PAK AMERICA INC2939 E WASHINGTON BoulevardLOS ANGELES900233089Plastics Products, N.E.C.FORTIFIBER CORP4489 BANDINI BoulevardLOS ANGELES900232673Plastics, Foil, and Coated Paper BagsPLEX-ART, INC211 W 140TH StreetLOS ANGELES900613089Plastics Products, N.E.C.JET PLASTICS941 N EASTERNLOS ANGELES900633089Plastics Products, N.E.C.JNITED SALES4713 W Jefferson BoulevardLos Angeles90016Novelty Wholesale/Manufactur3089Plastics Products, N.E.C.NUPLA CORPORATION11912SHELDONSUN VALLEY913523087Custom Compounding of Purchased Plastics ResinsCALIFORNIA ART PRODUCTS, CAPCO11125VANOWENNORTH HOLLYWOOD916053089Plastics Products, N.E.C.	Western States Packaging Inc	13276 Paxton Street	Los Angeles	91331		2673	Plastics, Foil, and Coated Paper Bags
FORTIFIBER CORP4489BANDINI BoulevardLOS ANGELES900232673Plastics, Foil, and Coated Paper BagsPLEX-ART, INC211W 140TH StreetLOS ANGELES900613089Plastics Products, N.E.C.JET PLASTICS941N EASTERNLOS ANGELES900633089Plastics Products, N.E.C.JNITED SALES4713W Jefferson BoulevardLos Angeles90016Novelty Wholesale/Manufactur3089Plastics Products, N.E.C.NUPLA CORPORATION11912SHELDONSUN VALLEY913523087Custom Compounding of Purchased Plastics ResinsCALIFORNIA ART PRODUCTS, CAPCO11125VANOWENNORTH HOLLYWOOD916053089Plastics Products, N.E.C.	ABCO PLASTIC EXTRUDERS	739 E 62ND Street	LOS ANGELES	90001		3089	Plastics Products, N.E.C.
PLEX-ART, INC211 W 140TH StreetLOS ANGELES900613089Plastics Products, N.E.C.JET PLASTICS941 N EASTERNLOS ANGELES900633089Plastics Products, N.E.C.JNITED SALES4713 W Jefferson BoulevardLos Angeles90016Novelty Wholesale/Manufactur 3089Plastics Products, N.E.C.NUPLA CORPORATION11912SHELDONSUN VALLEY913523087Custom Compounding of Purchased Plastics ResinsCALIFORNIA ART PRODUCTS, CAPCO11125VANOWENNORTH HOLLYWOOD916053089Plastics Products, N.E.C.	POLY PAK AMERICA INC						
JET PLASTICS941 N EASTERNLOS ANGELES900633089Plastics Products, N.E.C.JNITED SALES4713 W Jefferson BoulevardLos Angeles90016Novelty Wholesale/Manufactur 3089Plastics Products, N.E.C.NUPLA CORPORATION11912SHELDONSUN VALLEY913523087Custom Compounding of Purchased Plastics ResinsCALIFORNIA ART PRODUCTS, CAPCO11125VANOWENNORTH HOLLYWOOD916053089Plastics Products, N.E.C.	FORTIFIBER CORP	4489 BANDINI Boulevard	LOS ANGELES	90023		2673	Plastics, Foil, and Coated Paper Bags
JET PLASTICS941 N EASTERNLOS ANGELES900633089Plastics Products, N.E.C.JNITED SALES4713 W Jefferson BoulevardLos Angeles90016Novelty Wholesale/Manufactur 3089Plastics Products, N.E.C.NUPLA CORPORATION11912SHELDONSUN VALLEY913523087Custom Compounding of Purchased Plastics ResinsCALIFORNIA ART PRODUCTS, CAPCO11125VANOWENNORTH HOLLYWOOD916053089Plastics Products, N.E.C.	PLEX-ART, INC	211 W 140TH Street	LOS ANGELES	90061		3089	Plastics Products, N.E.C.
UNITED SALES4713 W Jefferson BoulevardLos Angeles90016Novelty Wholesale/Manufactur3089Plastics Products, N.E.C.NUPLA CORPORATION11912 SHELDONSUN VALLEY913523087Custom Compounding of Purchased Plastics ResinsCALIFORNIA ART PRODUCTS, CAPCO11125 VANOWENNORTH HOLLYWOOD916053089Plastics Products, N.E.C.	JET PLASTICS		LOS ANGELES	90063		3089	
NUPLA CORPORATION         11912         SHELDON         SUN VÄLLEY         91352         3087         Custom Compounding of Purchased Plastics Resins           CALIFORNIA ART PRODUCTS, CAPCO         11125         VANOWEN         NORTH HOLLYWOOD         91605         3089         Plastics Products, N.E.C.	UNITED SALES			90016	Novelty Wholesale/Manufactur	r 3089	,
CALIFORNIA ART PRODUCTS, CAPCO 11125 VANOWEN NORTH HOLLYWOOD 91605 3089 Plastics Products, N.E.C.	NUPLA CORPORATION						,
	Max Moulding	13838 S Figueroa Street	Los Angeles	90061		3089	Plastics Products, N.E.C.

SIC	Sub-Total
2673	9
2871	0
3081	4
3082	1
3085	2
3086	6
3087	13
3089	136
Total	171

List of IUs potentially involved in use of plastic pellets.

				SIC		
FACILITY NAME	ADDRESS	CITY	ZIP	CODE	SIC DESCRIPTION	WATERSHED
	11111 Santa Monica Boulevard #					
Rxi Holdings Inc	270	Los Angeles	90025	3085	Plastics Bottles	Ballona Creek
Mab Plastics	6248 De Longpre Avenue	Los Angeles	90028	3089	Plastics Products, N.E.C.	Ballona Creek
Engineering & Electronic Inc	1024 N MCCADDEN PLACE	LOS ANGELES	90038	3089	Plastics Products, N.E.C.	Ballona Creek
Mony's International Imports	315 N Hoover Street	Los Angeles	90004	3089	Plastics Products, N.E.C.	Ballona Creek
Morvis Corvis Corporation	1307 W Pico Boulevard	Los Angeles	90015	3089	Plastics Products, N.E.C.	Ballona Creek
Karma Kontrol	4606 W Jefferson Boulevard	Los Angeles	90016	3089	Plastics Products, N.E.C.	Ballona Creek
Quality Plasticraft	4568 W Adams Boulevard	Los Angeles	90016	3089	Plastics Products, N.E.C.	Ballona Creek
American Molds Engineering Inc	2258 W Washington Boulevard	Los Angeles	90018	3089	Plastics Products, N.E.C.	Ballona Creek
Sandel Products	3030 Exposition Boulevard	Los Angeles	90018	3089	Plastics Products, N.E.C.	Ballona Creek
Crossman Manufacturing Inc	6820 Brynhurst Avenue	Los Angeles	90043	3089	Plastics Products, N.E.C.	Ballona Creek
Little Crafts	2225 Southwest Drive	Los Angeles	90043	3089	Plastics Products, N.E.C.	Ballona Creek
Pro Plastic Inc	2358 S Robertson Boulevard	Los Angeles	90034	3089	Plastics Products, N.E.C.	Ballona Creek
Metro Mold Inc	2234 Purdue Avenue	Los Angeles	90064	3089	Plastics Products, N.E.C.	Ballona Creek
Solter Plastics	12016 W Pico Boulevard	Los Angeles	90064	3089	Plastics Products, N.E.C.	Ballona Creek
Teksun Inc <sup>1</sup>	11368 W Olympic Boulevard	Los Angeles	90064	3089	Plastics Products, N.E.C.	Ballona Creek
Acrylic Specialites	4203 Sepulveda Boulevard	Culver City	90230	3089	Plastics Products, N.E.C.	Ballona Creek
Joseph Galvan Studio	6740 S Centinela Avenue	Culver City	90230	3089	Plastics Products, N.E.C.	Ballona Creek
Techmar Corp	4150 GLENCOE AV	MARINA DEL REY	90292	3089	Plastics Products, N.E.C.	Marina Del Rey
HOWARD LEIGHT INDUSTRIES	4061 GLENCOE AVENUE	MARINA DEL REY		3086	Plastics Foam Products	Marina Del Rey
UNITED SALES	4713 W JEFFERSON BOULEVARD	LOS ANGELES		3089	Plastics Products, N.E.C.	Ballona Creek
ASTRO PAK, FLOW-LINE SERVICES	1150 W JEFFERSON Boulevard	LOS ANGELES		3087	Custom Compounding of Purchased Plastics Resins	Ballona Creek
CALIFORNIA PLASTICARD, INC.	1380 W WASHINGTON Boulevard	LOS ANGELES		3089	Plastics Products, N.E.C.	Ballona Creek
UNITED SALES	4713 W Jefferson Boulevard	Los Angeles		3089	Plastics Products, N.E.C.	Ballona Creek

<sup>&</sup>lt;sup>1</sup> The only facility from the list that was found to be involves in handling of Plastic Pellets

# PUBLIC WORKS PROTOCOLTO RESPOND TO REPORTS OF SPILL AND ABANDONED WASTES

# **APPENDIX B**

#### Department of Public Works

### Bureau of Engineering

Bureau of Street Maintenance Bureau of Sanitation Joint Report No. 1 ADOPTED BY THE BOARD OF PUBLIC WORKS OF THE CITY of Los Angeles, California AND REFERRED TO THE CITY COUNCIL JUL - 2 1997

Secretary

July 2, 1997 CD Nos. All

PUBLIC WORKS PROTOCOL TO RESPOND TO REPORTS OF SPILLS AND ABANDONED WASTE

#### RECOMMENDATIONS

- Approve the protocol for responses to spills and abandoned waste on the public right-of-ways (Transmittal No. 2).
- Direct the Bureaus of Engineering, Sanitation, and Street Maintenance to produce a Memorandum of Understanding based on the approved protocol.
- Direct Stormwater Management Division and the Public Affairs Office to produce and distribute to the Mayor, Council offices, other City departments and appropriate agencies the policy and a high visibility placard giving the "Hotline" phone number for reporting spills and abandoned wastes.
- Direct Stormwater Management Division to convene a workshop presenting the new protocol.
- 5. Forward this report to the City Council's Environmental Quality and Waste Management Committee.

#### TRANSMITTALS

- 1. Council Motion 96-0833-51 (Galanter).
- 2. Protocol to respond to calls from the public regarding spills and abandoned wastes.

#### DISCUSSION

#### Spill Response

Spilled or abandoned waste materials in the City generally are dealt with by several groups. The Bureau of Sanitation's Wastewater Collection Systems Group responds to

#### Joint Report No. 1

#### Page 2

spills of sewage, and their Recycling and Collections group for abandoned bulky items. The Bureau of Engineering's Stormwater Management Division deals with spills of hazardous materials, while the Bureau of Street Maintenance also responds to nonhazardous and hazardous materials if in the City streets. These groups effectively respond to spills reported by the public in various ways including:

- staffing a "hotline" phone number for the public to call,
- working with L. A. County's Hazardous Response Team to identify spills and wastes, containing and cleaning nonhazardous materials, and
- · using contractors to clean and remove hazardous materials.

#### Council Motion CF 96-0833-51

Response to sewage spills recently was streamlined by the Bureaus of Sanitation, Engineering, and Contract Administration. To ensure that these new procedures were understood by personnel at various points of public contact (e.g. fire and police stations, public health agencies, lifeguards, City Council offices), a City Council Motion was presented by Council members Galanter and Feuer and approved on July 17, 1996 (CF 96-0833-51, Transmittal No. 1). Through this Motion, the Bureau of Sanitation was instructed to notify all points of public contact on the proper procedures to take when notified by the public of sewage spills. Further, the Stormwater Management Division was instructed to incorporate this information into their proposed City employee training programs and informational materials given to the public.

#### Further Refinement of Spill and Waste Collection Protocols

Over the years, City personnel have dealt with a wide variety of hazardous and nonhazardous waste items spilled or abandoned onto the City's streets and right-of-ways. In response to the Council's motion, staff from departments typically dealing with these materials met to revise the response protocols where necessary. Under the direction of Commissioner Burnett of the Board of Public Works, a working committee was formed that included staff from the Bureaus of Sanitation (Wastewater Collections System Division), Street Maintenance, and Engineering (Stormwater Management Division). Staff did not limit the protocols only to sewage related materials, but considered the whole spectrum of waste materials historically encountered. Specific agreements are presented in Attachment 2. Main points of the new response protocols (Transmittal No. 2) are:

Department of Public Works Bureau of Engineering Bureau of Street Maintenance Bureau of Sanitation Joint Report No. 1

July 2, 1997 Page 3

- The "Hotline" maintained by Stormwater, or the "after-hours" City operator will be the main contact point for the public or City officials to report spills or abandoned materials.
- Sanitation (Wastewater Collections Systems Division) shall deal with sewage spills or overflows, septic tank discharges, and recreational vehicle wastes spilling on the public right-of-way or entering the storm drain system.
- Street Maintenance by contractual services will continue to deal with hazardous waste spilled or abandoned on public right-of-ways (curb-to-curb) excluding infectious, human/animal wastes and explosives. Street Maintenance will use Bureau forces to deal with nonhazardous wastes spilled or abandoned on public right-of-ways (curb-to-curb).
- Engineering (Stormwater Management Division) will deal with hazardous materials contaminating the storm drain system in addition to responding more frequently to materials reported on public right-of-ways.

In addition to those responded to by the Bureau of Street Maintenance, the Bureau of Engineering, Stormwater Management Division will also respond to hazardous waste calls. Therefore, during 1997-98, it may be necessary to request the Council to appropriate funds, or transfer any surplus funds from within the Bureau of Sanitation or other Bureaus to cover contractual services for collecting and disposing of hazardous materials by either Bureau.

#### RECOMMENDATIONS

Based on this work, we recommend that five actions by taken by your Board:

- Adopt the revised protocols for response to spills and abandoned wastes.
- Draft a Memorandum of Understanding among the Bureaus of Sanitation, Street Maintenance, and Engineering to codify the revised protocols.
- Direct Stormwater Management Division and Public Affairs Office to develop a "hotline" placard and a synopsis of the revised protocols for distribution to the Mayor, Council offices, other City departments, and other appropriate agencies.

Joint Report No. 1

Page 4

 Direct Stormwater Management Division to hold a workshop with all interested groups to describe these new response protocols.

( PLR JMF RKH JTC WEW )

Report reviewed by:

Respectfully submitted,

BOE, BOS and BSM

Report prepared by:

Stormwater Management Division

Philip L. Richardson Division Engineer Phone No. (213) 847-6346

PLR/JD/0602SMD7.cnl

Writer: John Dorsey Phone No. (213) 847-6347 Fax No. (213) 847-5443

But of Eng-Letter Files 650 S Spring St - Ste 200

JUL 1 5 1997

ASEIGNED TO\_

WCMD PMID Harano

 Direct Scannetia Management Device Form P. Sko Matrix Office to strengt, c Trailing stacking and a symposis of the pressure processis to national of the Mayon Scanding Schedules, other City departments, and care contenting agritudes.

John Closse for prew Sones, Director

for Sam L. Furuta

**City Engineer** 

Bureau of Sanitation

Gregory L. Scott, Director Bureau of Street Maintenance

# CITY PROCEDURES IN RESPONSE TO CALLS FROM THE PUBLIC REGARDING SPILLS AND ABANDONED WASTES AFFECTING THE PUBLIC RIGHTS-OF-WAY

- Calls from the public reporting abandoned wastes, spills of hazardous or nonhazardous material, sewage spills or other discharges affecting the public right-of-way shall be received at the Stormwater Management hotline number (800) 974-9794 from 7:00 A.M. to 4:30 P.M., Monday through Friday, or at the Communications Services Division (CSD) number (213) 485-2121 from 4:30 P.M. to 7:00 A.M, Monday through Friday and for twenty-four hours on Saturdays, Sundays and holidays.
- The Duty Officer of the Stormwater Management Hotline, or the Communications Services Division (CSD) Operator, shall enter the caller's name and phone number, time and date of call, nature of the call, and other pertinent information into the appropriate computer database or call logbook.
- 3. If the nature of the waste is unknown, or suspected hazardous, the Duty Officer or CSD Operator shall notify the Los Angeles County Fire Department, Health Haz Mat Division (Health Haz Mat) at telephone number (213) 890-4317 from 8:00 A.M. to 4:30 P.M., and at (213) 881-2455 from 4:30 P.M. to 8:00 A.M., to request a HazCat, a quick method of identifying and characterizing the hazards of a material in the field.
- 4. If the storm drain system is threatened or impacted by a discharge or spill of unknown material, then the Duty Officer or CSD Operator shall immediately notify the Bureau of Sanitation, Wastewater Collection Systems Division at (310) 823-5507 or (310) 822-0777 to provide containment necessary for protecting the storm drain system.
- 5. Once the waste has been identified, the Duty Officer or CSD Operator shall determine the appropriate agency to call for one or more of the following actions:
  - a. Traffic Control
  - b. Barricading
  - c. Containment
  - d. Cleanup
  - e. Disposal
  - f. Investigation and Identification of Responsible Party
  - g. Enforcement
- 6. After hours, an on-call Stormwater Management Division personnel shall assist the CSD Operator in facilitating the response or determining the appropriate agency to handle the call (See attached "Table of Items/Discharges Abandoned or Spilled on the Public Rightsof-Way and City Agency Responsible for Mitigation and Disposal" for guidance). In

FIFTH DRAFT, DATED 6/12/97

general, the Bureaus of Sanitation, Engineering and Street Maintenance are responsible for dealing with the following situations:

a. Bureau of Sanitation (Wastewater Collection Systems Division) handles the containment and cleanup of identified sewage spills or overflows, septic tank discharges, and recreational vehicle wastes onto the public right-of-way and into the storm drain system, and provides for, the cleanup of debris found in the storm drain system.

Bureau of Sanitation (Recycling and Collection Division) deals with the pickup and disposal of bulky items on all public rights-of-way.

Bureau of Street Maintenance responds to the containment, cleanup and/or disposal of hazardous and nonhazardous materials (excluding infectious waste, human/animal waste, pharmaceutical waste and explosives) abandoned or spilled on the public right-of-way, from curb face to curb face, through its Emergency Response and/or Hazardous Waste Management contracts. This bureau also is responsible for the disposal of trash and like materials that are not containerized or are indiscriminately scattered on all public rights-of-way.

Bureau of Engineering (Stormwater Management Division) handles, through its Emergency Response and/or Hazardous Waste Management contracts, the cleanup and disposal of all hazardous and nonhazardous materials abandoned on the sidewalk or entering the storm drain system.

7. The Duty Officer or on-call Stormwater Management personnel shall notify the caller that a referral has been made to the appropriate agency and shall provide the caller with the telephone number and name of the contact person of the responding agency.

- 8. The Duty Officer or on-call Stormwater Management personnel shall make the necessary notifications to all impacted local, State or federal agencies, as required by state and federal law, on all spills, except sewage. All sewage spill notifications required by State or federal law shall be made by the Bureau of Sanitation, Wastewater Collection Systems Division.
- 9. The Bureau of Engineering (Stormwater Management Division), with assistance from the Public Affairs Office, shall distribute a high visibility notice regarding the use of the Hotline. In addition, the Public Affairs Office, in accordance with the Public Information and Education Requirements of the City's Stormwater NPDES Permit, shall educate City employees who are public points-of-contact on the use of the Stormwater Management Hotline by October 31, 1998. The Public Affairs Office shall continue to distribute brochures and other educational materials containing the Hotline number.

#### FIFTH DRAFT, DATED 6/12/97

b.

#### Definition of terms:

Hazardous material - "Any material that, because of its quantity, concentration, or physical or chemical characteristics, poses a significant present or potential hazard to human health and safety or to the environment if released into the work place or the environment." (Health and Safety Code, § 25501 (k))

Hazardous waste -

"Solid waste, or combination of solid wastes, which because of its quantity, concentration, or physical, chemical or infectious characteristics may

- (A) cause, or significantly contribute to an increase in mortality or an increase in serious irreversible, or incapacitating reversible, illness; or
  - (B) pose a substantial present or potential hazard to human health or the environment when improperly treated, stored, transported, or disposed of, or otherwise managed."
     (Resource Conservation and Recovery Act, 42 U.S.C. §6903, Sec. 1004 (5))

Stormwater NPDES Permit - NPDES stands for National Pollutant Discharge Elimination System. This permit lists the waste discharge requirements for the City's storm water and urban runoff discharges and became effective on July 15, 1996.

Bulky item - Any household good abandoned on the public right-of-way as waste.

#### FIFTH DRAFT, DATED 6/12/97

# TABLE OF ITEMS/ DISCHARGES ABANDONED OR SPILLED ON THE PUBLIC RIGHTS-OF-WAY AND CITY AGENCY RESPONSIBLE FOR MITIGATION AND DISPOSAL

	ITEM OR DISCHARGE	RESPONSIBLE AGENCY '.
1.	Batteries	SMD, ON ALL PUBLIC RIGHTS-OF-WAY
2.	Hazardous waste	<ol> <li>SMD, ON SIDEWALK AND IN STORM DRAIN SYSTEM</li> <li>BSM, CURB FACE TO CURB FACE</li> </ol>
3.	Oil-based paint	<ol> <li>SMD, ON SIDEWALK AND STORM DRAIN SYSTEM</li> <li>BSM, CURB FACE TO CURB FACE</li> </ol>
4.	Liquid latex or water-based paint	<ol> <li>SMD, ON SIDEWALK AND IN STORM DRAIN SYSTEM</li> <li>BSM, CURB FACE TO CURB FACE</li> </ol>
5.	Asbestos	SMD, ON ALL PUBLIC RIGHTS-OF-WAY
6.	Waste oil (petroleum-based)	<ol> <li>SMD, ON SIDEWALK AND IN STORM DRAIN SYSTEM</li> <li>BSM, CURB FACE TO CURB FACE</li> </ol>
7.	Bio-medical waste/syringes/needles over 50 lbs.	SMD, ON ALL PUBLIC RIGHTS-OF-WAY
8.	Human waste (feces)	SMD, ON ALL PUBLIC RIGHTS-OF-WAY
9.	Animal waste (feces)	No service shall be provided.
10.	Dead animals	BOS/RCD, ON ALL PUBLIC RIGHTS-OF- WAY
11.	Liquid cooking oil	<ol> <li>SMD, ON SIDEWALK AND IN STORM DRAIN SYSTEM</li> <li>BSM, CURB FACE TO CURB FACE</li> </ol>
12.	Solid cooking fat	<ol> <li>SMD, ON SIDEWALK AND IN STORM DRAIN SYSTEM</li> <li>BSM, CURB FACE TO CURB FACE</li> </ol>

<sup>&</sup>lt;sup>1</sup>Calls regarding bio-medical waste/syringes/needles under 50 pounds shall be handled by Los Angeles County Fire Department, Health Haz Mat.

19	ITEM OR DISCHARGE	RESPONSIBLE AGENCY
	olid food waste	<ol> <li>SMD, ON SIDEWALK</li> <li>BOS/WCSD IN STORM DRAIN SYSTEM</li> <li>BSM, CURB FACE TO CURB FACE</li> </ol>
	iquid non-hazardous waste	<ol> <li>SMD, ON SIDEWALK AND STORM DRAIN SYSTEM</li> <li>BSM, CURB FACE TO CURB FACE</li> </ol>
15. T	ires	BSM, ON ALL PUBLIC RIGHTS-OF-WAY
16. F	urniture	BOS/RCD, ON ALL PUBLIC RIGHTS-OF- WAY
17. W	Vood/lumber	BOS/RCD, ON ALL PUBLIC RIGHTS-OF- WAY
18. T	ree trimmings	BSM, ON ALL PUBLIC RIGHTS-OF-WAY
19. C	construction debris	BSM, ON ALL PUBLIC RIGHTS-OF-WAY
20. P	harmaceutical waste	SMD, ON ALL PUBLIC RIGHTS-OF-WAY
21. E	mpty pharmaceutical containers	SMD, WITH ASSISTANCE FROM BSM, ON ALL PUBLIC RIGHTS-OF-WAY
22. A	bandoned drug lab waste	STATE DTSC
23. E	mpty drug lab waste containers	STATE DTSC
24. D	rug lab waste at crime scene	STATE DTSC/LAPD (NARC & SID)
25. P	ressurized / empty gas cylinders	<ol> <li>SMD, ON SIDEWALK</li> <li>BSM, CURB FACE TO CURB FACE</li> </ol>
26. E	xplosives	SMD, ON ALL PUBLIC RIGHTS-OF-WAY
27. E	mpty latex paint cans	<ol> <li>BSM, ON ALL PUBLIC RIGHTS- OF-WAY</li> <li>BOS/WCSD, IN STORM DRAIN SYSTEM</li> </ol>
28. F	ull/partially full dried paint cans	<ol> <li>SMD, ON SIDEWALK</li> <li>BSM, CURB FACE TO CURB FACE</li> </ol>
29. H	azardous spills from traffic accidents	<ol> <li>SMD, ON SIDEWALK AND IN STORM DRAIN SYSTEM</li> <li>BSM, CURB FACE TO CURB FACE</li> </ol>

_	ITEM OR DISCHARGE	RESPONSIBLE AGENCY
30.	Non-hazardous spills from traffic accidents	<ol> <li>SMD, ON SIDEWALK AND IN STORM DRAIN SYSTEM</li> <li>BSM, CURB FACE TO CURB FACE</li> </ol>
31.	Dairy product spills	<ol> <li>SMD, ON SIDEWALK AND STORM DRAIN SYSTEM</li> <li>BSM, CURB FACE TO CURB FACE</li> </ol>
32.	Liquid food waste spills	<ol> <li>SMD, ON SIDEWALK AND STORM DRAIN SYSTEM</li> <li>BSM, CURB FACE TO CURB FACE</li> </ol>
33.	Solid food waste spills	<ol> <li>SMD, ON SIDEWALK AND IN STORM DRAIN SYSTEM</li> <li>BSM, CURB FACE TO CURB FACE</li> </ol>
34.	Mixed liquid/solid food spills	<ol> <li>SMD, ON SIDEWALK AND IN</li> <li>STORM DRAIN SYSTEM</li> <li>BSM, CURB FACE TO CURB FACE</li> </ol>
35.	RV/Septic/Cesspool spilled waste	BOS/WCSD, ON ALL PUBLIC RIGHTS- OF-WAY AND IN STORM DRAIN SYSTEM
36.	Sewage spill (domestic waste)	BOS/WCSD, ON ALL PUBLIC RIGHTS- OF-WAY AND IN STORM DRAIN SYSTEM
37.	Sewage spill (industrial waste)	BOS/WCSD, ON ALL PUBLIC RIGHTS- OF-WAY AND IN STORM DRAIN SYSTEM

ACRONYMS:	
BOS/WCSD	Bureau of Sanitation, Wastewater Collection Systems Division
SMD	
SMD	Bureau of Engineering, Stormwater Management Division
BSM	Bureau of Street Maintenance
BOS/RCD	Bureau of Sanitation, Recycling and Collection Division
State DTSC	CalEPA, Department of Toxic Substance Control, Emergency Response Unit
LAPD (SID)	Los Angeles Police Department, Scientific Investigation Division
LAPD (Narc)	Los Angeles Police Department, Narcotics Group

1 .

# MEMORANDUM OF UNDERSTANDING BETWEEN THE BOARD OF PUBLIC WORKS, STORMWATER MANAGEMENT DIVISION, AND THE BUREAUS OF SANITATION AND STREET MANINTENANCE

# **APPENDIX B**

Department of Public Works

ADOPTED SY THE SOARD OF PUSUS WORKS OF THE CITY of Los Montes a Complete

DEC 3 - 1997

148156

Bureau of Engineering Bureau of Sanitation **Bureau of Street Maintenance** Joint Report No. 1 December 3, 1997 CD Nos. All

A MEMORANDUM OF UNDERSTANDING BETWEEN THE BOARD OF PUBLIC WORKS, THE STORMWATER MANAGEMENT DIVISION OF THE BUREAU OF ENGINEERING, AND THE BUREAUS OF SANITATION AND STREET MAINTENANCE REGARDING RESPONSE TO REPORTS OF SPILLS AND ABANDONED WASTE ON PUBLIC RIGHTS-OF-WAY.

#### RECOMMENDATION

That your Board approve the Memorandum of Understanding establishing clear guidelines and protocols for effective coordination of duties and responsibilities between the Bureau of Sanitation, the Bureau of Street Maintenance and Stormwater Management Division of the Bureau of Engineering in responding to reports of spills and abandoned waste on the public rights-of-way.

#### TRANSMITTAL

- 1. Board Report dated July 2, 1997.
- Memorandum of Understanding between the Board of Public Works, Bureau of Sanitation and the Bureau of Street Maintenance and the Stormwater Management Division of the Bureau of Engineering.

#### DISCUSSION

In a Board Report dated July 2, 1997 (Transmittal No. 1), your Board approved a protocol (Transmittal No. 1) describing how the Bureau of Sanitation, the Bureau of Street Maintenance and Stormwater Management Division (SMD) of the Bureau of Engineering would cooperatively respond to calls from the public regarding spills and abandoned wastes in the public rights-of-way. Further, these Bureaus were directed to draft a Memorandum of Understanding (MOU) to promulgate the protocol. A MOU has been drafted (Transmittal No. 2), naming the Stormwater Management Division of the Bureau of Engineering, the Bureau of Sanitation and the Bureau of Street Maintenance and your Board as parties agreeing to the terms of the MOU. Among the terms are the following:

- The Stormwater Management Division, currently under the Bureau of Engineering, shall provide staff to coordinate responses to all calls received through the Department of Public Works Stormwater Hotline (800) 974-9794 from the public and government agencies regarding abandoned wastes and spills affecting the public right-of-way.
- It is anticipated that the SMD will be transferred to the Bureau of Sanitation no later than July 1, 1998; this transfer should not affect the terms of the MOU.

#### Joint Report No. 1

#### Page 2

- The Bureau of Sanitation, Wastewater Collection Systems Division, shall be responsible for the cleanup of sewage and septage spills, and spills from recreational vehicle wastes impacting the public right-of-way or the storm drain system.
- The Bureau of Sanitation, Recycling and Collections Division, shall be responsible for the pickup and disposal of bulky items on all public rights-of-way.
- The Bureau of Street Maintenance, using contractual services, shall be responsible for the containment, cleanup and disposal of hazardous materials (excluding biomedical and human wastes, pharmaceutical waste, batteries, asbestos and explosives) abandoned or spilled on the public right-of-way, from curb to curb. The Bureau will continue to use its work force to contain, clean and dispose of any nonhazardous materials spilled or indiscriminately scattered (from curb to curb) on the public right-of-way.
- The Stormwater Management Division shall handle, through contractual services, the cleanup and disposal of hazardous and nonhazardous materials abandoned or spilled on the sidewalk or entering the storm drain system.
- The Bureaus of Street Maintenance and Sanitation shall transfer any surplus funds from within their budgets to the Stormwater Management Division to cover the cost of cleanup exceeding that which was budgeted by the Stormwater Management Division for fiscal year 1997-98.
- The Board shall consider and endorse any additional resource needs for the Hotline to maintain the level of public service that the Board deems appropriate.

( BDG AS TC WEW )

Report reviewed by:

BOE, BOS and BSM

Report prepared by:

Stormwater Management Division

Brian D. Griffith Division Engineer Phone No. (213) 847-6346

BRG/VM/1102SMD7.lmb

Writer: Vivian Marquez Phone No. (213) 847-4840 Fax No. (213) 847-0331 Respectfully submitted,

Sam L. Furuta City Engineer

DEC 16 1997

ASSIGNED

WLA VAILLY Harbor PMD

Judith A. Wilson, Director Bureau of Sanitation

PMD Hara~-

Gregory L. Scott. Director Bureau of Street Maintenance

#### ENFORCEMENT UNIT PROCEDURES MANUAL

# APPENDIX B

City of Los Angeles
Dept. of Public Works
Bureau of Sanitation

Stormwater

Management Division

### **ENFORCEMENT UNIT PROCEDURES MANUAL**

Subject:

#### HOTLINE RESPONSE

re Revisi 7/26/99

Date

Revision No.

Page 1 of 28

#### I. OBJECTIVES:

- A. To receive calls from the public, and City, County, State and federal agencies via the Stormwater Hotline regarding reports of abandoned wastes or emergency spills.
- B. To provide the necessary technical information and/or service relating to stormwater management and education and the protection of the storm drains of the City of Los Angeles and Waters of the State.
- C. To facilitate mitigation of emergency spills threatening the City's storm drain system and Waters of the State and/or disposal of wastes abandoned on the public right-of-way.
- D. To investigate reports of illicit discharges and illicit connections, identify their sources, and take appropriate actions to mitigate or stop the discharges.
- E. To assist local, State and federal regulatory agencies in investigating suspect or known perpetrators of environmental crimes and/or receive information regarding violators of Sec. 64.70 and other pertinent sections of the Los Angeles Municipal Code.
- F. To make the proper notifications of releases of hazardous materials, including oil, to impacted agencies.

#### II. DUTY OFFICER PROCEDURES FOR ABANDONED WASTES OR EMERGENCY SPILLS<sup>1</sup><sup>2</sup>

#### A. During regular business hours (7:00A.M. to 4:30 P.M.):

- Calls are received by the Duty Officer at the hotline number (800) 974-9794 (when option 1 of the voice mail is selected) or directly from (213) 847-4852 or 485-1776. Callers may be private citizens, or representatives of City Departments, Los Angeles County Public Works, Los Angeles County Fire Department, State and federal agencies.
  - Information regarding spills is faxed by State Office of Emergency Services (OES) to the City Hall Communications Operator who, in turn, faxes the information to the Duty Officer.
  - Written referrals from State, federal and local enforcement agencies are received via fax or mail by the Duty Officer.

<sup>1</sup> This section was revised to accommodate the Department of Public Works protocol to respond to reports of spills and abandoned wastes adopted by the Board of Public Works on July 2, 1997, for which a Memorandum of Understanding (MOU) was entered into by the Board and the Bureaus of Street Maintenance and Sanitation, and Stormwater Management Division on December 3, 1997. See Appendix B for protocol and MOU.

<sup>2</sup> Refer to Appendix B for Hotline Response Flowchart for Spills and Abandoned Waste.

Stormwater

Management Division

#### **ENFORCEMENT UNIT PROCEDURES MANUAL**

Subject:

HOTLINE RESPONSE

e Revision No. 7/26/99 3

Date

Page 2 of 28

- The Duty Officer writes down caller's name and phone number, time and date of call, nature of the call and other pertinent information on the Initial Call Worksheet (See Sample Worksheet in Appendix E).
- The Duty Officer inputs information from the worksheet, referrals, or faxes into Initial Call Worksheet of the Call Log-in Database. (See copy of Worksheet and Protocol for Call Log-in Entry System in Appendix E). The call is automatically assigned a call ID number by the computer.
- 6. The Duty Officer determines if the incident called in is within City of Los Angeles territory.
- a. If the call is outside the City's jurisdiction, the following protocol is followed:
  - i. The Duty Officer calls LA County Public Works hotline (800) 303-0003 or the appropriate municipality to report the incident of abandoned waste or spills affecting the public right-of-way or threatening the storm drain system.
  - ii. The Duty Officer then contacts the complainant/caller and informs the complainant that the details of the incident have been relayed to another agency for action. The Duty Officer provides the caller with the telephone number and name of the contact person of the agency to which the call is referred.
  - iii. The Duty Officer updates the Call Log-in database to reflect referral made and receiving agency's response.
  - b. If the call is within the City of Los Angeles's jurisdiction, the following protocol is followed:
    - i. The Duty Officer determines from the caller if the nature of the abandoned waste or spilled material is unknown or suspected hazardous.

#### For Materials of Unknown Nature or Suspected Hazardous

- a) If the nature of the material is unknown or is suspected to be hazardous, the Duty Officer notifies the Los Angeles County Fire Department, Health Haz Mat Division (Health Haz Mat) at telephone number (213) 890-4317 to request a hazcat, a quick method of characterizing the hazards of a material outside of a laboratory environment.
- b) The Duty Officer ascertains from the caller if the material is entering or will potentially enter a nearby catch basin or storm drain. If so, the Duty Officer notifies the Bureau of Sanitation, Wastewater Collection Systems Division at (213) 485-7575, (310) 823-5507 or (310) 822-0777 to provide spill containment and protection of the storm drain system.
- c) The Duty Officer also ascertains from the caller if there are any identifying marks or labels on abandoned containers, or if there are any witnesses to the abandonment. If so, the Duty Officer notifies the Los Angeles Police

#### **ENFORCEMENT UNIT PROCEDURES MANUAL**

HOTLINE RESPONSE

Subject:

Date F 7/26/99

Revision No.

Page 3 of 28

Department, Hazardous Material/Environmental Crimes Unit (LAPD) at (213) 485-4011, in order that an investigation, if deemed necessary by LAPD, may be conducted.

- d) The Duty Officer awaits callback from Health Haz Mat to obtain results of the hazcat.
- e) When the Duty Officer receives callback from Health Haz Mat and material or waste is confirmed non-hazardous, the Duty Officer calls the appropriate agency for cleanup and/or disposal of the material. The Duty Officer follows the response protocol for non-hazardous material on page 4 (See Section II.A.6.b.i. For Non-hazardous Material).

f) If the callback from Health Haz Mat confirms that material is hazardous and/or identifies the material, the Duty Officer obtains answers to the following questions from the Health Haz Mat Specialist who performed the hazcat:

- Is there a responsible party who can be required by Health Haz Mat to be liable for cleanup and disposal?
- Is public health and safety threatened by the incident, necessitating an immediate cleanup?
- Is the spill occurring on street (from curb face to curb face) or are other public rights-or-way (i.e., sidewalk, alley, parkway etc.) affected?
- Is there an imminent threat to the City's storm drain system or the receiving waters or has either one been already impacted?
- What is the extent and type of cleanup necessary? Are there
  precautions to be exercised by responding inspectors?

g) The Duty Officer evaluates all information received from Health Haz Mat and determines the Department of Public Works agency responsible for handling the response, in compliance with the Memorandum of Understanding dated December 3, 1997 referenced on page 1 (see Appendix B for original MOU). The Duty Officer observes the following protocol:

- For the cleanup and disposal of hazardous materials (excluding infectious waste, human waste, pharmaceutical waste, batteries or explosives) from curb face to curb face of the City streets, notify the Hazardous Material Coordinator of the Bureau of Street Services (BSS) at (213) 485-6350.
- For the cleanup and disposal of hazardous materials on the sidewalk and public rights-of way beyond curb faces of the street and entering the storm drain system, including infectious waste, human waste,

Stormwater Management Division

Stormwater

Management Division

#### ENFORCEMENT UNIT PROCEDURES MANUAL

Subject:

#### HOTLINE RESPONSE

Date Revision No. 7/26/99 3

Page 4 of 28

pharmaceutical waste, batteries, or explosives within the curb faces of the street, Duty Officer acknowledges that the responsibility for the mitigation lies with Stormwater Management Division **only** if Health Haz Mat is unable to identify or locate the Responsible Party or the Responsible Party is financially unable to provide cleanup.

- h) If the Duty Officer is unsure of the appropriate action or referral needed or if he/she has any questions pertaining to the appropriate protocol to be observed, the Duty Officer requests guidance from the Supervisory Staff in charge of the Stormwater Hotline.
- i) If Stormwater Management Division is the responsible agency or if the Duty Officer is unable to contact the Hazardous Material Coordinator of the BSS, then the Duty Officer contacts the City's emergency response contractor<sup>3</sup>, Safety-Kleen, Inc. at (213) 277-2600 or 277-2605 to request an emergency cleanup. If the Duty Officer has difficulty getting a response from a Safety-Kleen representative, the Duty Officer is authorized to call United Pumping Services directly at (626) 961-9326, a subcontractor for Laidlaw<sup>3</sup>, to request an emergency response. The Duty Officer relates all the pertinent details of the incident that will be helpful in effecting the cleanup, such as the following:
  - the identity or type of material
  - the incident location
  - approximate area (in square feet, yards, etc.) of contamination if material has been spilled onto the street, sidewalk, alley, gutter, or catch basin
  - storm drain line location or Waters of the State affected
  - the number of containers and individual volumes of each container
  - the mode of cleanup that may be necessary
  - the names and cellular phone numbers/pager numbers of contact persons (i.e., responding inspectors, Health Haz Mat specialist, Duty Officer)
  - any precautionary measures specified by Health Haz Mat
- j) The Duty Officer obtains an estimated time of arrival (ETA) and confirmation of response from Safety-Kleen, Inc. and notifies Health Haz Mat of the ETA.
  - k) Whether or not a Responsible Party has been located, the Duty Officer dispatches two Industrial Waste Inspectors (designated first and second

<sup>3</sup> The current emergency cleanup contract expires on December 31, 1999. A change in primary contractor may lead to a change in subcontractor.

Stormwater

Management Division

#### ENFORCEMENT UNIT PROCEDURES MANUAL

Subject:

### HOTLINE RESPONSE

7/26/99

Date

Revision No. 3

Page 5 of 28

responders for the day), to the incident location in order that they may investigate the incident, determine the extent of the spilled material's contamination of City's storm drain system, supervise the cleanup, and facilitate communication between the City and all other affected agencies. The Duty Officer then gives them a printout of the Call Log-in Report and briefs them on information obtained from Health Haz Mat and Safety-Kleen, Inc.

I) If the release is of a reportable quantity, the Duty Officer verifies from Health Haz Mat if a notification to the State Office of Emergency Services (OES) has been made. If not, the Duty Officer has to report the incident to OES at (800) 852-7550.

m) The Duty Officer notifies all other impacted agencies as listed below:

- For discharges affecting Los Angeles County (L.A.County) storm drain system, notify L.A. County Public Works Hotline at (800) 303-0003 or L.A. County Flood Control Emergency number (626) 458-4357.
  - For discharges affecting the Waters of the State, notify:
    - State Department of Fish and Game at (562) 590-5132 Regional Water Quality Control Board at (213) 576-6600 United States Coast Guard, Marine State Office (Long Beach) for releases affecting any navigable waterway, including tributaries at (562) 980-4450.
- For abandoned wastes and spills occurring within railroad property, notify: Santa Fe Railroad Emergency at (800) 285-2164
   Union Pacific Pailroad (formerly Southern Pacific Pailroad) at (800)

Union Pacific Railroad (formerly Southern Pacific Railroad) at (800) 892-1283 or

Southern Pacific Railroad Haz Mat at (310) 490-7045.

- For spills or abandoned wastes on railroad property, the Duty Officer confirms that upon notification, the owner/operator of the property will handle the cleanup of its property through its own Haz Mat personnel or contractor. If the spill is caused by the railroad operator/owner and the spill affects the City streets, public right-of-way or storms drain system, the Duty Officer informs the operator/owner of its responsibility to clean up all affected areas.
- n) The Duty Officer contacts the Bureau of Street Services service request desk at (213) 485-5661 if barricading and additional containment (with use of absorbent material or sandbags) are needed.
  - If the incident is impeding vehicular traffic in an alley or a street, the Duty Officer calls the 24-hour Department of Transportation Public Service and Information number at (818) 756-9418 or (213) 485-4184 for traffic control.
  - p) The Duty Officer continues to communicate with field personnel or responders

Stormwater

Management Division

#### ENFORCEMENT UNIT PROCEDURES MANUAL

Subject:

HOTLINE RESPONSE

Revision No. 7/26/99

Date

3

Page 6 of 28

(i.e., Health Haz Mat, Inspectors, Safety-Kleen, Inc.) and acts as facilitator for additional assistance needed at the incident site, until cleanup or disposal is completed.

q) If subsequent enforcement action, cost recovery, or any other follow-up actions are required relating to the incident, see section III, "Field Responders' Procedures for Abandoned Wastes or Emergency Spills."

#### For Non-hazardous Material

a) When the Duty Officer confirms from a caller or Health Haz Mat that the abandoned material or waste is nonhazardous, the Duty Officer contacts the appropriate City agency for action or disposal as listed below:4

- For all nonhazardous materials found between curb faces of the public . streets, notify the Bureau of Street Services service request number at (213) 485-5661.
- For construction debris, tires, tree trimmings, trash and like materials indiscriminately scattered on all pubic rights-of-way, notify the Bureau of Street Services service request number at (213) 485-5661.
  - For large items abandoned on the public right-of-way such as used furniture and appliances, or for bundled wood or lumber, dead animals and other refuse, notify Bureau of Sanitation, Recycling and Collections Division at (800) 773-CITY.
- For trash and solid food waste in catch basins, notify the appropriate Wastewater Collection Systems Division district office:

West Valley (818) 345-2107 East Valley (818) 756-9895 Hollywood (213) 485-4910 Downtown (213) 485-5391 West L.A. Venice/Westchester (310) 575-8491

- South/Harbor (323) 295-1000
- For sewage spills, overflows, and leaks, or for septic tank discharges, and

<sup>4</sup> For additional guidance, refer to "Table of Items /discharges Abandoned or Spilled on the Public Rights-of-way and City Agency Responsible for Mitigation and Disposal" contained in Appendix B.

Stormwater

Management Division

#### **ENFORCEMENT UNIT PROCEDURES MANUAL**

Subject:

#### HOTLINE RESPONSE

Date	Revision No.
7/26/99	3

Page 7 of 28

recreational vehicle septic waste spills on all pubic rights-of-way and in the storm drain system, notify Bureau of Sanitation, Wastewater Collection Systems Division at (213) 485-5884 or at the emergency number (213) 485-5391.

Sewage spills greater than 500 gallons that enter the receiving waters, including Ballona Creek and Los Angeles River are reportable to the OES. The Duty Officer ensures that a notification to OES has been made by the Wastewater Collection Systems Division of the Bureau of Sanitation within twenty-four hours of discovery of the incident. All other notifications are to be made by the Bureau of Sanitation, Wastewater Collection Systems Division. The Duty Officer notifies the Los Angeles County, Department of Health Services at (213) 974-1234.

The Duty Officer contacts and updates the complainant/caller on referral made C) or action taken. The Duty Officer provides the caller with the telephone number and name of the contact person of the responding agency.

d) The Duty Officer updates Log-in database. If an inspector is dispatched to the site to investigate, and acquired more information on the incident, the investigating inspector, usually the first responder, updates the Log-in database and writes a narrative report, as needed.

- B. After business hours (4:30 P.M. to 7:00 A.M.) and on weekends and holidays:
  - 1. The Duty Officer forwards calls from (800) 974-9794 at the end of each working day to the Information Technology Agency's Communications Operator (213) 485-5500 by using the "Call Forward" function on the Meridian telephone.
  - Other calls are directly received by the Communications Operator at (213) 485-5500. 2. Information regarding spills is faxed by the OES to the Communications Operator at (213) 485-9813. After hour calls usually come from Los Angeles County Fire Department, Health Haz Mat Division (Health Hazmat), City of Los Angeles Fire Department, or Los Angeles Police Department, Environmental Crimes Unit.
  - 3. The Communications Operator determines if the call is within the City's jurisdiction. If so, the Communications Operator contacts the on-call Senior Industrial Waste Inspector (Senior) and relays the details of the incident.
  - 4. a. If the incident is reported by Health Haz Mat, a hazcat may have already been completed.
  - i. The Senior calls and consults with Health Haz Mat Specialist who performed the Hazcat or initially responded to the call to determine the nature of the material and if the incident necessitates an emergency response and/or cleanup because of any one of the following circumstances:

b)

Stormwater

Management Division

#### **ENFORCEMENT UNIT PROCEDURES MANUAL**

Subject:

#### HOTLINE RESPONSE

e Revision No. 7/26/99 3

Date

Page 8 of 28

- There is a discharge to the public right-of-way that poses an imminent hazard to the public.
- The discharge may cause the introduction of pollutants into the storm drain system that may compromise the integrity of the system or impair the beneficial uses of the receiving waters.
- There is an abandoned drum, which contains flammable or explosive material.
- There is an abandoned drum which has spilled some material onto the public right-of-way which is currently static or not flowing but whose static condition may be reversed by runoff from an impending storm.
- The Senior, who assumes Duty Officer responsibilities, obtains the answers to the following questions from the Health Haz Mat Specialist who performed the hazcat:
- Is there a responsible party who can be required by Health Haz Mat to be liable for cleanup and disposal?
- Is the spill occurring on street (from curb face to curb face) or are other public rights-or-way (i.e., sidewalk, alley, parkway etc.) affected?
- Is there an imminent threat to the City's storm drain system or the receiving waters or has either one been already impacted?
- What is the extent and type of cleanup necessary?
- Are there precautions to be exercised by responding inspectors?
- iii. The Senior evaluates all information received from Health Haz Mat and determines the Department of Public Works agency responsible for handling the response, in compliance with the Memorandum of Understanding dated December 3, 1997 (see Appendix B for original MOU). The senior observes the following protocol:
  - For the cleanup and disposal of hazardous materials (excluding infectious waste, human waste, pharmaceutical waste, batteries or explosives) from curb face to curb face of the City streets, notify the BSS through the City Communications Operator.
- for the cleanup and disposal of hazardous materials on the sidewalk and public rights-of way beyond curb faces of the street and entering the storm drain system, including infectious waste, human waste, pharmaceutical waste, batteries, or explosives within the curb faces of the street, the Senior acknowledges that the responsibility for the mitigation lies with Stormwater Management Division only if Health Haz Mat is unable to identify or locate the Responsible Party or if the Responsible Party is financially unable to provide cleanup.
- iv. If Stormwater Management Division is the responsible agency or if the

#### ENFORCEMENT UNIT PROCEDURES MANUAL

Subject:

#### HOTLINE RESPONSE

e	Revision No.
7/26/99	3

Date

Page 9 of 28

Senior is unable to contact the Hazardous Material Coordinator of the BSS, the Senior then contacts the City's emergency response contractor to request an emergency cleanup. The Senior relates all the pertinent details of the incident that will be helpful in effecting the cleanup such as the following:

- the identity or type of material
- the incident location
- approximate area (in square feet, yards, etc.) of contamination if material has been spilled onto the street, sidewalk, alley, gutter or catch basin
- storm drain line or Waters of the State affected
- the number of containers and individual volumes of each container
- the mode of cleanup that may be necessary
  - the names and cellular telephone numbers/pager numbers of contact persons (i.e., responding inspectors, Health Haz Mat specialist, Senior etc.)
- any precautionary measures specified by Health Haz Mat.
- v. The Senior obtains an estimated time of arrival (ETA) and confirmation of response from Safety-Kleen, Inc. or its subcontractor, United Pumping Services, and notifies Health Haz Mat of the ETA.

b. If the incident is reported by an agency other than Health Haz Mat, the Senior contacts Los Angeles County Fire Department at (323) 881-2455 and asks for a Health Haz Mat Unit.

i. The Senior awaits a callback from Health Haz Mat to provide them with more information regarding the incident and requests a hazcat of the material. If the hazcat confirms that the material is hazardous and/or if Health Haz Mat identifies the material, the Senior then consults with the Health Haz Mat Specialist who performed the Hazcat or initially responded to the call to determine the nature of the material, and if the incident necessitates an emergency response and/or cleanup because of any one of the following circumstances:

- There is a discharge to the public right-of -way that poses an imminent hazard to the public.
- The discharge may cause the introduction of pollutants into the storm drain system that may compromise the integrity of the system or impair the beneficial uses of the receiving waters.
- There is an abandoned drum, which contains flammable or explosive material.
- There is an abandoned drum which has spilled some material onto the public right-of-way, which is currently static or not flowing but whose static condition

Stormwater Management Division

Stormwater

Management Division

#### **ENFORCEMENT UNIT PROCEDURES MANUAL**

Subject:

#### HOTLINE RESPONSE

Revision No. 7/26/99 3

Date

Page 10 of 28

may be reversed by runoff from an impending storm.

- ii. The Senior follows the procedure specified in the previous section II.B.4.a.ii.-v.
  - iii. The Senior notifies all impacted agencies as listed below:
    - For discharges affecting Los Angeles County (L.A.County) storm drain • system, notify L.A. County Public Works Hotline at (800) 303-0003 or L.A.County Flood Control Emergency number (626) 458-4357.
    - For discharges affecting the Waters of the State, notify the following numbers after business hours, and during weekends and holidays:
      - State Department of Fish and Game at (916) 445-0045

Regional Water Quality Control Board at (213) 576-6600

United States Coast Guard, Marine State Office (Long Beach) for releases affecting any navigable waterway, including tributaries at (562) 980-4444

For abandoned wastes and spills occurring within railroad property, notify: Santa Fe Railroad Emergency at (800) 285-2164

Union Pacific Railroad (formerly Southern Pacific Railroad) at (800) 892-1283.

- For spills or abandoned wastes on railroad property, the Senior confirms that upon notification, the owner/operator of the property will handle the cleanup of its property through its own Haz Mat personnel or contractor. If the spill is caused by the railroad operator/owner and the spill affects the City streets, public right-of-way or storms drain system, the Senior informs the operator/owner of its responsibility to clean up all affected areas.
- iv. The Senior dispatches two Industrial Waste Inspectors (designated first and second responders for the day<sup>5</sup>), to the incident location in order that they may investigate the incident, perform source or responsible party identification, supervise the cleanup, and facilitate communication between the City and all other affected agencies. The Senior then briefs the responders on information obtained from Health Haz Mat and Safety-Kleen, Inc.
- If the release is of reportable quantity, the Senior verifies from Health Haz Mat V. if a notification to the State Office of Emergency Services (OES) has been made. If not, the Senior reports the incident to OES at (800) 852-7550.
- vi. The Senior contacts the Bureau of Street Services through the Communications Operator if barricading and immediate containment (with use of absorbent material or sand bags) are needed.
- vii. If the incident is in impeding traffic in an alley or a street, the Senior calls the 24-hour Department of Transportation Public Service and Information number

5 On a monthly basis, a schedule of first and second responders is published. The first and second responders are designated for the entire day and are on call after business hours.

City of Los Angeles	ENFORCEMENT UNIT PROC	EDURES MANU	JAL	
Dept. of Public Works Bureau of Sanitation Stormwater	Subject:	Date 7/26/99	Revision No. 3	
Management Division	HOTLINE RESPONS	1 mg	Page 11 of 28	

at (818) 756-9418 or (213) 485-4184 for traffic control.

- viii. The Senior continues to communicate with field personnel or responders (i.e., Health Haz Mat, Inspectors, United Pumping Services) for additional assistance needed at the incident site until cleanup or disposal is completed. The Senior may seek the assistance of the Communications Operator for contacting different City and outside agencies because the Operator has a comprehensive listing of after-hour or emergency telephone numbers and contact persons.
- ix. If subsequent enforcement action, cost recovery, or any other follow-up actions are required relating to the incident, see Section III, "Field Responders' Procedures for Abandoned Wastes or Emergency Spills."

#### III. FIELD RESPONDERS' PROCEDURES FOR ABANDONED WASTES OR EMERGENCY SPILLS

Once the incident has been assigned to an inspector team (first and second responders), the first responder assumes the lead in the team and the second responder assists the lead inspector in his/her investigation.

- A. When the inspection team is dispatched to the incident location, the first responder leads any source investigation or responsible party identification required in the field. Other first responder responsibilities include:
  - 1. ensures smooth workflow and completion of all scheduled abandoned waste pickups and emergency spill cleanups during the day of assignment;
  - acts as Incident Commander at sites where command has been relinquished by LA County Fire Health Haz Mat or other agency to Stormwater Management Division, or during incidents where Stormwater Management Division is first to arrive on scene;
  - contacts complainant to verify details of complaint or to update him/her of actions taken by responders;
  - ensures that all measures are taken to protect the storm drain system and that cleanup of the storm drain system is adequate and prevents the contamination of other systems and the Waters of the State;
  - 5. supervises cleanup of contractors, examines manifests and work orders for accuracy and signs paperwork pertaining to cleanup;
  - communicates to Senior Inspectors/Duty Officer the status of cleanup, unanticipated problems, additional resource needs, etc.;
  - notifies Senior Inspectors of possibility for enforcement and requests supervisory assistance and/or presence on site, as necessary;
  - 8. performs investigation necessary to identify responsible party, to assess extent of

#### ENFORCEMENT UNIT PROCEDURES MANUAL

Subject:

HOTLINE RESPONSE

Revision No. 7/26/99 3

Date

Stormwater Management Division

damage to City property or storm drains and to further efforts in recovering City costs:

- 9. issues Notices to Comply or Notices of Violation for violations of L.A.M.C. Sec. 64.70, such as those that pertain to the entry of illicit discharges or non-stormwater into the storm drain system or receiving waters;
- 10. writes field reports and performs all data entry for each day of assignment; and
- 11. performs all follow-up investigations or communications relating to the day's incidents.
- B. The second responder assists the first responder in the manner indicated below:
  - acts as Safety Officer where First Responder is the Incident Commander; 1.
  - conducts all in-vehicle communications; 2.
  - acts as navigator to First Responder (driver) and provides directions to First Responder;
  - takes samples to validate cause for enforcement or to identify pollutants of illegal or 4 unknown discharges;
  - 5. preserves sample, prepares chains-of-custody and contacts laboratory for timely acceptance of samples:
  - takes photographs of discharge and other evidentiary items incriminating the responsible 6. party:
  - 7. notes witness statements for reference in pursuit of any enforcement actions;
  - 8. notifies appropriate agencies of incident, as requested by First Responder;
  - 9. submits field notes to First Responder and contributes to the completion of the First Responder's reports; and
  - 10. assists the First Responder, as needed, in the performance of the First Responder's responsibilities above.
- C. The inspection team locates the storm drain map that applies to the location to determine the direction of flow of the discharge and the storm drain lines affected, from the point of Based on the drainage map, the inspection team determines the extent of entry. contamination of the storm drain lines and therefore, makes a general assessment of the extent of cleanup required. The inspection team seeks the assistance of one or more of the following groups:
  - Bureau of Sanitation, Wastewater Collection Systems Division
  - Los Angeles County Public Works, Flood Control
  - L.A. County Fire Health Haz Mat
- D. The inspection team oversees the cleanup by the City emergency response contractor and that performed by the responsible party's emergency response contractor. The team ensures that with both remedial efforts, the threat of the discharge has been completely removed and the cleanup effectively performed.
- E. The first responder checks the hazardous waste manifest and work order for accuracy and validates these documents with his/her signature.

City of Los Angeles	ENFORCEMENT UNIT PROCEDU	RES MANU	JAL
City of Los Angeles Dept. of Public Works Bureau of Sanitation	Subject:	Date 7/26/99	Revision No.
Stormwater Management Division	HOTLINE RESPONSE	Page 13 of 28	

- F. Enforcement action is required if a violation of Section 64.70.02 of the L.A.M.C. has been detected. A discussion of the L.A.M.C. Sec.64.70.02 and its corresponding enforcement actions may be referred to in Part II, Section 2.0 "Prohibitions of Stormwater Ordinance" of the Enforcement Response Plan. If the first responder determines that a violation of Section 64.70 has taken place or if the inspection team deduces wrong doing or criminal intent in violating other environmental standards, the inspection team documents the violation by collecting evidence such as taking photographs, witnesses accounts, and samples of the discharge.
- G. The first responder contacts the on-call Senior Industrial Waste Inspector and briefs him/her regarding the incident and violation in question. The Senior Inspector decides the best enforcement option to pursue.
- Once approved by Senior Inspector, the first responder issues a Notice To Comply or Notice of Violation to the responsible party at the appropriate time (i.e., when violation has been confirmed by evidence) by personal service or registered mail.
  - If the incident appears to have violated discharge prohibitions or standards of the Health and Safety Code, Clean Water Act, or any other environmental statute, the Senior Inspector may refer this case to the appropriate enforcement agency.
  - If the incident appears to have violated discharge standards or prohibitions of multiple statutes, the Senior Inspector then compiles the reports and evidence and turns the case over to the District Attorney's Strike Force or Environmental Protection Agency Strike Force for review.
- H. The first responder updates the Call Log-in Database and writes a narrative report. If the call is received after business hours, the first responder enters the details of the call (as a Duty Officer would when he/she first receives the call) and actions taken, during the next business day. The first responder contacts and updates the caller regarding the cleanup.
- If additional investigations are needed or if the cleanup is effected for a long period of time, the first responder returns to the site for follow-up until the cleanup or investigation is complete.
- J. If any of the City's costs can be recovered through a legal process, the first responder prepares the letter and invoice requiring payment, updates the Cost Recovery database, and notifies the City Attorney's office of any delinquencies. To adequately document the Inspector time spent on any particular enforcement case or incident for the purposes of cost recovery, the Inspectors indicate the number of hours spent on the case or incident and make reference to the specific Call ID number and incident location on the comment section of their timesheets.

#### ENFORCEMENT UNIT PROCEDURES MANUAL

Subject:

HOTLINE RESPONSE

Revision No. 7/26/99 3

Stormwater Management Division

Page 14 of 28

Date

#### PROCEDURES FOR UNAUTHORIZED (ILLICIT) CONNECTIONS<sup>6</sup> IV.

- A. Calls are received by the Duty Officer at the hotline number (800) 974-9794, (when option 1 of the voice mail is selected) or directly from (213) 847-4852 or 485-1776. Callers may be private citizens, or representatives of City Departments, Los Angeles County Public Works, Los Angeles County Fire Department, State and federal agencies.
- B. Written referrals from local, State and federal enforcement agencies are received via mail or fax by the Chief or Senior Industrial Waste Inspector.
- C. Referrals (written or verbal) for further investigation are also received by the Chief or Senior Industrial Waste Inspector from various enforcement agencies during the District Attorney's and/or EPA Strike Force meetings and forwarded to the Duty Officer.
- D. The Duty Officer inputs information from the worksheet, referrals, or faxes into Initial Call Worksheet of the Call Log-in Database. (See copy of Worksheet and Protocol for Call Log-in Entry System in Appendix E). The call is automatically assigned a call ID number by the computer. Additionally, the Duty Officer creates a file for all supporting documentation of referral such as photographs, inspection reports, and witnesses' accounts.
  - E. The Duty Officer determines if the incident called in is within City of Los Angeles territory.
    - 1. If the call is outside the City's jurisdiction, the following protocol is followed:
      - a. The Duty Officer calls L.A. County Public Works hotline (800) 303-0003 or the appropriate municipality to report unauthorized (illicit) connections<sup>7</sup>.
      - b. The Duty Officer then contacts the complainant/caller and informs the complainant that the details of the incident have been relaved to another agency for action.
      - c. The Duty Officer updates the Call Log-in database to reflect referral made and receiving agency's response.

6 Refer to flowchart, "Interim Procedure for Elimination of Illicit Connections" posted at the Duty Officer Station. 7 An illicit connection is a specific pathway for an illicit discharge. Therefore, a discharge must be observed flowing out of the connection, or evidence of intermittent or infrequent discharge must be detected prior to proceeding with the investigation of such a connection.

City of Los Angeles	
Dept. of Public Works	
Bureau of Sanitation	

# ENFORCEMENT UNIT PROCEDURES MANUAL

Subject:

#### HOTLINE RESPONSE

Date Rev 7/26/99

Revision No. 3

Page 15 of 28

If the call is within the City of Los Angeles's jurisdiction, the following protocol is followed:

- a. The Duty Officer searches the database for previous complaints on similar incidents or discharge location by using the duplicate check function in the Call Log-in database.
- b. If there are previous complaints on similar incidents or discharge locations, the Duty Officer quickly reviews the database for past investigations, samplings or enforcement actions.
- c. The Duty Officer dispatches two inspectors to assess situation and sample any discharge to determine the type and source of pollutant. Samples for *Colilert* testing are taken, especially if a sewage contamination is suspected. Such samples are taken in 125 ml sample bottles, stored in a cooler at 10°C, and submitted to EMD as soon as possible for processing by EMD within six hours from time of collection.

d. The Inspectors perform the field tests included in the Storm Drain Kits (Model SSDK Code 7446 by LaMotte) such as total residual chlorine, phenols, detergents, total copper, color, turbidity and pH. The inspectors also check temperature and conductivity.

e. The inspectors submit the sample to the Environmental Monitoring Division (EMD) for testing. EMD may be contacted at the following telephone numbers:

During business hours:

Hyperion Plant

Ron Cressey, Water Biologist III – (310) 648-5349; pager (310) 249-2524

Terminal Island Plant

Soun Chanjamsri, Process Control Lab Supervisor: (310) 528-7680; pager (310) 249-1295

D.C.Tillman Plant

James Kim, Senior Chemist: (818) 756-8175; pager (310) 249-7493 Lee Huang, Lab Manager, D.C. Tillman Laboratory: (310) 648-5923 After business hours:

Lee Huang, Lab Manager for emergency tasks: pager (310) 249-8232; home (626) 287-4828

Stormwater Management Division

2.

	ENFORCEMENT	UNIT	PROCEDU	<b>RES MANUA</b>
--	-------------	------	---------	------------------

Subject:

ii.

Stormwater Management Division

#### HOTLINE RESPONSE

Date 7/26/99

3

Revision No.

Page 16 of 28

f. EMD performs tests on sample amd submits preliminary results to Stormwater Inspectors within 24 hours.

#### If the lab results indicate sewage:

a. The Duty Officer contacts the Wastewater Collection Systems Division (WCSD) to contain the discharge and pump it into the sewer. Wastewater Collection may be contacted at (213) 847-0527 during business hours, or (310) 823-5507 or (310) 822-0777 after business hours.

b. The lead inspector seeks assistance from WCSD in checking the storm drain maps for upstream tributaries to the connection.

c. Lead inspector coordinates confined space entry or CCTV inspection of main line by WCSD to track house connection.

- If WCSD detects sewer infiltration into the storm drain i. system, WCSD performs dye test to determine leaking sewer line. Once WCSD finds the sewer line, WCSD takes over the invetsigation and repairs the sewer line.
  - a) WCSD cleans the storm drain line (flushes while blocking the storm drain line, disinfects and pumps the generated wastewater into the sewer).
  - b) Inspectors follow up on completion of repairs and sample the storm drain line to check for any signs of sewage infiltration, and submit the sample to any EMD laboratory.
  - c) If the lab results still indicate the presence of sewage, WCSD will resume the investigation, cleanup and repair of the storm drain line.
  - If WCSD does not detect any sewer infiltration but instead finds a sewer house connection directly connected to the storm drain lateral in question, Inspectors and WCSD jointly perfrom dye test on the domestic or industrial sink to confirm the source.

a) If the discharge does not pose a public health and

#### ENFORCEMENT UNIT PROCEDURES MANUAL

Subject:

Stormwater Management Division

#### HOTLINE RESPONSE

7/26/99

Date

Page 17 of 28

or conserves investigated

you youture of and alight

- nd Galety and mysericity
- submit involce to the cover all City costs in all discribinge

t, the individual dumants to the City Attempty to

ing to comply, the Lead too from his subarrisor. boold:

And out or water wat.

per the oppower to pound

Marias, The City Alasenaty inal Margus spaines into

I NPDES permit for the application where Mater Quality Cost of Board forcement and wards att

DOMESTIC POINT PROFESSION

the to the Gate Department of Fair

safety threat, the Inspectors should notify the owner/operator of the source (facility) that a discharge from his/her facility is causing a contamination problem in the storm drain system.

- The Lead Inspector issues a Notice of Violation to the owner/operator to cease and desist any discharges into the storm drain system.
- The Lead Inspector then refers the case to the Department of Building and Safety to issue a Notice to Disconnect (sewer line from storm drain system) to facility operator/owner.
- The Lead Inspector keeps track of Building and Safety's enforcement action status to determine if the operator complies with the Notice to Disconnect by re-routing the facility's line to the sewer.
- b) If the discharge poses a health and safety threat due to public exposure to the hazards of the discharge, the Inspectors should notify the owner/operator of the source (facility) that a discharge from his/her facility is causing a contamination problem in the storm drain system.
  - The Inspectors issue a Notice of Violation to the facility owner/operator to cease and desist any discharge to the affected storm drain line. The Inspectors should explain that failing to cease and desist is a violation of L.A.M.C. Sec. 64.70 and considered a misdemeanor and therefore punishable by a fine of \$1000.00 or imprisonment for six months, or both.
  - If the owner/operator is willing to comply and take corrective actions, the operator ceases discharge and performs work to reconnect to sanitary sewer.

a) The operator obtains the necessary Industrial

- Waste permits, connection permits or Building permits.
- b) WCSD stops all containment and temporary

# ENFORCEMENT UNIT PROCEDURES MANUAL

Sanitation Subject:

Stormwater Management Division

#### **HOTLINE RESPONSE**

Date 7/26/99

Revision No. 3

Page 18 of 28

diversion to sanitary

sewer while work is being performed by the operator to complete permanent connection to the sanitary sewer.

- WCSD cleans storm drain line by flushing and disinfecting the storm drain while pumping any resulting discharge into the sanitary sewer.
- WCSD, Building and Safety and Inspectors inspect the completed diversion for proper installation.
- e) The City Divisions submit invoice to the owner/operator to recover all City costs in mitigating the storm drain discharge.
  - If costs are not recovered, the individual divisions will refer the case to the City Attorney for collection.
- c) If the owner/operator is not willing to comply, the Lead Inspector can select, with guidance from his supervisor, among three options on how to proceed:
  - a) The Lead Inspector may refer the case to the City Attorney, who

then seeks an injunctive relief for the operator to cease and

desist and take corrective actions. The City Attorney may also choose to file criminal charges against the operator; or

- b) If the operator possesses a NPDES permit for the facility(contamination source), the Lead Inspector refers the case to the Regional Water Quality Control Board who then takes over enforcement and issues an Administrative Civil Liability; or
- c) If the operator does not possess a NPDES Permit, the Lead

Inspector refers the case to the State Department of Fish

d)

C)

Stormwater

Management Division

#### **ENFORCEMENT UNIT PROCEDURES MANUAL**

Subject:

HOTLINE RESPONSE

7/26/99 3

Revision No.

Date

Page 19 of 28

Son thed to the storm drain indicate collform becteria, isolated case of cettopold he Lead inspector updates at and advises him or her to here service.

and Game, and to L.A. County Department fo Health Services at (213) 351-5132.

 d) The Inspectors then follow up with the enforcing agency(ies) on the status of the case and corrective action and coordinate the cessation of containment by WCSD.

- e) The Inspectors refer the case to Industrial Waste Management Division for permitting, if necessary.
- f) WCSD attempts to recover cost through City Attorney.
- g) If the operator delays compliance with the injunctive relief or other City Attorney action, WCSD analyzes situation and considers impact of illict discharge/connection on storm drain system.
  - a) If WCSD can perform the necessary work for reconnection to the sanitary sewer and stop the discharge, WCSD informs Bureau Director and briefs him/her on the work required.
  - b) Bureau Director approves WCSD involvement in reconnection work.
  - c) Lead Inspector notifies owner/operator of Bureau action and City's intent to recover all City costs.
  - WCSD takes lead in reconnection activities (emergency contractor hired by Bureau of Engineering, Collection Systems Engineering Division may perform work).
  - e) Bureau of Engineering, Survey Division verifies main storm drain line, laterals, and house connections.
  - f) WCSD assists in coordinating with Dig-Alert to verify all underlying lines.
  - g) WCSD reconnects sewer discharge line to the sanitary sewer.
  - h) WCSD cleans storm drain line.
  - WCSD submits invoice to the owner/operator for cost recovery, or refers case to the City Attorney for collection.

of the source (facility) that optimination problem in

or of Violation to Inu-

case to the Department of to Disconnect (newer time wardoperator.

at Building and Safety's as if the operator compliant other the facilities like to the

I earliely thread clus to public argo, the inspectors should be (facility) that a discharge

# **ENFORCEMENT UNIT PROCEDURES MANUAL**

Subject:

Stormwater Management Division

#### HOTLINE RESPONSE

Date 7/26/99

Revision No.

Page 20 of 28

iii. If there is no sewer house connection tied to the storm drain lateral in question and lab results indicate coliform bacteria, the discharge may have just been an isolated case of cesspool dumping into a nearby catch basin. The Lead Inspector updates the caller of the illicit discharge incident and advises him or her to call the Stormwater Hotline if the discharge recurs.

#### If the lab results indicate industrial waste:

- a. WCSD contains and pumps the discharge into the sanitary sewer.
- The Lead Inspector seeks assistance from WCSD in checking the storm drain maps for upstream tributaries to the connection.
- c. Lead Inspector coordinates confined space entry or CCTV inspection of main line by WCSD to track house connection.

i. If a similar discharge from the house connection is coming into the main storm drain line, Inspectors and WCSD jointly perform dye test on the domestic or industrial sink to confirm the source.

- a) If the discharge does not pose a public health and safety threat, the Inspectors should notify the owner/operator of the source (facility) that a discharge from his/her facility is causing a contamination problem in the storm drain system.
  - The Lead Inspector issues a Notice of Violation to the owner/operator to cease and desist any discharges into the storm drain system.
  - 2. The Lead Inspector then refers the case to the Department of Building and Safety to issue a Notice to Disconnect (sewer line from storm drain system) to facility owner/operator.
  - 3. The Lead Inspector keeps track of Building and Safety's enforcement action status to determine if the operator complies with the Notice to Disconnect by re-routing the facility's line to the sewer.
  - b) If the discharge poses a health and safety threat due to public exposure to hazards of the discharge, the Inspectors should notify the owner/operator of the source (facility) that a discharge

#### ENFORCEMENT UNIT PROCEDURES MANUAL

Subject:

#### HOTLINE RESPONSE

7/26/99 3

Date

Revision No.

from his/her facility is causing a contamination problem in the storm drain system.

- 1. The Inspectors issue a Notice of Violation to the facility owner/operator to cease and desist any discharge to the affected storm drain line. The Inspectors should explain that failing to cease and desist is a violation of L.A.M.C. Sec. 64.70 and considered a misdemeanor and therefore punishable by a fine of \$1000.00 or imprisonment for six months, or both.
  - 2, If the owner/operator is willing to comply and take corrective actions, the operator ceases discharge and performs work to reconnect to sanitary sewer.
    - The operator obtains the necessary Industrial Waste a) permits, connection permits or Building permits.
    - WCSD stops all containment and temporary diversion b) to sanitary sewer while work is being performed by the operator to complete permanent diversion to the sanitary sewer.
      - WCSD cleans storm drain line by flushing and disinfecting the storm drain while pumping any resulting discharge into the sanitary sewer.
    - WCSD, Building and Safety and Inspectors inspect the d) completed diversion for proper installation
    - The City Divisions submit invoice to the owner/operator e) to recover all City costs in mitigating storm drain discharge.
    - If costs are not recovered, the individual divisions will f) refer the case to the City Attorney for collection.

3. If the owner/operator is not willing to comply, the Lead Inspector can select, with guidance from his supervisor, among three options on how to proceed:

a) the Lead Inspector may refer the case to the City Attorney, who then seeks an injunctive relief for operator to cease and desist and take corrective actions. The City Attorney may also

Stormwater Management Division

C)

### ENFORCEMENT UNIT PROCEDURES MANUAL

Subject:

Stormwater
Management
Division

#### HOTLINE RESPONSE

Revision No.

Page 22 of 28

- choose to file criminal charges against the operator; or
- b) If the operator possesses a NPDES permit for the facility (contamination source), the Lead Inspector refers the case to the Regional Water Quality Control Board who then takes over enforcement and issues an Administrative Civil Liability; or
- c) If the operator does not possess a NPDES Permit, the Lead Inspector refers the case to the State Department of Fish and Game and to L.A. County Department fo Health Services at (213) 351-5132.
- The Inspectors then follow up with the enforcing agency(ies) on the status of the case and corrective action and coordinate the cessation of containment by WCSD.
- 5. The Inspectors refer the case to Industrial Waste Management Division for industrial waste permitting, if necessary.
- 6. WCSD attempts to recover cost through City Attorney.
- If the operator delays compliance with the injunctive relief or other City Attorney action, WCSD analyzes situation and considers impact of illict discharge/connection on storm drain system.
  - a) If WCSD can perform the necessary work for reconnection to the sanitary sewer and stop the dsicharge, WCSD informs Bureau Director and briefs him/her of the work required.
  - b) Bureau Director approves WCSD involvement in reconnection work.
  - c) Lead Inspector notifies owner/operator of Bureau action and City's intent to recover all City costs.
  - d) WCSD takes lead in reconnection activities (emergency contractor hired by Bureau of Engineering, Collection Systems Engineering Division may perform work).
  - e) Bureau of Engineering, Survey Division verifies main storm drain line, laterals, and house conenctions.
  - f) WCSD assists in coordinating with Dig-Alert for verification of all underlying lines.

Stormwater

Management Division

### ENFORCEMENT UNIT PROCEDURES MANUAL

Subject:

#### HOTLINE RESPONSE

7/26/99

Date

Revision No. 3

Page 23 of 28

- g) WCSD reconnects sewer discharge line to the sanitary sewer.
- WCSD cleans storm drain line.WCSD submits invoice to the owner/operator for cost recovery or refers case to the City Attorney for collection.

ii. If a dissimilar discharge is detected coming into the storm drain main line, Inspectors survey the area to determine possible sources of industrial waste or pollutant.

a) If no possible source can be found, the discharge may be dismissed as an isolated case or a case of one-time illegal dumping.

*b)* If a possible source is found during the survey, Inspectors and WCSD jointly perform dye test on the domestic or industrial sink to confirm the source. Inspectors follow the same procedures in Section E.2.c.v.a.

#### V. PROCEDURES FOR ILLICIT DISCHARGES

- A. Calls are received by the Duty Officer at the hotline number (800) 974-9794 (when option 1 of the voice mail is selected) or directly from (213) 847-4852 or 485-1776. Callers may be private citizens, or representatives of City Departments, Los Angeles County Public Works, Los Angeles County Fire Department, State and federal agencies.
- B. Written referrals from State, federal and local enforcement agencies are received via fax or mail by the Duty Officer.
- C. Referrals (written or verbal) for further investigation are also received by the Chief or Senior Industrial Waste Inspector from various enforcement agencies during the District Attorney's and/or EPA Strike Force meetings and forwarded to the Duty Officer.
- D. The Duty Officer inputs information from the worksheet, referrals, or faxes into Initial Call Worksheet of the Call Log-in Database. (See copy of Worksheet and Protocol for Call Log-in Entry System in Appendix E). The call is automatically assigned a call ID number by the computer. Additionally, the Duty Officer creates a file for all supporting documentation of referral such as photographs, inspection reports, and witnesses' accounts.
- E. The Duty Officer determines if the incident called in is within City of Los Angeles

# **ENFORCEMENT UNIT PROCEDURES MANUAL**

<sup>n</sup> Subject:

Stormwater Management Division

#### HOTLINE RESPONSE

Date 7/26/99

3 3

Revision No.

Page 24 of 28

territory. 1. If the call is outside the City's jurisdiction, the following protocol is followed: The Duty Officer calls L.A. County Public Works hotline (800) 303a. 0003 or the appropriate municipality to report the illicit discharge. b. The Duty Officer then contacts the complainant/caller and informs the complainant that the details of the incident have been relayed to another agency for action. c. The Duty Officer updates the Call Log-in database to reflect referral made and receiving agency's response. 2. If the call is within the City of Los Angeles's jurisdiction, the following protocol is followed: The Duty Officer searches the database for previous complaints on a. similar incidents or discharge location by using the duplicate check function in the Call Log-in database. If there are previous complaints on similar incidents or discharge b. locations, the Duty Officer quickly reviews the database for past investigations, samplings or enforcement actions. The Duty Officer dispatches two inspectors to assess situation and C. sample any discharge, especially when the source of the discharge is not immediately identifiable or traceable. Samples for Colilert testing are taken, especially if a sewage contamination is suspected. Such samples are taken in 125 ml sample bottles, stored in a cooler at 10°C, and submitted to EMD as soon as possible for processing by EMD within six hours from time of collection. Whenever necessary or helpful, Inspectors perform the field tests d. included in the Storm Drain Kits (Model SSDK Code 7446 by LaMotte) such as total residual chlorine, phenols, detergents, total copper, color, turbidity and pH. The inspectors also check temperature and conductivity. These field tests will not only help ascertain the nature of the discharge and possible sources, but also assist the Inspectors in narrowing down the list of pollutants to be sampled for and tested by the laboratory. e. Inspectors perform a visual inspection of the discharge and the

# **ENFORCEMENT UNIT PROCEDURES MANUAL**

Subject:

Stormwater Management Division

#### **HOTLINE RESPONSE**

7/26/99 3

Date

Revision No.

Page 25 of 28

structure that conveys it such as the street, street gutter, storm drain, or catch basin. Inspectors check the discharge for the following indications:

- i. odor
- ii. color
- iii. turbidity
- iv. presence of floatable matter
- v. presence of oil sheen
- vi. flow (i.e., intermittent, continuous, low or high), and
- vii. temperature.
- . Inspectors check the conveyance for the following:
  - i. structural damage such as cracking, deterioration, spalling of concrete or peeling of surface paint
  - ii. deposits and stains
  - iii. vegetation surrounding the conveyance, and
  - iv. PVC pipes or hoses connected to or directed toward the conveyance.
- g. Inspectors document all observations on the Illicit Discharge/Connections Field Investigation Checklist shown in Appendix M.
- Inspectors take photographs of the discharge, samples taken, sample labels, the affected drainage area, the surrounding areas, and street signs and numbers (to identify geographical location).
  - Inspectors should refer to the guide "Investigation of Inappropriate Pollutant Entries into Storm Drainage Systems" in Appendix L, for the interpretation of physical and chemical observations made at the site of illicit discharge. For example, a sulfide (i.e., rotten egg) odor usually indicates stale sewage or discharges from meat packers, canneries, or diaries.
  - The inspectors leave the site to submit any sample (s) to the Environmental Monitoring Division (EMD) for testing. EMD may be contacted at the following telephone numbers:

During business hours: Hyperion Plant

f.

i.

#### **ENFORCEMENT UNIT PROCEDURES MANUAL**

Subject:

Stormwater Management Division

#### HOTLINE RESPONSE

Date 7/26/99

3

Revision No.

Page 26 of 28

Ron Cressey, Water Biologist III – (310) 648-5349; pager (310) 249-2524

**Terminal Island Plant** 

Soun Chanjamsri, Process Control Lab Supervisor: (310) 528-7680; pager (310) 249-1295

D.C.Tillman Plant

James Kim, Senior Chemist: (818) 756-8175; pager (310) 249-7493

Lee Huang, Lab Manager, D.C. Tillman Laboratory: (310) 648-5923

After business hours:

Lee Huang, Lab Manager for emergency tasks: pager (310) 249-8232; home (626) 287-4828

- k. EMD performs tests on sample and submits preliminary results to Stormwater Inspectors within 24 hours.
- I. If the lab results indicate sewage, refer to Section IV of the Hotline Response,"Procedure for Responding to Complaints Regarding Unauthorized (Illicit) Connections."
- m. If the lab results indicate hazardous waste, Inspectors should refer to Section III of the Hotline Response, "Procedure for Responding to Requests of Abandoned Wastes on the Public Rightof-Way or Notification of Emergency Spills [For Industrial Waste Inspectors Dispatched to Incident Site (First and Second Reponders)].

If the lab results indicate industrial waste and the discharge appears to come from a direct connection<sup>8</sup> into the storm drain system or catch basin, inspectors should first determine whether the discharge is exempted, conditionally exempted, or authorized by the Regional Water Quality Control Board (Regional Board). If not exempt or authorized by the Regional Board, Inspectors should then refer to Section IV of the Hotline Response,"Procedure for

8 Direct connections are physical connections of sanitary, commercial, or industrial piping carrying untreated or partially treated wastewater to a separate storm drainage system. Although these are commonly unauthorized, they may be intentional or may be accidental due to mistaken identification of sanitary sewer lines.

#### ENFORCEMENT UNIT PROCEDURES MANUAL

Subject:

HOTLINE RESPONSE

e Revision No. 7/26/99 3

Date

Page 27 of 28

Responding to Complaints Regarding Unauthorized (Illicit) Connections." However, if the discharge is exempt or permitted, no further investigation or sampling is necessary, unless the discharge exhibits physical characteristics that arouse suspicion.

 o. If the lab results indicate industrial waste and the discharge appears to be coming from sheet flow or from a curb drain, the Inspectors trace the flow upstream to identify the source.

- If the discharge is no longer flowing at the time the Inspectors reach the suspected source, the Inspectors look for evidence of similar discharge (such as staining) at the curb drain, driveway, or parking lot.
- Once the source is identified, Inspectors should determine whether the discharge is exempted, conditionally exempted, or authorized by the Regional Water Quality Control Board (Regional Board).
- iii. If not exempt or authorized by the Regional Board, Inspectors then approach the owner/operator of the facilty suspected to be the source and explain to him/her that there is a possible contamination problem arising from the discharge.
- p. If the discharge does not arise from sheet flow but comes from a discreet source or drain within the facility and the discharge has been determined not to be exempt or permitted by the Regional Board, the Inspectors ask for permission to dye the industrial/commecial sink or other drain to confirm that the discharge flows into the curb drain in question.
  - i. The Inspectors continue to investigate inside the facility to identify possible industrial or commercial processes or storage areas that may generate similar pollutants or exhibit similar physical characteristics as the sample originally tested by EMD.
  - The Inspectors take photographs of the storage area or industrial process that generates the illicit discharge.
- q. Inspectors refer to the Enforcement Response Plan to determine the corrective or enforcement action that applies to the illicit discharge.
- r. Inspectors execute the corrective action, explain the applicable

Stormwater Management Division

## **ENFORCEMENT UNIT PROCEDURES MANUAL**

ation Subject:

Stormwater Management Division

#### **HOTLINE RESPONSE**

Date 7/26/99

Revision No.

Page 28 of 28

provisions of L.A.M.C. Sec. 64.70 and provide helpful educational materials to the facility owner/operator.

- s. If the discharge is in violation of other laws, statutes or regulations, the Inspectors, upon consulting with their supervisor, may consider a joint investigation/enforcement with another agency that has similar or overlapping jurisdiction over the violation.
- t. The Lead Inspector informs the caller or referring agency about the status of the illicit discharge, updates the Call Log-in database, and writes an investigation and enforcement report.
- u. The Inspectors perform follow-up investigations, as needed, to determine that remedial actions have been taken by the facility owner/operator, or if recurring discharges are reported to the Stormwater Hotline.

If if not exempt or substitute by the Required Sound Inscention them apprends the period spatiality of the liturity discretical to be the source and exploit to burdler that them is a product construmentar problem missing from the discharge if the discretize rous not arise from the discharge a discretification problem missing from the discharge in discretification within the facility and the discharge has been discretize as drain within the facility and the discharge frequent Board, the trapelition list to be exempt or permuted by the field static frequence and an a structure the facility and the discharge frequent Board, the trapelition list to be exempt or permuted by the field static frequence and the permutet for the discharge.

- C The Inspectore continue to investigate inside the lineary to carrier possible industrial or communical processors of analign invest that may generate similar politization or solicit similar chesical characteristics as the terminar coginality tested by ERE.
- The Interactional takes choicegraphics of the shortegy and, compluminal prototols. This predictines the West discontegy.

a) Impediate relay for the Enforcement Planuary Planuar activities the constative or enforcement watcout that applies to the intervet-infrance in trapediate execute the contextive satisfy, replace has supported.


### HOTLINE RESPONSE FLOWCHART FOR SPILLS AND ABANDONED WASTE

#### **APPENDIX B**

.

#### HOTLINE RESPONSE FLOWCHART FOR SPILLS AND ABANDONED WASTES

7

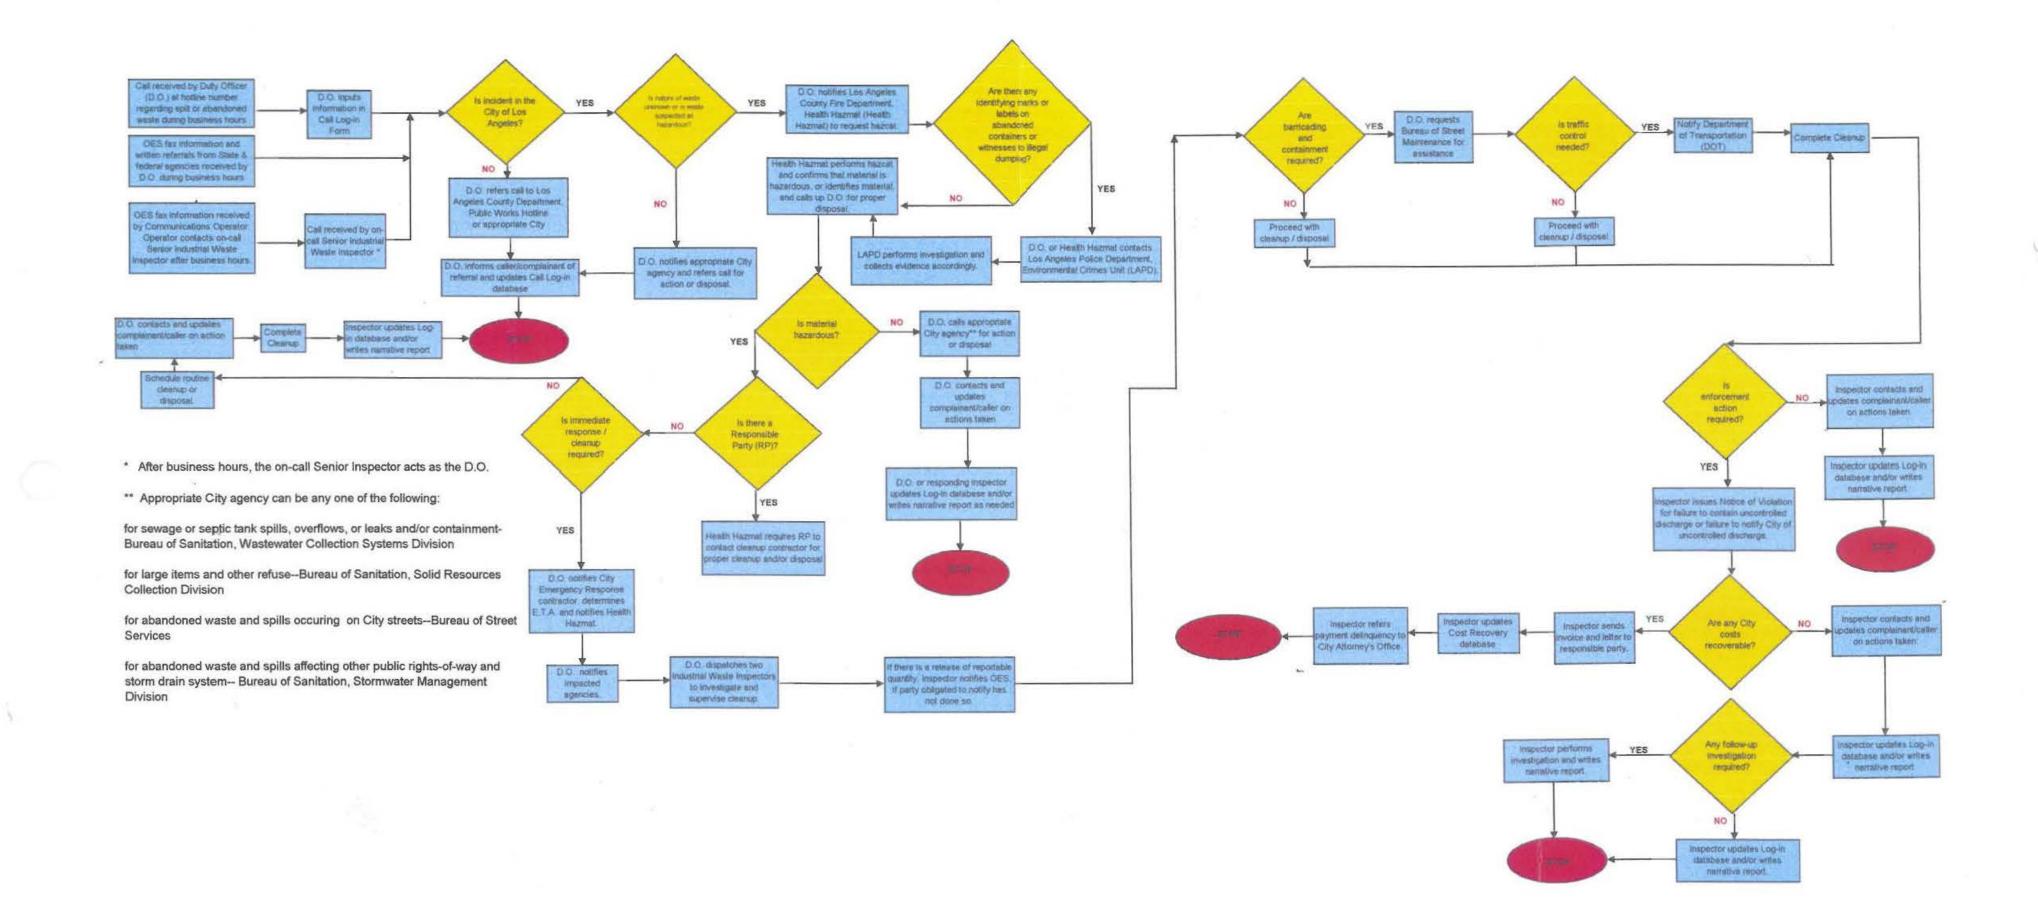

# Appendix A

# **Additional Watershed Information**

# Santa Monica Bay Beach Bacteria TMDL Monitoring Exceedance Frequency Summary Table (2008-2013)

	Exceedance Frequency for Santa Monica Bay Beaches Bacteria TMDL Monitoring																		
		2008			2009			2010			2011			2012		2013			
Location	#	SS	GM	#	SS	GM	#	SS	GM	#	SS	GM	#	SS	GM	#	SS	GM	
Dry - Summer																			
SMB-2-1	24	6	4	23	1	7	26	6	1	30	0	0	32	2	2	11	1	0	
SMB-2-2	17	2	2	23	0	19	14	9	1	18	2	4	15	2	0	8	0	0	
SMB-2-3	30	3	0	28	0	0	28	0	2	31	2	0	28	1	0	24	0	0	
SMB-2-4	32	1	0	31	1	7	27	2	0	29	1	0	30	1	0	24	0	0	
SMB-2-5	32	1	0	30	1	5	31	4	12	32	3	2	32	1	0	25	2	1	
SMB-2-6	30	4	0	28	0	0	30	2	12	33	3	1	32	2	1	24	2	0	
SMB-2-7	154	10	6	147	6	0	134	5	4	143	11	26	142	7	2	122	6	0	
SMB-2-8	33	2	0	28	2	0	26	0	0	32	1	0	30	1	0	24	0	0	
SMB-2-9	34	4	16	28	4	0	27	0	2	33	2	0	31	2	1	24	1	0	
SMB-2-10	31	0	7	29	0	1	25	0	3	31	1	0	30	1	0	25	0	0	
SMB-2-11	31	0	0	29	0	0	25	0	0	29	0	0	30	0	0	25	0	0	
SMB-2-12	30	0	0	28	0	0	26	0	0	31	1	0	30	0	1	24	0	0	
SMB-2-13	31	0	0	29	0	0	26	1	4	32	0	1	31	3	0	25	0	0	
SMB-2-14	30	0	0	28	0	0	26	0	0	32	0	0	30	2	0	24	0	0	
SMB-2-15	30	0	0	28	0	0	28	2	1	31	0	0	31	0	0	24	1	1	
SMB-3-1	36	4	15	28	7	0	27	0	0	31	1	0	31	0	0	24	1	0	
SMB-3-2	41	5	19	29	6	0	27	0	3	36	1	8	33	7	1	26	2	0	
SMB-3-3	154	81	99	147	56	115	134	35	5	143	12	4	143	23	15	121	34	75	
SMB-3-4	154	10	0	147	10	2	131	5	4	141	10	3	142	12	0	121	7	11	
SMB-3-5	154	3	0	147	1	0	134	1	1	143	4	0	143	1	0	122	1	0	
SMB-3-6	33	1	0	29	1	0	27	0	3	30	3	0	30	1	0	24	0	0	
SMB-3-7	31	1	0	29	1	0	26	1	0	31	0	0	32	0	1	25	2	0	
SMB-3-8	31	3	0	31	0	2	30	3	3	29	4	0	30	0	0	24	0	0	
SMB-3-9	34	0	1	28	2	0	25	0	0	32	0	1	30	1	0	24	0	0	
Dry - Winter																			
SMB-2-1	25	15	24	14	9	13	12	0	0	9	0	0	16	1	0	14	0	0	
SMB-2-2	17	8	16	12	4	9	10	1	5	3	1	2	8	2	3	9	5	7	
SMB-2-3	14	0	1	17	0	0	15	0	1	9	0	0	14	0	0	14	0	0	
SMB-2-4	16	1	5	17	1	2	15	0	1	9	0	0	16	1	1	14	0	0	
SMB-2-5	14	0	0	18	1	6	16	1	0	10	1	3	14	1	0	14	0	0	
SMB-2-6	15	1	6	20	3	11	15	0	0	9	0	0	15	1	0	14	0	0	
SMB-2-7	79	55	73	70	41	69	73	8	17	62	19	45	86	5	0	79	10	6	
SMB-2-8	15	1	3	18	1	1	15	0	1	9	0	0	14	0	0	14	1	2	
SMB-2-9	14	0	0	19	1	1	15	0	0	9	0	0	14	0	0	14	0	2	

#### Appendix A Table 1 Exceedance Frequency for Santa Monica Bay Beaches Bacteria TMDL Monitoriu

Exceedance Frequency for Santa Monica Bay Beaches Bacteria TMDL Monitoring																			
		2008	•		2009	•		2010			2011	•		2012	•	2013			
Location	#	SS	GM	#	SS	GM													
SMB-2-10	15	0	0	16	0	1	15	0	3	9	0	0	15	0	0	15	1	2	
SMB-2-11	15	0	0	16	0	1	15	0	1	9	0	0	15	0	0	14	0	0	
SMB-2-12	14	0	0	17	1	5	16	2	3	9	0	0	15	1	2	15	1	4	
SMB-2-13	16	2	4	16	0	1	15	0	0	11	2	7	16	1	0	15	2	1	
SMB-2-14	15	1	0	17	1	6	16	1	0	9	0	0	16	0	0	15	1	1	
SMB-2-15	15	1	2	17	1	5	16	1	2	10	1	2	14	0	0	14	0	0	
SMB-3-1	14	0	6	19	2	6	15	0	0	9	0	0	14	0	0	14	1	3	
SMB-3-2	18	5	10	19	4	7	15	0	0	11	3	6	15	1	0	14	1	2	
SMB-3-3	79	32	66	70	36	69	73	19	39	62	10	18	86	17	48	79	35	60	
SMB-3-4	79	9	18	70	12	20	73	6	2	62	13	22	86	17	33	79	18	51	
SMB-3-5	79	2	0	70	2	2	73	2	0	62	5	6	86	5	0	79	9	11	
SMB-3-6	15	0	3	17	1	5	16	1	5	10	1	1	16	1	0	16	2	2	
SMB-3-7	15	2	5	19	2	3	16	2	4	9	0	0	14	0	1	14	0	0	
SMB-3-8	16	1	2	17	1	3	17	2	7	9	0	0	17	3	4	15	1	2	
SMB-3-9	14	0	2	19	2	4	15	0	0	9	0	0	14	0	0	14	0	0	
Wet	-		-		-	-						-		-	-				
SMB-2-1	4	4	4	5	3	4	10	1	4	14	3	3	8	2	2	8	1	1	
SMB-2-2	5	4	5	8	5	8	11	3	10	11	5	10	4	2	3	5	3	3	
SMB-2-3	7	2	4	7	4	5	10	5	8	13	2	5	8	3	3	7	2	3	
SMB-2-4	6	1	4	7	3	6	12	1	7	14	3	7	8	0	1	8	2	5	
SMB-2-5	7	2	4	6	2	2	11	4	9	13	6	8	9	4	6	8	3	4	
SMB-2-6	7	3	7	7	3	4	10	3	6	14	5	10	8	4	5	8	3	4	
SMB-2-7	29	29	29	44	31	43	52	29	50	55	38	50	33	13	25	31	13	27	
SMB-2-8	7	5	6	7	3	5	10	3	5	13	5	7	8	0	4	8	1	3	
SMB-2-9	7	4	7	7	3	5	10	3	4	13	8	10	8	3	7	8	2	3	
SMB-2-10	6	0	0	7	2	4	12	3	12	14	3	7	8	0	2	8	4	6	
SMB-2-11	6	0	0	7	3	6	12	2	7	14	4	9	8	0	1	8	1	4	
SMB-2-12	7	2	4	7	2	5	10	4	6	13	4	9	8	1	2	8	0	4	
SMB-2-13	6	1	2	7	2	5	12	1	5	14	4	8	8	2	5	8	2	5	
SMB-2-14	7	1	1	7	2	3	10	1	3	13	4	10	8	2	6	8	1	1	
SMB-2-15	7	2	4	7	3	4	10	2	6	13	7	12	8	4	8	8	2	3	
SMB-3-1	7	5	7	8	6	6	10	4	5	13	5	8	8	3	3	8	3	4	
SMB-3-2	8	4	8	7	5	5	10	5	7	14	6	14	8	3	4	8	3	4	
SMB-3-3	29	16	28	44	18	38	52	20	40	55	19	46	33	9	26	31	13	29	
SMB-3-4	29	21	29	44	27	43	52	25	42	55	33	51	33	22	33	31	16	28	

Appendix A Table 1 Exceedance Frequency for Santa Monica Bay Beaches Bacteria TMDL Monitoring

#### Appendix A Table 1

Exceedance Frequency for Santa Monica Bay Beaches Bacteria TMDL Monitoring


	2008 2009					2010		2011				2012		2013				
Location	#	SS	GM	#	SS	GM	#	SS	GM	#	SS	GM	#	SS	GM	#	SS	GM
SMB-3-5	29	11	20	44	15	43	52	16	39	55	20	44	33	7	16	31	13	26
SMB-3-6	6	2	5	7	5	6	12	2	8	14	8	11	8	3	4	8	2	5
SMB-3-7	8	4	7	8	5	6	10	4	5	13	7	10	8	4	6	8	1	5
SMB-3-8	6	1	0	7	2	6	12	2	7	14	5	10	8	1	2	8	3	6
SMB-3-9	7	4	7	7	3	5	10	2	5	13	7	12	8	2	3	8	2	3


# - Number of Samples


SS - Single Sample (Daily) Exceedances

GM - Geometric Mean Exceedances

# Heal the Bay Beach Report

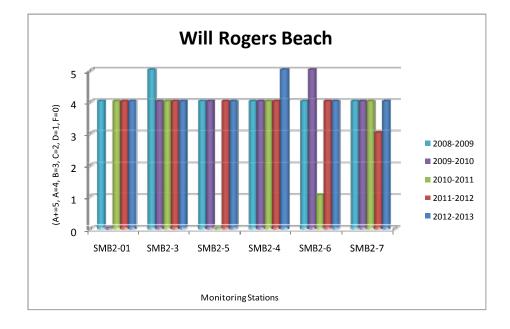

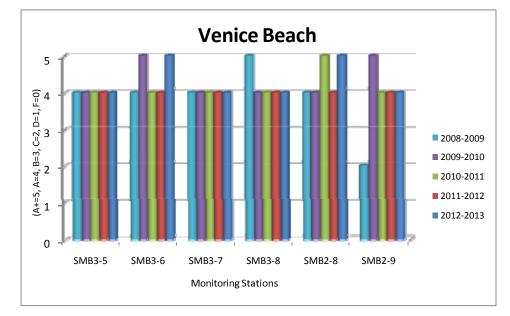


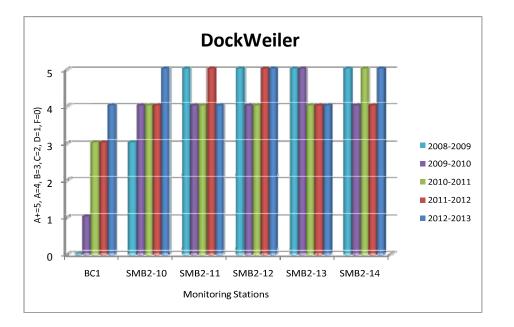



**Summer Dry Period** 

(April 1 – October 31)

# Heal the Bay Beach Report

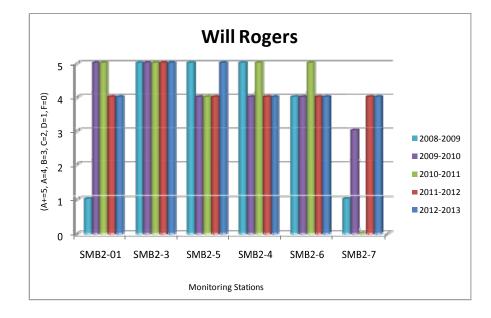

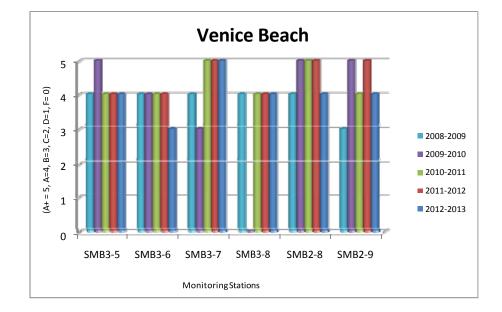


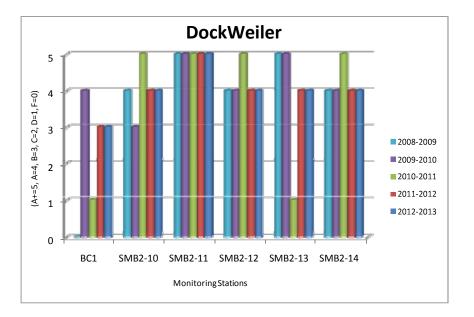



### Winter Dry Period

### (November 1 – March 31)

# Heal the Bay Beach Report

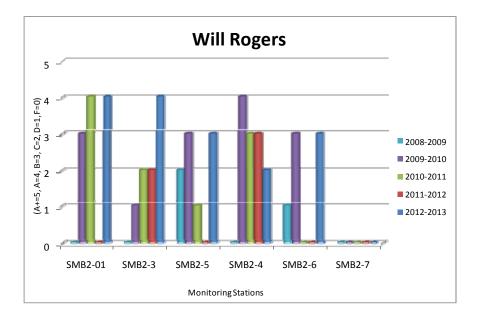


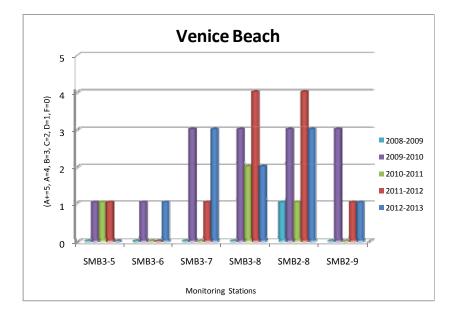

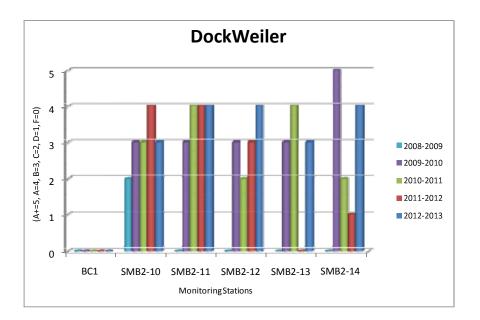

#### Wet Weather

(Year round)

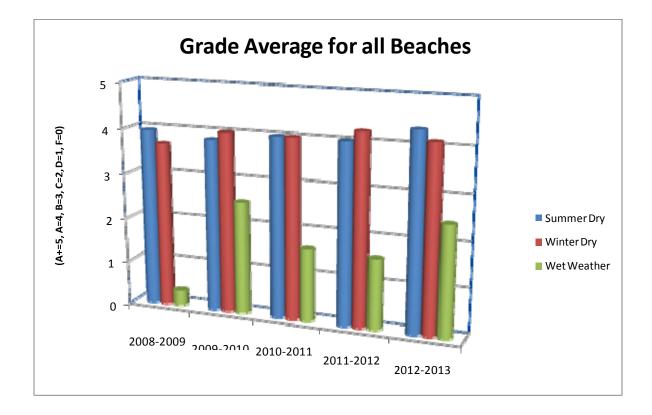

# JG 2/3 BEACH REPORT CARD

#### 2013-2014

		-	Winter Dry	
Beach	Location/ Shoreline Station	(April 1 - Oct 31)	(Nov 1 - Mar 31)	Year Round
Castle rock	Castlerock Drain (SMB 2-01)	A+		
	Santa Ynez drain (SMB 2-02)	A+	A -	
	17200 PCH (SMB 2-03)	A	A+	В
Will Rogers	Bay Club (SMP 2-05)	A+	A+	В
State Beach	Pulga (SMB 2-04)	A+	A+	A+
	Temescal canyon (SMB 2-06)	A	A+	С
	SMC (SMB 2-07)	А	В	F
	Montana Drain (SMB 3-01)	А	А	D
	Wilshire Blvd drain (SMB 3-02)	А	С	F
Santa Monica	SM Pier (SMB 3-03)	D	F	F
Beach	Pico Kenter (SMB 3-04)	А	А	F
	Stran Street (SMB 3-09)	A+	В	В
	Ashland (SMB 3-05)	A	А	D
	Rose Avenue (SMB 3-06)	A+	А	А
	Brooks Ave (SMB 3-07)	A	А	F
Venice Beach	Windward (SMB 3-08)	A+	A+	A+
	Venice Pier (SMB 2-08)	А	А	A+
	Topsail (SMB 2-09)	A	А	С
	Ballona Creek Mouth	А	А	F
	Culver Blvd drain (SMB 2-10)	А	А	F
	N. West Chester (SMB 2-11)	A	А	A+
Dock Weiler	World Way (SMB 2-12)	A+	A+	В
	Imperial HWY (SMB 2-13)	A	В	F
	HTP, 1 mile outfall (SMB 2-14)	A+	А	А
	Grand Ave (SMB 2-15)	А	А	А

Note: All shoreline station SMB 2-XX are within Jurisdictional Group 2, and SMB 3-XX are within Jurisdictional Grou

Appendix B

# Example Calibration, Field and Chain of Custody Forms

#### **Example Field Calibration Log Sheet**

			METE	R CALIBRAT	TIONS/FIEL	.D MEASUREI	MENTS STN	NO
	ed by:						Loca	tion:
Date:	94 - 140-	Tim	e:					
TEMPER	RATURE Me	ter MAKE/MODEL _	<u> </u>	S/N		Therm	ister S/N	Thermometer ID
Lab Testeo	against NIST	Thermometer/Th	ermister? N	Y Date			±°	C
								VG/WEDIAN OF POINTS
FIEIU RE	auniys # I _	#Z_	#J_	#'	<u> </u>	_ #J	_ WEDIAN	ºC Remark Qualifier
pH Mete	r Make <b>/</b> Model _	<i>X</i>	8	6/N		Electrode No	I	ype: gel liquid other
Sample:	FILTERED UN	IFILTERED	CONE SPLITTER	CHURN S	PLITTER	SINGLE POINT AT	FT DEEP	VERTICAL AVG. OF POINTS
pH	BUFFER	THEO-	pH	pH	SLOPE	MILLI-	TEMPERATURE COR	RECTION FACTORS FOR BUFFERS APPLIED? Y N
BUFFER	TEMP	RETICAL pH FROM	BEFORE ADJ.	AFTER ADJ.		VOLTS	BUFFER LOT NUM	
		TABLE					-	
pH 7						_		
pH 7							00 21-00-00	
pH 7	5.5							
pH								and a set of the set of
pH	\$2 Ts							
pH								
CHECK							СНЕСК рН:	
pH							Calit	pration Criteria: ± 0.2 pH units
Field R	eadings # 1	# 2	#3_	# 4	#5	ME	DIAN:	Units Remark Qualifier
SPECIEI						S/N	Sense	DIT Type: DIP FLOW-THRU OTHER
Sample. C	UNE SELLITER	GHORN SPLITTER	SINGLE FUINT	AI ILU	CCF VENIC	CAL AVG. OF		AUTO TEMP COMPENSATED METER
STD VALUE	STD TEMP		SC TER	STD LOT NO		STD EXPIR- ATION DATE	COMMENTS	MANUAL TEMP COMPENSATED METER
IALUL	T Ellon		NDJ.	LOTINO		ATION DATE		CORRECTION FACTOR APPLIED? Y N
								O 2012 SEVER OTHER SECTOR
								CORRECTION FACTOR=
								Calibration Criteria: the greater of 5 µS/cm or 3% of measured value
Field rea	idings # 1	#2	# 3	# 4	#5	MEDI	AN:μ	S/cm Remark Qualifier
DISSOL	/ED OXYGE	N Meter MAKEA	NODEL			S/N		Probe No.
Air Calibrat	ion Chamber ir	Water Air-S	Saturated Water	Air Calibr	ation Chambe	rin Air Winkl	er Titration Othe	r
Sample:		AT <b>ft</b> DE		LAVG. OF			THER	Stirrer Used? Y N
WATER	BAROMETR		SALINITY	DO	DO	Zero DO Chec	kmg/IL Ad	dj. to mg/L_Date:
TEMP ℃	PRESSURE mm Hg	E READING mg/L	CORR. FACTOR	BEFORE ADJ.	AFTER ADJ.			Thermister Check? Y N Date
			-					 Date: Time:
							174	Date: Time:
Calibratio	n Criteria: ± 0.3	ma/L				-		NGE
		5933 <sup>1</sup> 3 <b>4</b> 97				Dattery Offeck:	NEDEINE RA	1110L
Field rea	dings # 1	# 2	# 3	# 4	#5	MEDI	AN: mç	g/L Remark Qualifier

#### EXAMPLE Field Log

OBSERVATION	IS														
Weather:															
Water Color:					rity:										
Water Character	ristics (flow typ	be, odor, turbidi													
Other comments	s (trash, wildlif	e, recreational	uses, homeles	s activity, etc	. – Use notes s	ection if more room is needed):									
	GENERAL INFORMATION Date:														
Site ID: Personnel:				Sampl	ing										
GPS Coordinate	es: (lat)		(long)		Pi	cture/Video #:									
In situ WATER QUALITY MEASUREMENTS															
	Time	Temp	рН	<u>D.O.</u>	Elec Cond.	Turbidity									
		( <sup>0</sup> C)		<u>(mg/L)</u>	<u>(uS/cm)</u>	<u>(NTU)</u>									
COLLECTED W	ATER QUAL	ITY SAMPLES													
	Sample ID		Analysis	Time	Volum	ne Notes									
						Field blank									
						Field duplicate									
ADDITIONAL W	ATER QUAL	ITY SAMPLING	G NOTES:												

#### **Example Field Log**

Page 2 of 2

	FLOW MEASUREMENTS WITH VELOCITY METER         Estimated Total Width of Flowing Water (ft):       Distance measured from (circle): RIGHT or LEFT															
	Measurement Number	<sup>′</sup> 1	2	3	4	5	6	7	8	9	10	11	12	13	14	]
	Distance from Bank (ft)															
	Depth (ft)															_
	Velocity (ft/s)															
	FLOW MEASUREMENTS	WITH FL	ΟΑΤ Α	ND ST	OPWATCH Number of Flow Paths:											
	Fill out Pa	th # →	Pa	ath#	I	Path#		Path#		Path	n#	F	Path#			
۷	Vidth of Flow at <u><b>Top</b></u> of Mar	ked Secti	on:													
۷	Vidth of Flow at <u>Middle of</u> M	Marked Se	ection:													
۷	Vidth of Flow at <b>Bottom</b> of	Marked S	Section													
D	Depth of Flow at 0% of Top	Marked S	Sectior	):												
C	Depth of Flow at 25% of To	<b>p_</b> Marked	Sectio	n:												
C	Depth of Flow at 50% of To	<b>p</b> Marked	Sectio	n:												
C	Depth of Flow at 75% of To	<b>p_</b> Marked	Sectio	n:												
C	Depth of Flow at 100% of To	op Marke	d Sect	ion:												
C	Depth of Flow at 0% of Mide	dle Marke	d Sec	tion:												
C	Depth of Flow at 25% of Mic	ddle Mark	ked Se	ction:												
С	Depth of Flow at 50% of Mic	ddle Mark	ed Se	ction:												
C	Depth of Flow at 75% of Mic	ddle Mark	ked Se	ction:												
C	Depth of Flow at 100% of <u>M</u>	l <b>iddle</b> Mar	rked S	ection:												
С	Depth of Flow at 0% of Bott	tom Mark	ed Seo	ction												
C	Depth of Flow at 25% of <u>Bo</u>	<u>ttom Mar</u>	ked Se	ection:												
	Depth of Flow at 50% of <b>Bo</b>	<u>ttom Mar</u>	ked Se	ection:												
C	Depth of Flow at 75% of Bo	<u>ttom Mar</u>	ked Se	ection:												
C	Depth of Flow at 100% of B	ottom Ma	arked S	Section												
С	Distance Marked-off for Velo	ocity:														
Т	ime 1:															
Т	ime 2:															
Т	ime 3:															
		Specify	if mea	asurem	ents a	are in i	nche	s or fee	t usin	g "in"	or "ft'	,				
	FLOW MEASUREMENT W	VITH GRA		ED CC	NTAI	NER										
Container Volume: Percent Capture:																
	Time to fill container:		1													
╟╌	Minutes S Time1	Seconds	-													
-	Time2		1													
-	Time3		1													
•	<b>i</b>		-													

CHAIN OF CUSTODY RECORD																							
Com	bany:				Phone:			Job	No.									Page	of				
Proje	ct Manager:				Email:						Analy	/sis R	eques	sted	1		1	Test Instruc	tion & Corr	iments			
Proje	ct Name:				Project #	ŧ																	
Site N	Name:																						
& Ad	dress:				1	1																	
						Container																	
	Sample ID	Lab ID	Date	Time	Matrix	Number/Size	Pres.																
1																							
2																							
3																							
4																							
5																							
6																							
7																							
8																							
9																							
10																							
11																							
12																							
13																							
14																							
15																							
	ble Receipt: To Be Fil	led By Lab	т	urn Aroui	nd Time	Relinquished By:			1		Relinq	uisho	d By:			2		Test Instruction & Comments         Image: Comments of the second secon					
	Number of Container			ormal		Signature					Signati		u Dy.			2			su by.	0			
	ody Seals Yes N		Ru			Printed Name					olgriati												
				-							Data		<b>T</b> :										
Received in Good Condition Yes No Same Day							me			Date Time Received By						0							
Properly Cooled Yes No N/A 24 Hrs						Received By			1				y			2			3y	3			
Samples Intact Yes No N/A 48 Hrs						Signature					Signat												
Samples Accepted Yes No 72 Hrs						Printed Name Printed Name																	
						Date Ti	me	Date Time Date Time						Time									